

User Manual for PCB-4.2.0

an open source, interactive
printed circuit board
layout program

by Harry Eaton and PCB Contributors

This User Manual documents how to use PCB-4.2.0, the open source, interactive printed circuit board layout program.

Copyright © 1994, 1995, 1996, 1997, 2004 Thomas Nau

Copyright © 1997, 1998, 1999, 2000, 2001, 2002 Harry Eaton

Copyright © 2003, 2004, 2005, 2006, 2007, 2009 Dan McMahon

Copyright © 2004 DJ Delorie

Copyright © 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019 PCB Contributors

This program is free software; you may redistribute it and/or modify it under the terms of the GNU General Public License as published by the Free Software Foundation; either version 2 of the License, or (at your option) any later version.

This program is distributed in the hope that it will be useful, but WITHOUT ANY WARRANTY; without even the implied warranty of MERCHANTABILITY or FITNESS FOR A PARTICULAR PURPOSE.

See the **GNU General Public License** for more details.

Table of Contents

History	1
1 Overview	4
2 Introduction	5
2.1 Header	5
2.2 Symbols	5
2.3 Vias	5
2.4 Elements	6
2.5 Layers	7
2.6 Lines	8
2.7 Arcs	9
2.8 Polygons	9
2.9 Text	10
2.10 Nets	10
3 Getting Started	12
3.1 The Application Window	12
3.1.1 Menus	12
3.1.2 The Status-line and Input-field	15
3.1.3 The Layer Controls	15
3.1.4 The Tool Selectors	16
3.1.5 Layout Area	18
3.2 Log Window	18
3.3 Library Window	19
3.4 Netlist Window	19
3.5 Drawing and Removing Basic Objects	19
3.5.1 Common Drawing and Removing Methods	20
3.5.2 Lines	21
3.5.3 Arcs	21
3.5.4 Polygons and Rectangles	21
3.5.5 Text	22
3.5.6 Vias	22
3.5.7 Elements	22
3.5.8 Pastebuffer	24
3.6 Moving and Copying	24
3.7 Loading and Saving	25
3.8 Printing	25
3.9 Exporting a layout	27
3.9.1 Bill of materials (bom)	27
3.9.2 G-code (gcode)	27
3.9.3 Gerber (gerber)	29

3.9.4	Postscript (ps)	29
3.9.5	Encapsulated Postscript (eps)	29
3.9.6	Image (png)	29
3.9.7	Nelma (nelma)	29
3.9.8	GSvit (gsvit)	30
3.9.9	IPC-D-356 (ipcd356)	30
3.10	Connection Lists	30
3.11	Arrow Tool	31
3.12	Rats Nest	31
3.13	Design Rule Checking	32
3.14	Trace Optimizer	33
3.15	Searching for elements	34
3.16	Measuring distances	34
3.17	Vendor Drill Mapping	34
4	Autorouter	36
5	Toporouter	37
6	User Commands	38
7	Command-Line Options	39
7.1	General Options	39
7.2	General GUI Options	41
7.3	GTK+ GUI Options	42
7.4	lesstif GUI Options	42
7.5	Colors	42
7.6	Layer Names	43
7.7	Paths	44
7.8	Sizes	44
7.9	Commands	46
7.10	DRC Options	46
7.11	BOM Creation	47
7.12	G-code Options	47
7.13	Gerber Export	48
7.14	Postscript Export	49
7.15	Encapsulated Postscript Export	50
7.16	PNG Options	50
7.17	Nelma Options	51
7.18	IPC-D-356 Netlist Export	51
7.19	gsvit Options	51
7.20	lpr Printing Options	52
8	X11 Interface	53
8.1	Non-Standard X11 Application Resources	53
8.2	Actions	59
8.3	Default Translations	69

9	File Formats	71
9.1	Pad and Line Representation	71
9.2	Layout File Format	71
9.3	Element File Format	72
9.4	Font File Format	72
9.5	Netlist File Format	73
9.6	Library Contents File Format	74
9.7	Library File Format	74
9.8	File Syntax	75
9.8.1	Arc	75
9.8.2	Attribute	76
9.8.3	Connect	77
9.8.4	Cursor	77
9.8.5	DRC	77
9.8.6	Element	78
9.8.7	ElementArc	79
9.8.8	ElementLine	79
9.8.9	FileVersion	79
9.8.10	Flags	80
9.8.11	Grid	80
9.8.12	Groups	80
9.8.13	Layer	80
9.8.14	Line	81
9.8.15	Mark	82
9.8.16	Net	82
9.8.17	Netlist	82
9.8.18	Pad	82
9.8.19	PCB	83
9.8.20	Pin	83
9.8.21	PolyArea	84
9.8.22	Polygon	84
9.8.23	Rat	84
9.8.24	Styles	85
9.8.25	Symbol	86
9.8.26	SymbolLine	86
9.8.27	Text	86
9.8.28	Thermal	87
9.8.29	Via	87
9.9	Object Flags	88
9.10	PCBFlags	89

10	Library Creation	91
10.1	Old Style (m4) Libraries	91
10.1.1	Overview of Oldlib Operation	91
10.1.2	The Library Scripts	92
10.1.2.1	Scripts Used During Compilation	92
10.1.2.2	Scripts Used by PCB at Runtime	93
10.1.3	Creating an Oldlib Footprint	94
10.1.4	Troubleshooting Old Style Libraries	96
10.2	New Style Libraries	97
10.2.1	Creating Newlib Footprints	97
10.2.2	Modifying Newlib Footprints	98
11	Schematic Capture for PCB	99
11.1	gEDA	99
11.1.1	Set Up Project Directories	99
11.1.2	Set Up gEDA Config Files	99
11.1.3	Set Up gsch2pcb Config Files	100
11.1.4	Capture Schematics Using gschem	100
11.1.5	Create Any Unique PCB Footprints	100
11.1.6	Generate Initial PCB Design Using gsch2pcb	101
11.1.7	Layout Circuit Board	101
11.1.8	Forward Annotation of Schematic Changes	101
11.1.9	Generate Photoplot Files (RS-274X)	101
11.2	xcircuit	102
Appendix A	Installation	103
A.1	Quick Start	103
A.2	Running the configure Script	103
Appendix B	Trouble Shooting	104
B.1	HP Series 700 and 800	104
B.2	Sun SPARC architecture	104
B.3	Silicon Graphics	104
B.4	DEC Alpha	104
B.5	SCO Unix	104
B.6	Linux	105
B.7	FreeBSD and NetBSD	105
B.8	Problems related to X11	105
B.9	Problems related to TeX	105
Appendix C	Customizing the Menus	106
C.1	Resource Syntax	106
C.2	Menu Definitions	107
C.3	Menu Files and Defaults	108

Appendix D	Element Search/Regular Expressions	109
D.1	Element Search/Regular Expressions	109
Appendix E	Standard Drill Size Tables	111
E.1	American Standard Wire Size Drills	111
E.2	American Standard Letter Size Drills	111
E.3	Fractional Inch Size Drills	112
E.4	Metric Drills	112
Appendix F	Centroid (X-Y) File Format	115
F.1	Overview	115
F.2	File Format	115
F.3	Computation of Centroid and Rotation	115
Appendix G	Annotation File Format	117
G.1	Overview	117
G.2	File Format	117
G.2.1	*COMMENT*	117
G.2.2	*FILEVERSION*	117
G.2.3	*RENAME*	118
Appendix H	Action Reference	119
H.1	Core actions	119
H.1.1	AddRats	119
H.1.2	ApplyVendor	120
H.1.3	Atomic	120
H.1.4	Attributes	120
H.1.5	AutoPlaceSelected	120
H.1.6	AutoRoute	121
H.1.7	ChangeClearSize	121
H.1.8	ChangeDrillSize	121
H.1.9	ChangeFlag	121
H.1.10	ChangeHole	122
H.1.11	ChangeJoin	122
H.1.12	ChangeName	122
H.1.13	ChangeOctagon	122
H.1.14	ChangePaste	123
H.1.15	ChangePinName	123
H.1.16	ChangeSize	123
H.1.17	ChangeSquare	123
H.1.18	ClearOctagon	124
H.1.19	ClearSquare	124
H.1.20	ClrFlag	124
H.1.21	Connection	124
H.1.22	Delete	125

H.1.23	DeleteRats	125
H.1.24	DisableVendor	125
H.1.25	DisperseElements	125
H.1.26	Display	126
H.1.27	djopt	128
H.1.28	DRC	130
H.1.29	DumpLibrary	130
H.1.30	elementlist	130
H.1.31	elementsetattr	130
H.1.32	EnableVendor	131
H.1.33	execcommand	131
H.1.34	ExecuteFile	131
H.1.35	Flip	131
H.1.36	FontEdit	131
H.1.37	FontSave	132
H.1.38	FreeRotateBuffer	132
H.1.39	GlobalPuller	132
H.1.40	Import	132
H.1.41	ListLayertypes	134
H.1.42	LoadFootprint	134
H.1.43	LoadFrom	134
H.1.44	LoadVendorFrom	134
H.1.45	MarkCrosshair	135
H.1.46	Message	135
H.1.47	MinClearGap	135
H.1.48	MinMaskGap	135
H.1.49	Mode	135
H.1.50	MorphPolygon	136
H.1.51	MoveLayer	137
H.1.52	MoveObject	137
H.1.53	MoveToCurrentLayer	137
H.1.54	Netlist	138
H.1.55	New	138
H.1.56	OptAutoOnly	138
H.1.57	PasteBuffer	139
H.1.58	Polygon	139
H.1.59	Puller	140
H.1.60	Quit	140
H.1.61	Redo	140
H.1.62	Relocate	141
H.1.63	RemoveSelected	141
H.1.64	ReNUMBER	141
H.1.65	ReNUMBERBlock	141
H.1.66	ReNUMBERBuffer	141
H.1.67	Report	142
H.1.68	ReportDialog	142
H.1.69	RipUp	142
H.1.70	RouteStyle	142

H.1.71	SaveSettings	143
H.1.72	SaveTo	143
H.1.73	Select	143
H.1.74	SetFlag	144
H.1.75	SetLayertype	144
H.1.76	SetOctagon	145
H.1.77	SetSame	145
H.1.78	SetSquare	145
H.1.79	SetThermal	145
H.1.80	SetupRouteStyle	146
H.1.81	SetValue	146
H.1.82	setvialayers	146
H.1.83	SmartDisperse	147
H.1.84	Teardrops	147
H.1.85	ToggleHideName	148
H.1.86	ToggleVendor	148
H.1.87	Undo	148
H.1.88	UnloadVendor	149
H.1.89	Unselect	149
H.2	common actions	149
H.2.1	LayersChanged	149
H.2.2	LibraryChanged	150
H.2.3	NetlistChanged	150
H.2.4	PCBChanged	150
H.2.5	RouteStylesChanged	150
H.3	gtk actions	151
H.3.1	gtk About	151
H.3.2	gtk AdjustStyle	151
H.3.3	gtk Benchmark	151
H.3.4	gtk Busy	151
H.3.5	gtk Center	152
H.3.6	gtk Command	152
H.3.7	gtk Cursor	152
H.3.8	gtk DoWindows	153
H.3.9	gtk EditLayerGroups	153
H.3.10	gtk Export	153
H.3.11	gtk GetXY	154
H.3.12	gtk ImportGUI	154
H.3.13	gtk Load	154
H.3.14	gtk Pan	154
H.3.15	gtk Popup	154
H.3.16	gtk Print	155
H.3.17	gtk PrintCalibrate	155
H.3.18	gtk Save	155
H.3.19	gtk SelectLayer	155
H.3.20	gtk SetUnits	155
H.3.21	gtk SwapSides	156
H.3.22	gtk ToggleView	156

H.3.23	gtk Zoom	156
H.4	lesstif actions	157
H.4.1	lesstif About	157
H.4.2	lesstif AdjustSizes	157
H.4.3	lesstif AdjustStyle	157
H.4.4	lesstif Benchmark	158
H.4.5	lesstif Command	158
H.4.6	lesstif Cursor	158
H.4.7	lesstif Debug	159
H.4.8	lesstif DebugXY	159
H.4.9	lesstif DoWindows	159
H.4.10	lesstif DumpKeys	159
H.4.11	lesstif EditLayerGroups	160
H.4.12	lesstif Export	160
H.4.13	lesstif GetXY	160
H.4.14	lesstif ImportGUI	160
H.4.15	lesstif LibraryShow	160
H.4.16	lesstif Load	161
H.4.17	lesstif LoadVendor	161
H.4.18	lesstif NetlistShow	161
H.4.19	lesstif Print	161
H.4.20	lesstif PrintCalibrate	161
H.4.21	lesstif PromptFor	161
H.4.22	lesstif Return	162
H.4.23	lesstif Save	162
H.4.24	lesstif SelectLayer	162
H.4.25	lesstif SetUnits	162
H.4.26	lesstif SwapSides	163
H.4.27	lesstif ToggleView	163
H.4.28	lesstif Zoom	163
Appendix I	Glossary	165
Index of Resources		166
Index of Actions, Commands and Options		168
Index of Concepts		171

History

`Pcb` is a handy tool for laying out printed circuit boards.

`Pcb` was first written by Thomas Nau for an Atari ST in 1990 and ported to UNIX and X11 in 1994. It was not intended as a professional layout system, but as a tool which supports people who do some home-developing of hardware.

The second release 1.2 included menus for the first time. This made `Pcb` easier to use and thus a more important tool.

Release 1.3 introduced undo for highly-destructive commands, more straightforward action handling and scalable fonts. Layer-groups were introduced to group signal-layers together.

Release 1.4 provided support for add-on device drivers. Two layers (the solder and the component side) were added to support SMD elements. The handling of libraries was also improved in 1.4.1. Support for additional devices like GERBER plotters started in 1.4.4. The undo feature was expanded and the redo-feature added in 1.4.5.

harry eaton took over `pcb` development beginning with Release 1.5, although he contributed some code beginning with Release 1.4.3

Release 1.5 provides support for rats-nest generation from simple net lists. It also allows for automatic clearances around pins that pierce a polygon. A variety of other enhancements including a Gerber RS-274X driver and NC drill file generation have also been added.

Release 1.6 provides automatic screen updates of changed regions. This should eliminate most of the need for the redraw (*R* key). Also some changes to what order items under the cursor are selected were made for better consistency - it is no longer possible to accidentally move a line or line point that is completely obscured by a polygon laying over top of it. Larger objects on the upper most layers can be selected ahead of smaller objects on lower layers. These changes make operations more intuitive. A new mode of line creation was added that creates two line on 45 degree angles with a single click. The actual outline of the prospective line(s) are now shown during line creation. An arc creation mode was added. Drawn arcs are quarter circles and can be useful for high frequency controlled impedance lines. (You can have eighth circle arc if the source is compiled with `-DARC45`, but be aware that the ends of such arcs can never intersect a grid point). Two new flags for pins and vias were created - one indicates that the pin or via is purely a drill hole and has no copper annulus. You can only toggle this flag for vias - for elements, it must be an integral part of the element definition. The other flag controls whether the pad will be round or octagonal. There is also now a feature for converting the contents of a buffer into an element.

Release 1.6.1 added the ability to make groups of action commands bound to a single X11 event to be undone by a single undo. Also a simple design rule checker was added - it checks for minimum spacing and overlap rules. Plus many fixes for bugs introduced with the many changes of 1.6

Release 1.7 added support for routing tracks through polygons without touching them. It also added support for unplated drill files, and drawing directly on the silk layer. A Netlist window for easily working with netlist was also added.

Release 2.0 adds an auto-router, a new simpler library mechanism, much improved support for graphically creating (and editing) elements, viewable solder-mask layers (and editing), snap to pins and pads, netlist entry by drawing rats, element files (and libraries)

that can contain whole sub-layouts, metric grids, improved user interface, a GNU autoconf/automake based build system, and a host of other improvements.

Release 4.0.0 adds a IPC-D-356 netlister, relocate plugin, smartdisperse plugin, RenumberBlock and RenumberBuffer plugin, teardrops plugin, tooltips in the GTK UI and footprints.

Release 4.0.1 fixes a number of bugs.

Release 4.0.2 fixes a number of bugs.

Release 4.1.0 is a new features release (pcb file format change).

Release 4.1.1 fixes a number of bugs.

Release 4.1.2 fixes a number of bugs.

Release 4.1.3 fixes a number of bugs.

Release 4.2.0 is a new features release (pcb file format change).

Special thanks goes to:

Thomas Nau (who started the project and wrote the early versions).

C. Scott Ananian (who wrote the auto-router code).

Bernhard Daeubler (Bernhard.Daeubler@physik.uni-ulm.de)

Harald Daeubler (Harald.Daeubler@physik.uni-ulm.de)

DJ Delorie (djdelorie@users.sourceforge.net)

Larry Doolittle (ldoolitt@recycle.lbl.gov)

Dan McMahill (danmc@users.sourceforge.net)

Roland Merk (merk@faw.uni-ulm.de)

Erland Unruh (Erland.Unruh@malmo.trab.se)

Albert John FitzPatrick III (ajf_nylorac@acm.org)

Boerge Strand (borges@ifi.uio.no)

Andre M. Hedrick (hedrick@Astro.Dyer.Vanderbilt.Edu)

Anthony Blake (who wrote the toporouter code).

PCB Contributors:

Peter Clifton, Andrew Poelstra, Markus Hitter, Ben Jackson, Felix Ruoff,

Sergey Alyoshin, Dima Kogan, Jerome Marchand, Jean Richard, Bob Paddock,

Milan Prochac, Britton Leo Kerin, Roland Lutz, Charles Parker,

Jared Casper, Stuart Brorson, Ahmed El-Mahmoudy, Josef Wolf,

Krzysztof Kościuszkiewicz, Mike Crowe, Andrew Armenia, Jan Damborsky,

Wiley E. Hill, Sergey Stepanov, Vladimir Zhbanov, Peter Brett,

Steven Michalske, Leo Barring, Gareth Edwards, Anton Dubniak,

Kai-Martin Knaak, Keith Packard, Patrick Bernaud, Robert Drehmel,

Erich Heinzle, Marco Ciampa, Eugene Mikhantiev, Jorge Barros de Abreu,

Richard Hughes, Eric Brombaugh, Benjamin Bergman, Braddock Gaskill,

Dan White, Alan Somers, Richard Barlow, Bdale Garbee, Stanislav Brabec,

Levente Kovacs, Ed Maste, Uwe Hermann, Ivan Stankovic, Peter S. May,

Igor2, Felix K (kuhlix), rosvall, Martin, Christian Amsüss,

Johann Klammer, Newell Jensen, Rob Spanton, Bert Timmerman.

who provided all sorts of help including porting Pcb to several operating systems and platforms, bug fixes, library enhancement, user interface suggestions and more. In addition to

these people, many others donated time for bug-fixing and other important work. Some of them can be identified in the source code files. Thanks to all of them. If you feel left out of this list, I apologize; please send me an e-mail and I'll try to correct the omission.

1 Overview

Pcb is an open source printed circuit board editor. Pcb includes many professional features such as:

- Up to 16 copper layer designs by default. By changing a compile time setting, this can be set as high as needed.
- Blind and Buried Vias
- RS-274X (Gerber) output
- NC Drill output
- Centroid (X-Y) data output
- IPC-D-356 (rev. 0) netlist data output
- Postscript and Encapsulated Postscript output
- Nelma numerical analysis package export
- GSvit numerical analysis package export
- Autorouter
- Toporouter
- Trace optimizer
- Rats nest
- Design Rule Checker (DRC)
- Connectivity verification
- Pcb is Free Software
- Can interoperate with free schematic capture tools such as gEDA and xcircuit
- Runs under Linux, NetBSD, Solaris, and other similar operating systems.
- Windows version is available

2 Introduction

Each layout consists of several, mostly independent, objects. This chapter gives an overview of the object types and their relationship to each other. For a complete description of how to use `Pcb`, refer to [Chapter 3 \[Getting Started\], page 12](#). The layout is generated on-screen on a grid that can have its origin at any desired location. The X coordinate increases to the right, Y increases down to the bottom. All distances and sizes in `Pcb` are measured in mils (0.001 inch). One unit on the coordinate display is one mil in distance on the board. The grid may be set on a metric pitch, but is only correct to within the nearest +/- 0.01 mil because `Pcb` stores all dimensions as integer multiples of 1/100 of a mil or 0.00001 inch.

The sections in this chapter are sorted by the order of appearance of the objects within a layout file.

2.1 Header

The top object is the layout itself. It has a header with settings and layout values. Settings and layout values include the 'release' number, 'FileVersion', 'PCB' name, 'PCB' layout main dimensions, 'Grid' settings, 'PolyArea' setting, 'Thermal' setting, 'DRC' settings, 'Flags', 'Groups' layer stack, and routing 'Styles'

2.2 Symbols

The layout uses a set of symbols that resides at the first logical level. Each symbol is uniquely identified by a seven bit ASCII code. All layout objects share the same set of symbols. These symbols are used to form text objects on the silkscreen and copper layers. Undefined symbols are drawn as filled rectangles.

Every font file is preprocessed by a user-defined command when it is loaded. For details see 'fontCommand', [Section 8.1 \[Resources\], page 53](#).

2.3 Vias

Vias provide through-hole connectivity across all layers. While vias look a lot like element pins, don't use vias for adding elements to the layout, even if that seems easier than creating a new element. The default solder-mask will cover over vias, so you won't be able to solder to them. Of course, you can change this so that vias also have solder-mask cut-outs, but it is not the default. Vias are also useful for defining arbitrary drill points such as those used for mounting a board. Vias used in this way have a special flag set so that they have no annular copper ring, and also appear in the unplated drill file. *Ctrl-H* key over a via switches it between being a pure-mounting hole and a regular via. You can assign a name to a via, which is useful during the creation of new element definitions.

Blind and buried vias are supported. Blind and buried vias exist only on specified layer range. The first and last layer can be assigned using appropriate action, menu item or keys: *Ctrl-Shift-F* to set active layer as first layer, *Ctrl-Shift-T* to set last layer and *Ctrl-Shift-P* to convert via to through-hole.

Blind and buried vias have colored half-circles drawn on top to designate first and last layer..

2.4 Elements

Elements represent the components on a board. Elements are loaded from ASCII coded files in a similar manner to the layout file itself, or from the library selector window. An element is composed of lines and arcs on the silk-screen layer (used to define the package outline), pins (or pads for SMD) and three labels that define the description, the element's layout-name (which also appears on the silk-screen layer) and its value. You can choose which of the names are displayed on the screen with the **Screen** menu; however, the silk screen in the printout will always show the layout-name. Element pins are contained on the first logical level and so reside on all layers, but the pads of surface-mount elements reside on only the component or solder layers. An element can have a mixture of pins, pads (on one or both sides), and mounting holes.

A mark is used to position the element with respect to the cross hair during pasting. The mark will lie on a grid point when the element is positioned. The mark is drawn as a small diamond shape, but is only visible when *both* the `silk` and `pins/pads` layers are visible. All parts of an element are treated as one unit, except for the name. It is not possible to delete a single pin or move only part of an element on the layout. You can resize separate pieces of an element, but doing so is usually a bad idea. You can move/rotate the element name independently of the element it belongs to. When you move an element name, a line is drawn from the cursor to the element mark so it is easy to tell which element the name belongs to.

Each pin and pad has two string identifiers, one is the "name" which is a functional description of the pin (*e.g.* "clock in") and the other is the "number" of the pin which is used to identify it in a netlist. The "number" is usually an integer, but it can be any string. You can edit the "name" of each pin of an element, but the "number" is embedded in the element definition and is determined when the new element is first created. Pads are similar to lines on a layer but they must be oriented either vertically or horizontally. Pads can have either rounded or square ends. Pins can be round, square, or octagonal.

Elements are supported by several special layers: `silk`, `pins/pads` and `far-side`. The `silk` layer shows the package outline and also holds legend text and element names. The `pins/pads` layer is used to toggle whether the element's pins and pads are displayed. The `far-side` layer controls visibility of objects (silkscreen and pads) that are on the far (*i.e.* not currently viewed) side of the board.

The "oldlib" style of footprint libraries distributed with `Pcb` rely upon the M4 macro processor. M4 is typically installed under the name `m4` on most unix-like operating systems. It is recommended that you use the GNU version of M4 to avoid limitations found in some vendor implementations. See the `m4` man page on your system for more information. Every element file is preprocessed by a user-defined command when the file is read. For details see '`elementCommand`', [Section 8.1 \[Resources\], page 53](#). `m4`, the default value of '`elementCommand`', allows you to create libraries for package definitions that are shared by all elements. The old element libraries distributed with `Pcb` expect `m4` or an equivalent to be the `elementCommand`. The new library scheme simply has each element stored in a self-contained file, so there is no need to learn `m4` to add to the libraries.

`Pcb` can create a list of all connections from one (or all) elements to the others or a list of unconnected pins. It can also verify the layout connections against a netlist file.

The element's 'layout-name' is the name used to identify the element in a netlist file (see [Section 9.5 \[Netlist File\], page 73](#)).

The old libraries, or very old (pre-1.6) layout files may have incorrect pin numbering since there was no concept of pin numbers when they were created. Pcb uses the order of appearance of the pin definitions in the layout or library file if it uses the old format, but there is no guarantee that it will be correct for these old objects.

Be aware that a few of the old library parts may still be incorrectly implemented regarding pin-numbering. All of the DIL (Dual- Inline-Pins) parts are correct and most of the others are too, but you should verify the pin numbering of any non-DIL part before using an old library part. (use the 'generate object report' in the **Info** menu to see what Pcb thinks a pin's number is) All of the old library names begin with a ~, so you can easily identify them. The old libraries also *may* contain other sorts of errors, including incorrect pin spacing, silkscreen overlapping solder areas, etc. **Check carefully any element in the old library before using it!** As the new library grows, the old library will be pared down to at least remove all of the elements with errors, but this will take time.

You can make your own element definitions graphically now. Simply draw vias for the pins, lines on the solder and/or component layers for surface-mount pads (they must be either horizontal or vertical), and lines and arcs on the silkscreen layer for the silkscreen outline. You should *name* (*N* key) each via and copper line with the pin *number*. Once you are happy with the geometry, select everything that is to become part of the element, then choose 'convert selection to element' from the **Select** menu. Afterwards you can make pin (or pad) one square if you like, and give the element its various names. You can also give the pins and pads their functional names. Note that the element mark corresponds to the position you click after choosing the conversion from the menu, so decide where the mark goes and make sure it falls on a grid point before you request the conversion. If the vias/lines are not named, then the pin numbering will correspond to the order in which they were placed.

When you create a new element, remember that silkscreen lines should *never* overlap the copper part of the pins or pads, as this can interfere with soldering. The silkscreen should identify the maximum extent of the element package so it is easy to see how close elements can be placed together.

If you want to make an element similar to an existing one, you can break an element into constituent pieces from the **Buffer** menu. Paste the pieces to the layout, make the necessary changes, then convert it back into an element. If the pin numbers haven't changed, there is no need to name each via/line as they are pre-named when the element was broken apart. When you create a new element, you can save it to a file in order to have easy access to it the next time you run Pcb.

2.5 Layers

Every layout consists of several layers that can be used independently or treated as a group. Layer groups can be used to logically separate (and color-code) different traces (*e.g.* power and signal); however, all layers within a group reside on the same physical copper layer of a board, so using different layers within the same group won't provide electrical separation where they touch or overlap. For details, see 'layerGroups', [Section 8.1 \[Resources\], page 53](#). Each layer is drawn in a color defined in the resource file and identified

by a name that you can change (for details see ‘`layerColor`’, [Section 8.1 \[Resources\]](#), [page 53](#).) Layers are really just containers for line, arc, polygon, and text objects. The component and solder layers contain SMD elements as well, but the file structure doesn’t reflect that fact directly.

Each layer group represents a physical layer on the printed circuit board. If you want to make a four layer board, you’ll need to have at least four layer groups. Connections between layer groups are established only through element pins and vias. The relationship between a specific layer and the board itself is configurable from the ‘**Edit layer groups**’ option in the **Settings** menu. The layer groups corresponding to the physical layers: *component-side* and *solder-side* are always defined and you must map at least one logical layer to each, even if you plan to make a single-sided board. You are not obligated to put tracks on either of them. Surface mount elements always reside on either the component-side or the solder-side layer group. When you paste an element from the buffer, it will go onto whichever side of the board you are viewing. You can swap which side of the board you are viewing by pressing the *Tab* key, or by selecting ‘**view solder side**’ from the **Screen** menu. The layer groups just have a name or number associated with them - where they are sandwiched in the board is left for you to tell the manufacturer.

The silkscreen layer is special because there are actually two silkscreen layers, one for the top (component) and one for the bottom (solder) side of the board. Which silk layer you draw on is determined by the side of the board that you are viewing. If you are viewing the component side, then drawing on the silk layer draws to the component-side silk layer.

The netlist layer is another special layer. It shows rat’s-nest lines (*i.e.* guides that show how the netlist expects the element to interconnect). If you make this the active layer, you can use the Line tool to add entries into the netlist, or to delete connections from the netlist window. Except for these two purposes, you should not make the netlist layer the active layer. Usually there is no need to do this because a separate schematic package should be used to create the netlist. **Pcb** can automatically draw all of the rats from the netlist. In some cases you may want to make a small change without going to the trouble of modifying the schematic, which is why this facility is provided.

2.6 Lines

Lines are used to draw tracks on the pc board. When in the line mode, each *Btn1* press establishes one end of a line. Once the second point is defined, the line is drawn and a new line started where the first one ended. You can abandon the new starting point in favor of another by pressing *Ctrl-Btn1*, or *Btn3*, but don’t use *Btn2*. The undo function (*U* key or ‘**Undo**’ from the **Edit** menu) will take you back point by point if you use it while in the line mode.

New lines can be restricted to 45 degree angles if desired. You can toggle this restriction on and off while creating lines by pressing the *period* key. If the 45 degree restriction is turned on, then the */* (forward slash) key can be used to cycle through three different modes of 45 degree line creation. One mode just creates a single line forced to the nearest 45 degree vector. The next mode creates two lines from the start to end points such that the first line leaves the start point at a 90 degree vector, and the second line enters the end point on a 45 degree vector. The last mode creates two lines such that the first line leaves

the start point on a 45 degree vector and arrives at the end point on a 90 degree vector. You can temporarily swap between the last two modes by holding the *Shift* key down.

It is simple to edit a line object by breaking it into pieces (insert point mode), moving an end point or the whole line (*Arrow tool*), or changing the layer it resides on (*M* key moves the line under the pointer to the active layer). In the case when two line segments meet at exactly the same point you can delete the intermediate point, otherwise the delete tool removes an entire line. Feel free to experiment since Pcb will allow you to undo and redo anything that materially affects your work. If you switch active layers in the midst of placing lines a via will automatically be placed, when necessary, in order to continue the connection. The via can be through-hole via or buried/blind via; the via type is controlled by option *Auto buried vias*.

If you draw a line inside a polygon, it will either plow through the polygon creating a clearance, or touch the polygon. This behavior is selectable in the **Settings** menu for new lines. To change the behavior of an existing line, hit the *J* key with the cross hair over the line. You can increase the size of the clearance by 2 mils on each edge with the *K* key. *Shift-K* will decrease the clearance by 2 mils. The increment may be changed from 2 mils through the application resource file. The clearance can be also increased, decreased and set by the *ChangeClearSize* action.

Lines do not need to intersect the center of a pin, pad, via, or other line for Pcb to understand that they make electrical connection. If the connection is too tenuous, running the design rule checker will report that the connection may break if the line width shrinks slightly.

2.7 Arcs

Pcb can handle arcs of any angular extent, but when you create an arc with the Arc tool, it will be a quarter circle (this means they always bend a right angle). Arcs are very similar to lines otherwise. They are created on the active layer and have the same thickness that new lines will have. The various clicks for creating lines work pretty much the same way for creating arcs. In order to make the arc curve in the desired direction, drag the mouse along the tangent line from the starting position towards the end position. If the grid is too coarse, it may not be possible to distinguish whether you've moved over then up, or up then over, so if you can't seem to make the arc go in the direction you want, try pressing the *Shift* key while drawing the arc. Decreasing the grid spacing may also help. Alternatively you can draw the wrong arc, then rotate and move it where you want. Like the Line tool, after an arc is drawn a new starting point is established at the end point.

Whenever a starting point is established by either the Line or Arc tools it will be retained if you switch directly between the tools (e.g. *F2* key for Lines, *F8* key for Arcs). Arcs can either touch or clear polygons just like lines do. Of course connection searches, undo and all the other features you'd expect work with arcs too.

2.8 Polygons

Sometimes it's useful to fill large areas with solid copper. The way to do this is with polygons. Polygons can be created in either the polygon mode or the rectangle mode. In the polygon mode, you'll have to define each corner of the polygon with a mouse click (*Btn1*). When the last point is clicked exactly on top of the starting point, the polygon is

finished. Since this can be hard to do, the *Shift-P* key will enter the final point for you, closing the polygon. If the 45 degree angle restriction is turned on and you try to close the polygon when it is not possible, you'll get a warning instead. If you haven't finished entering a polygon, but want to undo one (or more) of the points that you've already defined, use the undo command (*U* key).

With the rectangle tool, defining the two diagonally opposite corners is sufficient, but of course the resulting polygon is a rectangle. Like lines, a polygon can be edited by deleting, inserting and moving the points that define it. Pins and vias *always* clear through polygons without touching them when first positioned. You must add a thermal with the thermal tool in order to connect pins and vias to polygons. Thermals can be added and removed by clicking *Btn1* with the thermal tool over the pin or via. The thermal tool always places a thermal to polygons on the active layer, so if the tool doesn't seem to work, it's probably because the polygon you want to touch is not on the active layer. You can change the style of thermal used or make a solid connection by holding down *Shift* while clicking *Btn1* with the thermal tool over the pin or via.

Pcb is capable of handling complex polygons, but using a number of simpler ones improves performance of the connection tracing code. You also must be careful not to create polygons that touch or overlap themselves. The fabricated board may not look the way you expect if you violate this principle. It is always ok to have two (or more) polygons touch or overlap each other, but not for points within the same polygon to do so.

The great advantage to this new polygon behavior is that simple or complex ground and/or power planes can be easily made with polygons and seen on the screen. If you don't want this auto-clearance behavior, or you load a layout created by an early version of Pcb, the old behavior (shorts to all piercing pins and vias) is available. A 'ChangeSize' operation (*S* key) toggles a polygon between the new and old polygon/pin behavior.

2.9 Text

Text objects should be used to label a layout or to put additional information on the board. Elements have their 'layout-name' labels on the silk-screen layer. If you are making a board without a silkscreen, you can use copper text to label the elements, but you have to do this manually.

Text is always horizontal when first created, but the rotate mode can align it along 0, 90, 180 and 270 degree angles. Text on the far side of the board will automatically appear mirror-imaged.

Warning: TEXT OBJECTS ON A COPPER LAYER CREATE COPPER LINES BUT THEY ARE NOT SCANNED FOR CONNECTIONS OR TESTED FOR CREATING SHORTS VS. THE NETLIST. NEITHER ARE TEXT OBJECTS TESTED AGAINST ANY DESIGN RULES.

2.10 Nets

Layout files also contain the netlist that describes how the elements are supposed to be interconnected. This list of connections can be loaded from a netlist file (see [Section 9.5 \[Netlist File\], page 73](#)), or entered by drawing rat-lines as described previously. Each net has a name and routing style associated with it. The net contains a list of all element *layout-name* names and pin *numbers* that should be connected to the net. Loading a netlist

file will replace all existing nets with the ones from the file. The *Netlist* window provides an easy way to browse through the net list. You can display the rat's-nest by selecting 'optimize rats-nest' from the **Connects** menu. If you move or rotate elements, the rat's-nest will automatically follow the movements, but they won't necessarily show the shortest paths until you optimize them again.

3 Getting Started

The goal of this chapter is to give you enough information to learn how `Pcb` works and how to develop your layouts to make the best use of `Pcb`'s features. All event translations (*i.e.* the buttons and keys you press) refer to the default application resource file shipped with `Pcb`. There is probably no need to change this unless your window manager uses some of the button events itself; however, if you *want* to customize the behavior of `Pcb` then changing the resource file is usually the best way to do it.

Get yourself a printout of this chapter and *User Commands*, if you haven't already done so, and follow the examples.

Start `Pcb` (the actual command will use all lower-case letters) without any additional options. If you get the error message:

```
can't find default font-symbol-file 'default_font'
```

then the font searchpath or filename in the application resource file is wrong. Be sure that your `m4` program supports search paths. If not, get GNU `m4`. For other messages, see [Appendix B \[Trouble Shooting\]](#), page 104. Another quick-start is provided by `pcbtest.sh` in the `'src'` directory. If some features don't seem to work, try running `pcbtest.sh`, if that works, then `Pcb` hasn't been installed properly.

3.1 The Application Window

The main window consists of five areas: the menu at the top, the layer control in the upper left, the tool buttons located below the layer controls, the Layout area to the right of these, and the status line at the bottom of the window.

3.1.1 Menus

The menus are located at the top of the Layout area. Most, but not all, of their functions are also available from the keyboard. Similarly, some functions are only achievable through the keyboard or command entry. Some menu entries such as `'center layout'` in the **Screen** menu require a certain cross hair position. In this case a prompt message will popup at the bottom of the screen with wording similar to the following:

```
move pointer to the appropriate screen position and press a button
```

Any mouse button will do the job, whereas any key except the arrow (cursor) keys will cancel the operation. If it seems like the menu hasn't done what you expected, check to see if it is waiting for the position click. For details see [Section 8.2 \[Actions\]](#), page 59.

Pressing `Btn3` in the Layout area also pops up a menu with many of the most common operations (except when you're in the midst of drawing a line or arc). When a choice in the `Btn3` popup menu needs a cross hair position, it uses the position where the cross hair was when `Btn3` was pressed. For example, to get detailed information on an object, place the cross hair over the object, press `Btn3`, then choose `'object report'`. If you pop up the `Btn3` menu but don't want to take any of the actions, click on one of the headers in the menu.

File This menu offers a choice of loading, saving and printing data, saving connection information to a file or quitting the application. Most of the entries in the **File** menu are self explanatory. Selecting `'Print...'` pops up a printer control

dialog. Several output formats are available from the ‘**Export...**’ menu item. Presently *PostScript*, *encapsulated PostScript*, and *GerberX* are some of the supported filetypes. The *GerberX* driver produces all of the files necessary to have the board professionally manufactured. The connection saving features in the **File** menu produce outputs in an arcane format that is not too useful. They do *not* produce netlist files.

Edit The **Edit** menu provides the usual cut, copy, paste which work on selections. To learn how to create complex selections, see [Section 3.11 \[Arrow Tool\]](#), page 31. The **Edit** menu also provides access to Undo and Redo of the last operation. These can also be accomplished with the *U* key and *Shift-R* key. Finally, the **Edit** menu allows you to change the names of: the layout, the active layer, or text objects on the layout.

Routes Style

The **Edit** menu allows you to select a group of line thickness, via diameter, via drill size, and clearance (keepaway) (collectively called a "routing style") to be copied to the "active" sizes. You can also change the names given to the routing styles and adjust their values from this menu. The "active" sizes are also adjustable from this menu. The "active" sizes are shown in the status-line and control the initial size of new vias, drilling holes, lines, clearances, text-objects and also the maximum dimensions of the board layout.

View The **View** menu supports most functions related to the whole Layout area. There are various entries to change the grid to some popular values, the zoom factor, and which kind of element name is displayed. You can also re-align the grid origin and turn on and off the display of the grid. Before changing the grid alignment, I recommend that you zoom in as close as possible so that you're sure the grid points appear exactly where you want them.

The **View** menu also allows you to turn on and off the visibility of the solder-mask layer. When the solder-mask layer is made visible it obscures most of the layout, so only turn this on when you really want to know what the solder-mask will look like. The solder-mask that you see belongs to the side of the board you are viewing, which can be changed with the ‘**Flip up/down**’ option, also found in the **View** menu. When the solder-mask is displayed, the pin and pad clearance adjustments (see [Section 2.6 \[Line Objects\]](#), page 8) alter the size of mask cut-outs.

Settings The **Settings** menu controls several operating configuration parameters. The ‘**all-direction lines**’ entry controls the clipping of lines to 45-degree angles. You can also control whether moving individual objects causes the attached lines to "rubber band" with the move or not from the **Settings** menu. Another entry controls whether the starting clip angle for the two-line mode (see [Section 2.6 \[Line Objects\]](#), page 8) alternates every other line. You can also control whether element names must be unique from the **Settings** menu. When unique element names are enforced, copying a new element will automatically create a unique ‘**layout-name**’ name for it provided that the name originally ended with a digit (*e.g.* U7 or R6). The **Settings** menu allows you to control whether the cross hair will snap to pins and pads even when they are off-grid. Finally you can

control whether new lines and arcs touch or clear intersecting polygons from this menu.

Select This menu covers most of the operations that work with selected objects. You may either (un)select all visible objects on a layout or only the ones which have been found by the last connection scan see . You can delete all selected objects from this menu. Other entries in the **Select** menu change the sizes of selected objects. Note that a select action only affects those objects that are selected *and* have their visibility turned on in the Layer Control panel. The **Select** menu also provides a means for selecting objects by name using unix [Appendix D \[Regular Expressions\]](#), page 109.

Buffer From the **Buffer** menu you may select one out of five buffers to use, rotate or clear its contents or save the buffer contents to a file. You can also use the ‘**break buffer elements to pieces**’ entry to de-compose an element into pieces for editing. Note: only objects with visibility turned on are pasted to the layout. If you have something in a buffer, then change which side of the board you are viewing, the contents of the buffer will automatically be mirrored for pasting on the side you are viewing. It is not necessary to clear a buffer before cutting or copying something into it - it will automatically be cleared first.

Connects The entries available through the **Connects** menu allow you to find connections from objects and to manipulate these. You can also optimize or erase rat’s nests from this menu. Finally, the ‘**auto-route all rats**’ entry allows you to auto-route all connections show by the rat’s nest. The auto-router will use any visible copper layer for routing, so turn off the visibility of any layers you don’t want it to use. The auto-router will automatically understand and avoid any traces that are already on the board, but it is not restricted to the grid. Finally, the auto-router routes using the active sizes (except for nets that have a route-style defined). Pcb always knows which tracks were routed by the auto-router, and you can selectively remove them without fear of changing tracks that you have manually routed with the ‘**rip-up all auto-routed tracks**’ entry in the **Connects** menu. The ‘**design rule checker**’ entry runs a check for copper areas that are too close together, or connections that touch too tenuously for reliable production. The DRC stops when the first problem is encountered so after fixing a problem be sure to run it again until no problems are found.

Warning: **COPPER TEXT IS IGNORED BY THE DRC CHECKER.**

Info The ‘**generate object report**’ entry from the **Info** menu provides a way to get detailed information about an object, such as its coordinates, dimensions, etc. You can also get a report summarizing all of the drills used on the board with ‘**generate drill summary**’. Lastly, you can get a list of all pins, pads and vias that were found during a connection search.

Window The **Window** menu provides a way to bring each of Pcb’s windows to the front. The *Library* window is used to bring elements from the library into the paste-buffer. The *Message Log* window holds the various messages that Pcb sends to the user. The *Netlist* window shows the list of connections desired.

Now that you’re familiar with the various menus, it’s time to try some things out. From the **File** menu choose ‘**Open . . .**’, navigate to the tutorial folder, then load the file ‘**tut1.pcb**’.

3.1.2 The Status-line and Input-field

The status-line is located at the bottom edge of the main window. During normal operation the status information is visible there. When a selected menu operation requires an additional button click, the status-line is replaced by a message telling you to position the cursor and click. When a text input is required, the status-line is replaced by the Input-field which has a prompt for typing the input.

The status-line shows, from left to right, the side of the board that you are viewing (*Tab* key changes this), the current grid values, if new lines are restricted to 45 degrees, which type of 45 degree line mode is active, whether rubberband move and rotate mode is on (R), and the zoom factor. This information is followed by the active line-width, via-size and drilling hole, keepaway spacing, and text scaling. Last is the active buffer number and the name of the layout. An asterisk appearing at the far left indicates that the layout has been modified since the last save. Note that the name of the layout is not the same thing as the filename of the layout. Change the grid factor to 1.0 mm from the **Screen** menu. Observe how the status line shows the new grid setting. Except for the case of the metric grid, all dimensions in the status line are in units of 0.001 inch (1 mil).

The input-field pops up (temporarily replacing the status-line) whenever user input is required. Two keys are bound to the input field: the *Escape* key aborts the input, *Return* accepts it. Let's change the name of a component on the board to see how the input-field works. Position the cross hair over R5, and press the *N* key. The input field pops-up showing the name for you to edit. Go ahead and change the name, then hit return. Notice the name of the element changed. Now undo the change by pressing the *U* key. You can position the cross hair over the name, or the element before pressing the *N* key.

Now select 'realign grid' from the **Screen** menu. Notice that the status line has been replaced with an instruction to position the cursor where you want a grid point to fall. In this case, since the cross hair can only fall on a grid point, you must move the tip of the finger cursor to the place where you want a grid point to appear. Do not worry that the cross hair is not coincident with the cursor. Click *Btn1* at your chosen location. See how the grid has shifted, and the status line has returned.

The present cross hair position is displayed in the upper right corner of the window. Normally this position is an absolute coordinate, but you can anchor a marker at the cross hair location by pressing *Ctrl-M* (try it now) and then the display will read both the absolute cross hair position as well as the difference between it and the marker. The numbers enclosed in < > are the X and Y distances between the cross hair and the mark, while the numbers enclosed in parenthesis are the distance and angle from the mark to the cross hair. The values displayed are always in units of 0.001 inch (1 mil). Pressing *Ctrl-M* again turns the marker off.

3.1.3 The Layer Controls

The layer control panel, located in the upper left, is used to turn on and off the display of layer groups and to select the active drawing layer. If a layer hasn't been named, the label "(unknown)" is used as the default. If this happens, it probably means the application resources are not installed properly.

The upper buttons are used to switch layers on and off. Click <*Btn1*> on one or more of them. Each click toggles the setting. If you turn off the currently active layer, another

one that is visible will become active. If there are no others visible, you will not be able to turn off the active layer. When the layers are grouped, clicking on these buttons will toggle the visibility of all layers in the same group. This is a good idea because layers in the same group reside on the same physical layer of the actual board. Notice that this example has 2 groups each having 3 layers, plus two other layers named ‘unused’. Use the ‘Edit layer groups’ option in the ‘Settings’ menu to change the layer groupings in the lesstif GUI or the ‘Preferences’ dialog from the ‘File’ menu in the GTK+ GUI. Note that changing the groupings can radically alter the connectivity on the board. Grouping layers is only useful for helping you to color-code signals in your layout. Note that grouping layers actually reduces the number of different physical layers available for your board, so to make an eight layer board, you cannot group any layers.

The *far side* button turns on and off the visibility of elements (including SMD pads) on the opposite (to the side you’re viewing) board side, as well as silk screening on that side. It does not hide the x-ray view of the other copper layers, these must be turned off separately if desired. Use the *tab* key to view the entire board from the other side. To see a view of what the back side of the board will actually look like, make the solder layer the active layer then press *tab* until the status line says "solder" on the right, then turn off the visibility of all layers except solder, pins/pads, vias, and silk. Now turn them all back on.

The lowest button, named *active*, is used to change the active drawing layer. Pressing `<Btn1>` on it pops up a menu to select which layer should be active. Each entry is labeled with the layer’s name and drawn in its color. The active layer is automatically made visible. The active layer is always drawn on top of the other layers, so the ordering of layers on the screen does not generally reflect the ordering of the manufactured board. Only the solder, component, silkscreen, and solder-mask layers are always drawn in their physical order. Bringing the active layer to the top makes it easier to select and change objects on the active layer. Try changing the active layer’s name to *ABC* by selecting ‘edit name of active layer’ from the ‘Edit’ menu. Changing the active layer can also be done by pressing keys `1..MAX_LAYER`.

Turn off the visibility of the component layer. Now make the component layer the active layer. Notice that it automatically became visible. Try setting a few other layers as the active layer. You should also experiment with turning on and off each of the layers to see what happens.

The netlist layer is a special layer for adding connections to the netlist by drawing rat lines. This is not the recommended way to add to the netlist, but occasionally may be convenient. To learn how to use the netlist layer see [Section 2.10 \[Net Objects\]](#), page 10.

3.1.4 The Tool Selectors

The tool selector buttons reside below the layer controls. They are used to select which layout tool to use in the drawing area. Each tool performs its function when *Btn1* is pressed. Every tool gives the cursor a unique shape that identifies it. The tool selector buttons themselves are icons that illustrate their function. Each layout tool can also be selected from the keyboard:

<i>F1</i> key	Via tool
<i>F2</i> key	Line tool
<i>F3</i> key	Arc tool
<i>F4</i> key	Text tool

<i>F5</i> key	Rectangle tool
<i>F6</i> key	Polygon tool
<i>F7</i> key	Buffer tool
<i>F8</i> key	Delete tool
<i>F9</i> key	Rotate tool
<i>Insert</i> key	Insert-point tool
<i>F10</i> key	Thermal tool
<i>F11</i> key	Arrow tool
<i>F12</i> key	Lock tool

Some of the tools are very simple, such as the Via tool. Clicking *Btn1* with the Via tool creates a via at the cross hair position. The via will have the diameter and drill sizes that are active, as shown in the status line. The Buffer tool is similar. With it, *<Btn1>* copies the contents of the active buffer to the layout, but only those parts that reside on visible layers are copied. The Rotate tool allows you to rotate elements, arcs, and text objects 90 degrees counter-clockwise with each click. Holding the *Shift* key down changes the Rotate tool to clockwise operation. Anything including groups of objects can be rotated inside a buffer using the rotate buffer menu option.

The Line tool is explained in detail in [Section 2.6 \[Line Objects\]](#), page 8. Go read that section if you haven't already. Activate the Line tool. Set the active layer to the solder layer. Try drawing some lines. Use the *U* key to undo some of the lines you just created. Zoom in a bit closer with the *Z* key. Draw some more lines. Be sure to draw some separate lines by starting a new anchor point with *Ctrl-Btn1*. Change the 'crosshair snaps to pin/pads' behavior in the **Settings** menu. Now draw a line. Notice that the new line points must now always be on a grid point. It might not be able to reach some pins or pads with this setting. Increase the active line thickness by pressing the *L* key. Note that the status line updates to reflect the new active line thickness. Now draw another line. Before completing the next line, make the component layer active by pressing the *4* key. Now finish the line. Notice that a via was automatically placed where you switched layers. Pcb does not do any checks to make sure that the via could safely be placed there. Neither does it interfere with your desire to place lines haphazardly. It is up to you to place things properly when doing manual routing with the Line tool.

The Arc tool is explained in detail in [Section 2.7 \[Arc Objects\]](#), page 9. Its use is very similar to the Line tool.

The Rectangle tool, Polygon tool and Thermal tool are explained in detail in [Section 2.8 \[Polygon Objects\]](#), page 9. Go read that section. Remember that the Thermal tool will only create and destroy thermals to polygons on the active layer. Use the Rectangle tool to make a small copper plane on the component layer. Now place a via in the middle of the plane. Notice that it does not touch the plane, and they are not electrically connected. Use the Thermal tool to make the via connect to the plane. Thermals allow the via or pin to be heated by a soldering iron without having to heat the entire plane. If solid connections were made to the plane, it could be nearly impossible to solder. Shift-click on the via with the Thermal tool to change the style of thermal used or to make the connection solid. Click on the via again with the Thermal tool to remove the connection to the plane.

The Insert-point tool is an editing tool that allows you to add points into lines and polygons. The Insert-point tool enforces the 45 degree line rule. You can force only the shorter line segment to 45 degrees by holding the *Shift* key down while inserting the point.

Try adding a point into one of the lines you created. Since line clipping is turned on, you may need to move the cross hair quite far from the point where you first clicked on the line. Turn off the line clipping by selecting ‘**all-direction lines**’ from the **Settings** menu (or hit the *Period* key). Now you can place an inserted point anywhere. Try adding a point to the rectangle you made earlier. Start by clicking somewhere along an edge of the rectangle, then move the pointer to a new location and click again.

The delete-mode deletes the object beneath the cursor with each *Btn1* click. If you click at an end-point that two lines have in common, it will replace the two lines with a single line spanning the two remaining points. This can be used to delete an "inserted" point in a line, restoring the previous line. Now delete one of the original corner points of the polygon you were just playing with. To do this, place the cross hair over the corner and click on it with the Delete tool. You could also use the *Backspace* key if some other tool is active. Try deleting some of the lines and intermediate points that you created earlier. Use undo repeatedly to undo all the changes that you’ve made. Use redo a few times to see what happens. Now add a new line. Notice that you can no longer use redo since the layout has changed since the last undo happened. The undo/redo tree is always pruned in this way (*i.e.* it has a root, but no branches).

The Arrow tool is so important, it has its own section: [Section 3.11 \[Arrow Tool\], page 31](#). Go read it now.

The Lock tool allows you to lock objects on the layout. When an object is locked, it can’t be selected, moved, rotated, or resized. This is useful for very large objects like ground planes, or board-outlines that are defined as an element. With such large objects, nearly anywhere you click with the Arrow tool will be on the large object, so it could be hard to draw box selections. If you lock an object, the Arrow tool will behave as if it didn’t exist. You cannot unlock an object with undo. You must click on it again with the Lock tool. If an object is locked, previous changes to it cannot be undone either. When you lock an object, a report message about it is popped up and will always tell you what object it is, and that it is locked if you just locked it. Other than noticing your inability to manipulate something, the only way to tell an object is locked is with a report from the **Info** menu. Use the Lock tool sparingly.

3.1.5 Layout Area

The layout area is where you see the layout. The cursor shape depends on the active tool when the pointer is moved into the layout area. A cross hair follows the mouse pointer with respect to the grid setting. Select a new grid from the *Screen* menu. The new value is updated in the status line. A different way to change the grid is *Shift<Key>g* to decrease or *<Key>g* to increase it, but this only works for English (integer mil) grids. The grid setting is saved along with the data when you save a pcb layout. For homemade layouts a value around 50 is a good setting. The cursor can also be moved in the layout area with the cursor (arrow) keys or, for larger distances, by pressing the *Shift* modifier together with a cursor key.

3.2 Log Window

This optional window is used to display all kind of messages including the ones written to *stderr* by external commands. The main advantage of using it is that its contents are saved

in a scrolling list until the program exits. Disabling this feature by setting the resource *useLogWindow* to *false* will generate popup windows to display messages. The *stderr* of external commands will appear on *Pcbs stderr* which normally is the parent shell. I suggest you iconify the log window after startup for example by setting **log.iconic* to *true* in the resource file. If *raiseLogWindow* is set *true*, the window will deiconify and raise itself whenever new messages are to be displayed.

3.3 Library Window

The library window makes loading elements (or even partial layouts) easy. Just click the appropriate library from the list on the left. A list of its elements then appears on the right. Select an element from the list by clicking on its description. Selecting an element from the library will also automatically copy the element into the active buffer, then invoke the *Buffer* tool so you can paste it to the layout. Elements in the old library should be taken with a grain of salt (*i.e.* check them carefully before using). The old library names all begin with *~* so you can easily distinguish between the old and new libraries. All of the elements in the new library should be thoroughly vetted, so you can use them with confidence. The new libraries are stored simply as directories full of element files, so making additions to the new library is easy since there is no need to learn *m4*. For details on the old libraries, check-out [Section 9.7 \[Library File\]](#), page 74 and [Section 9.6 \[Library Contents File\]](#), page 74. For details on the format of an element file used for the new libraries, see [Section 9.3 \[Element File\]](#), page 72.

3.4 Netlist Window

The netlist window is very similar to the library window. On the left is a list of all of the nets, on the right is the list of connections belonging to the chosen net. The chosen net is highlighted in the list and also shown on the second line of the window in red. If the net name has a star to the left of it then it is "disabled". A disabled net is treated as if it were not in the net list. This is useful, for example, if you plan to use a ground plane and don't want the ground net showing up in the rat's nest. You can enable/disable individual nets by double-clicking the net name. If you want to enable or disable all nets at once, there are two buttons at the top of the netlist window for this purpose.

The button labeled 'Sel Net On Layout' can be used to select (on the layout) everything that is connected (or is supposed to be connected) to the net. If you click on a connection in the connection list, it will select/deselect the corresponding pin or pad in the layout and also center the layout window where it is located. If you "Find" ('lookup connection' in the **Connects** menu [also *F* key]), a pin or pad it will also choose the net and connection in the netlist window if it exists in the netlist.

If no netlist exists for the layout, then the netlist window does not appear. You can load a netlist from a file from the **File** menu. The format for netlist files is described in [Section 9.5 \[Netlist File\]](#), page 73.

3.5 Drawing and Removing Basic Objects

hace begging gutting here, and do a real-world tutorial example.

There are several ways of creating new objects: you can draw them yourself, you can copy an existing object (or selection), or you can load an element from a file or from the Library window. Each type of object has a particular tool for creating it.

The active tool can be selected from the tool selectors in the bottom left corner or by one of the function keys listed earlier in this chapter. Each *<Btn1>* press with the tool tells the application to create or change the appropriate object or at least take the first step to do so. Each tool causes the cursor to take on a unique shape and also causes the corresponding tool selector button to be highlighted. You can use either cue to see which tool is active.

Insert mode provides the capability of inserting new points into existing polygons or lines. The 45 degree line clipping is now enforced when selected. Press and hold the shift key while positioning the new point to only clip the line segment to the nearer of the two existing points to 45 degrees. You can also toggle the 45-degree clipping in the middle of a point insertion by pressing the *<Key>*. If the shift key is not depressed and the 45 degree line clipping mode is on, both new line segments must be on 45 degree angles - greatly restricting where the new point may be placed. In some cases this can cause confusion as to whether an insertion has been started since the two new lines may be forced to lie parallel on top of the original line until the pointer is moved far from the end points.

Removing objects, changing their size or moving them only applies to objects that are visible when the command is executed.

3.5.1 Common Drawing and Removing Methods

There are several keystrokes and button events referring to an *object* without identifying its type. Here's a list of them:

<Btn1> creates (or deletes) an object depending on the current mode.

<Key>BackSpace or *<Key>Delete* removes the visible object at the cursor location. When more than one object exists at the location, the order of removal is: via, line, text, polygon and element. The drawn layer order also affects the search - whatever is top - most (except elements) is affected before lower items. Basically all this means that what is removed is probably just what you expect. If for some reason it isn't, undo and try again. Only one object is removed for each keystroke. If two or more of the same type match, the newest one is removed.

Use *<Key>s* and *Shift<Key>s* to change the size (width) of lines, arcs, text objects, pins, pads and vias, or to toggle the style of polygons (whether pins and vias automatically have clearances).

<Key>n changes the name of pins, pads, vias, the string of a text object, or the currently displayed label of an element.

<Key>m moves the line, arc, or polygon under the cross hair to the active layer if it wasn't on that layer already.

<Key>u (undo) recovers from an unlimited number of operations such as creating, removing, moving, copying, selecting etc. It works like you'd expect even if you're in the midst of creating something.

Shift<Key>r restores the last undone operation provided no other changes have been made since the undo was performed.

<Key>tab changes the board side you are viewing.

For a complete list of keystrokes and button events see [Section 8.3 \[Translations\]](#), page 69.

3.5.2 Lines

To draw new lines you have to be in *line-mode*. Get there either by selecting it from the *Tool palette* or by pressing $\langle Key \rangle F2$. Each successive *notify* event creates a new line. The adjustment to 45 degree lines is done automatically if it is selected from the *Display* menu. You can toggle the 45 degree mode setting by pressing the $\langle Key \rangle$. (That is the period key). When 45 degree enforcement is turned on there are three distinct modes of line creation: a single line on the closest 45 degree vector towards the cross hair (but not necessarily actually ending at the cross hair), two lines created such that the first leaves the start point on a 90 degree vector and the second arrives at the cross hair on a 45 degree vector, and finally two lines created such that the first leaves the start point on a 45 degree vector and the second arrives at the cross hair on a 90 degree vector. These last two modes always connect all the way from the start and end points, and all lines have angles in 45 degree multiples. The $\langle Key \rangle /$ cycles through the three modes. The status line shows a text icon to indicate which of the modes is active and the lines following the cross hair motion show the outline of the line(s) that will actually be created. Press $\langle Key \rangle Escape$ to leave line-mode.

$\langle Key \rangle l$, $Shift \langle Key \rangle l$ and the entries in the *Sizes* menu change the initial width of new lines. This width is also displayed in the status line.

3.5.3 Arcs

An Arc is drawn with the *arc-tool*. Get there either by selecting it from the *Tool palette* or by pressing $\langle Key \rangle F8$. Press *Btn1* to define the starting point for the arc. Drag the mouse towards the desired end point along the path you want the arc to follow. The outline of the arc that will be created is shown on the screen as you move the mouse. Arcs are always forced to be 90 degrees and have symmetrical length and width (i.e. they are a quarter circle). The next *Btn1* click creates the arc. It will have the same width as new lines (displayed in the status line) and appear on the active layer. The arc leaves the starting point towards the cross hair along the axis whose distance from the cross hair is largest. Normally this means that if you drag along the path you want the arc to follow, you'll get what you want. If the grid is set to the arc radius, then the two distances will be equal and you won't be able to get all of the possible directions. If this is thwarting your desires, reduce the grid spacing ($!Shift \langle Key \rangle G$) and try again.

3.5.4 Polygons and Rectangles

A polygon is drawn by defining all of its segments as a series of consecutive line segments. If the first point matches a new one and if the number of points is greater than two, then the polygon is closed. Since matching up with the first point may be difficult, you may use $Shift \langle Key \rangle p$ to close the polygon. The $Shift \langle Key \rangle p$ won't work if clipping to 45 degree lines is selected and the final segment cannot match this condition. I suggest you create simple convex polygons in order to avoid a strong negative impact on the performance of the connection scanning routines. The *rectangle-mode* is just an easy way to generate rectangular polygons. *Polygon-mode* also is selected by $\langle Key \rangle F6$ whereas *rectangle-mode* uses $\langle Key \rangle F4$. Pressing a $\langle Btn1 \rangle$ at two locations creates a rectangle by defining two of its corners. $\langle Key \rangle Insert$ brings you to *insert-point-mode* which lets you add additional points to an already existing polygon. Single points may be removed by moving the cross hair to them and selecting one of the delete actions (*remove-mode*, *BackSpace*, or *Delete*. This only works if the remaining polygon will still have three or more corners. Pressing $\langle Key \rangle u$

or $\langle Key \rangle p$ while entering a new polygon brings you back to the previous corner. Removing a point does not force clipping to 45 degree angles (because it's not generally possible). Newly created polygons will not connect to pins or vias that pierce it unless you create a thermal (using the thermal mode) to make the connection. If the edge of a polygon gets too close to a pin or via that lies outside of it, a warning will be issued and the pin will be given a special color. Increasing the distance between them will remove the warning color.

3.5.5 Text

Pressing $\langle Key \rangle F5$ or clicking one of the text selector buttons changes to *text-mode*. Each successive notify event ($\langle Btn1 \rangle$) pops up the input line at the bottom and queries for a string. Enter it and press $\langle Key \rangle Return$ to confirm or $\langle Key \rangle Escape$ to abort. The text object is created with its upper left corner at the current pointer location. The initial scaling is changed by $\langle Key \rangle t$ and $Shift \langle Key \rangle t$ or from the *Sizes* menu.

Now switch to *rotate-mode* and press $\langle Btn1 \rangle$ at the text-objects location. Text objects on the solder side of the layout are automatically mirrored and flipped so that they are seen correctly when viewing the solder-side.

Use $\langle Key \rangle n$ to edit the string.

TEXT OBJECTS ON COPPER LAYERS CREATE COPPER LINES BUT THEY ARE NOT SCANNED FOR CONNECTIONS. If they are moved to the silkscreen layer, they no longer create copper.

3.5.6 Vias

The initial size of new vias may be changed by $\langle Key \rangle v$ and $Shift \langle Key \rangle v$ or by selecting the appropriate entry from the *Sizes* menu. $Mod1 \langle Key \rangle v$ and $Mod1 Shift \langle Key \rangle v$ do the same for the drilling hole of the via. The statusline is updated with the new values. Creating a via is similar to the other objects. Switch to *via-mode* by using either the selector button or $\langle Key \rangle F1$ then press $\langle Key \rangle]$ or $\langle Btn1 \rangle$ to create one. $\langle Key \rangle n$ changes the name of a via. If you want to create a mounting hole for your board, then you can place a via where you want the hole to be then convert the via into a hole. The conversion is done by pressing $!Ctrl \langle Key \rangle h$ with the cross hair over the via. Conceptually it is still a via, but it has no copper annulus. If you create such a hole in the middle of two polygons on different layers, it will short the layers. Theoretically you could arrange for such a hole not to be plated, but a metal screw inserted in the hole would still risk shorting the layers. A good rule is to realize that holes in the board really are vias between the layers and so place them where they won't interfere with connectivity. You can convert a hole back into a normal via with the same keystroke used to convert it in the first place.

The via can be converted to blind or buried via using appropriate action, menu item or keys: $Ctrl-Shift-F$ to set active layer as first layer, $Ctrl-Shift-T$ to set last layer and $Ctrl-Shift-P$ to convert via back to through-hole via.

3.5.7 Elements

Some of the functions related to elements only work if both the package layer and the pin layer are switched on.

Now that you're familiar with many of the basic commands, it is time to put the first element on the layout. First of all, you have to load data into the paste buffer. There are four ways to do this:

- 1) load the data from a library
- 2) load the data from a file
- 3) copy data from an already existing element
- 4) convert objects in the buffer into an element

We don't have any elements on the screen yet nor anything in the buffer, so we use number one.

Select *lsi* from the menu in the library window press `<Btn1>` twice at the appropriate text-line to get the MC68030 CPU. The data is loaded and the mode is switched to *pastebuffer-mode*. Each notify event now creates one of these beasts. Leave the mode by selecting a different one or by `<Key>Escape` which resets all modes.. The cross hair is located at the *mark* position as defined by the data file. Rotating the buffer contents is done by selecting the *rotate* entry of the *Buffer* menu or by pressing `Shift<Key>F3`. The contents of the buffer are valid until new data is loaded into it either by a cut-to-buffer operation, copy-to-buffer operation or by loading a new data file. There are 5 buffers available (possibly more or less if changed at compile time with the `MAX_BUFFER` variable in 'globalconfig.h'). Switching between them is done by selecting a menu entry or by `Shift<Key>1..MAX_BUFFER`. Each of the two board sides has its own buffers.

The release includes all data files for the circuits that are used by the demo layout. The elements in the LED example are not found in the library, but you can lift them from the example itself if you want. If you have problems with the color of the cross hair, change the resource *cross hairColor* setting to a different one.

Now load a second circuit, the MC68882 FPU for example. Create the circuit as explained above. You now have two different unnamed elements. Unnamed means that the layout-name of the element hasn't been set yet. Selecting *description* from the *Display* menu displays the description string of the two circuits which are CPU and FPU. The values of the circuits are set to MC68030 and MC68882. Each of the names of an element may be changed by `<Key>n` at the elements location and editing the old name in the bottom input line. Naming pins and vias is similar to elements. You can hide the element name so that it won't appear on the board silkscreen by pressing `<key>h` with the cursor over the element. Doing so again un-hides the element name.

Entering `:le` and selecting an element data file is the second way to load circuits.

The third way to create a new element is to copy an existing one. Please refer to [Section 3.6 \[Moving and Copying\], page 24](#).

The fourth way to create a new element is to convert a buffer's contents into an element. Here's how it's done: Select the *Via-tool* from the *Tool pallet*. Set the grid spacing to something appropriate for the element pin spacing. Now create a series of vias where the pins go. Create them in pin number order. It is often handy to place a reference point (`!Ctrl<Key>m`) in the center of the first pin in order to measure the location of the other pins. Next make a solder-side layer the active layer from the *active-layer* popup menu. Now draw the outline of the element using lines and arcs. When you're done, select everything that makes up the element with a box selection (`<Btn3Down> drag, <Btn3Up>`). Now select "cut to buffer" from the *Buffer* menu. Position the cursor over the center of pin 1 and press the left button to load the data into the buffer. Finally select "convert buffer to element" from the *Buffer* menu. You'll only want to create elements this way if they aren't already

in the library. It's also probably a good idea to do this before starting any of the other aspects of a layout, but it isn't necessary.

To display the pinout of a circuit move to it and press *Shift<Key>d* or select *show pinout* from the *Objects* menu. A new window pops up and displays the complete pinout of the element. This display can be difficult to read if the component has been rotated 90 degrees :-(therefore, the new window will show an un-rotated view so the pin names are readable. *<Key>d* displays the name of one or all pins/pads inside the Layout area, this is only for display on-screen, it has no effect on any printing of the layout.

You also may want to change a pin's or pad's current size by pressing *<Key>s* to increase or *Shift<Key>s* to decrease it. While this is possible, it is not recommended since care was probably taken to define the element structure in the first place. You can also change the thickness of the element's silkscreen outline with the same keys. You can change whether a pin or SMD pad is rounded or square with the *<Key>q*. SMD pads should usually have squared ends. Finally, you can change whether the non-square pins are round or octagonal with the *!Ctrl<Key>o*.

SMD elements and silkscreen objects are drawn in the "invisible object" color if they are located on the opposite side of the board.

For information on element connections refer to [Section 3.10 \[Connection Lists\]](#), page 30.

3.5.8 Pastebuffer

The line-stack and element-buffer of former releases have been replaced by 5 (possibly more or less if changed at compile time with the `MAX_BUFFER` variable in 'globalconfig.h') multi-purpose buffers that are selected by *Shift<Key>1..MAX_BUFFER*. The status line shows which buffer is the active one. You may load data from a file or layout into them. Cut-and-paste works too. If you followed the instructions earlier in this chapter you should now have several objects on the screen. Move the cross hair to one of them and press *<Btn3Down>* to toggle its selection flag. (If you drag the mouse while the button is down, a box selection will be attempted instead of toggling the selection.) The object is redrawn in a different color. You also may want to try moving the pointer while holding the third button down and release it on a different location. This selects all objects inside the rectangle and unselects everything else. If you want to add a box selection to an existing selection, drag with *Mod1<Btn3Down>* instead. Dragging *Shift Mod1<Btn3Down>* unselects objects in a box. Now change to *pastebuffer-mode* and select some operations from the *Buffer* menu. Copying objects to the buffer is available as *Mod1<Key>c* while cutting them uses *Mod1<Key>x* as shortcut. Both clear the buffer before new data is added. If you use the menu entries, you have to supply a cross hair position by pressing a mouse button. The objects are attached to the pastebuffer relative to that cross hair location. Element data or PCB data may be merged into an existing layout by loading the datafiles into the pastebuffer. Both operations are available from the *File* menu or as user commands.

3.6 Moving and Copying

All objects can be moved including element-names, by *<Btn2Down>*, dragging the pointer while holding the button down and releasing it at the new location of the object. If you use *Mod1<Btn2Down>* instead, the object is copied. Copying does not work for element-names of course. You can move all selected objects with *Shift <Btn1>*. This uses the Pastebuffer,

so it will remove whatever was previously in the Pastebuffer. Please refer to [Section 3.5.8 \[Pastebuffer\], page 24](#). If you want to give a small nudge to an object, but you don't think that the mouse will give you the fine level of control that you want, you can position the cursor over the object, press `<Key>/`, move it with the arrow keys, then press `<Key>/` when it's at the desired position. Remember that all movements are forced onto grid coordinates, so you may want to change the grid spacing first.

To move a trace or group of traces to a different layer, first select the tracks to be moved. It's easiest to do this if you shut off everything but that layer first (i.e. silk, pins, other layers, etc). Now set the current layer to be the new layer. Press Shift-M to move all the selected tracks to the current layer. See the *MoveToCurrentLayer* action for more details.

3.7 Loading and Saving

After your first experience with Pcb you will probably want to save your work. `:s name` passes the data to an external program which is responsible for saving it. For details see *saveCommand* in [Section 8.1 \[Resources\], page 53](#). Saving also is available from the *File* menu, either with or without supplying a filename. Pcb reuses the last filename if you do not pass a new one to the save routine.

To load an existing layout either select *Open...* from the *File* menu or use `:l filename`. A file select box pops up if you don't specify a filename. Merging existing layouts into the new one is supported either by the *File* menu or by `:m filename`.

Pcb saves a backup of the current layout at a user specified interval. The backup filename is created by appending a dash, "-", to the `.pcb` filename. For example, if you are editing the layout in `projects/board.pcb` then the backup file name will be `projects/board.pcb-`. If the layout is new and has not been saved yet, then the backup file name is `PCB.####.backup` where the "####" will be replaced by the process ID of the current running copy of Pcb. This default backup file name may be changed at compilation time via the `BACKUP_NAME` variable in `globalconfig.h`. During critical sections of the program or when data would be lost it is saved as `PCB.%i.save`. This file name may be changed at compile time with the `SAVE_NAME` variable in `globalconfig.h`.

3.8 Printing

Pcb now has support for device drivers, *PostScript*, *encapsulated PostScript*, and *Gerber RS-274X* drivers are available so far. The *Gerber RS-274X* driver additionally generates a numerical control (NC) drill file for automated drilling, a bill of materials file to assist in materials procurement and inventory control, and a centroid (X-Y) file which includes the centroid data needed by automatic assembly (pick and place) machines. I recommend the use of *GhostScript* if you don't have a *PostScript* printer for handling the *PostScript* output. Printing always generates a complete set of files for a specified driver. See the page about the *Print()* action for additional information about the filenames. The control panel offers a number of options. Most of them are not available for Gerber output because it wouldn't make sense, for example, to scale the gerber output (you'd get an incorrectly made board!). The options are:

- 'device' The top menu button selects from the available device drivers.
- 'rotate' Rotate layout 90 degrees counter-clockwise before printing (default).

- ‘**mirror**’ Mirror layout before printing. Use this option depending on your production line.
- ‘**color**’ Created colored output. All colors will be converted to black if this option is inactive.
- ‘**outline**’ Add a board outline to the output file. The size is determined by the maximum board size changeable from the *sizes* menu. The outline appears on the top and bottom sides of the board, but not on the internal layers. An outline can be useful for determining where to shear the board from the panel, but be aware that it creates a copper line. Thus it has the potential to cause short circuits if you don’t leave enough room from your wiring to the board edge. Use a viewer to see what the output outline looks like if you want to know what it looks like.
- ‘**alignment**’ Additional alignment targets are added to the output. The distances between the board outline is set by the resource *alignmentDistance*. Alignment targets should only be used if you know for certain that **YOU WILL BE USING THEM YOURSELF**. It is extremely unlikely that you will want to have alignment targets if you send gerber files to a commercial pcb manufacture to be made.
- ‘**scaling**’ It’s quite useful to enlarge your printout for checking the layout. Use the scrollbar to adjust the scaling factor to your needs.
- ‘**media**’ Select the size of the output media from this menu. The user defined size may be set by the resource *media* either from one of the well known paper sizes or by a X11 geometry specification. This entry is only available if you use X11R5 or later. For earlier releases the user defined size or, if not available, *A4* is used. Well known size are:
- A3
 - A4
 - A5
 - letter
 - tabloid
 - ledger
 - legal
 - executive
- ‘**offset**’ Adjust the offsets of the printout by using the panner at the right side of the dialog box. This entry is only available if you use X11R5 or later. A zero offset is used for earlier releases.
- ‘**8.3 filenames**’ Select this button to generate DOS compatible filenames for the output files. The *command* input area will disappear if selected.
- ‘**commandline**’ Use this line to enter a command (starts with |) or a filename. A %f is replaced by the current filename. The default is set by the resource *printCommand*.

The created file includes some labels which are guaranteed to stay unchanged

‘PCBMIN’ identifies the lowest x and y coordinates in mil.
 ‘PCBMAX’ identifies the highest x and y coordinates in mil.
 ‘PCBOFFSET’
 is set to the x and y offset in mil.
 ‘PCBSCALE’
 is a floating point value which identifies the scaling factor.
 ‘PCBSTARTDATA’
 ‘PCBENDDATA’
 all layout data is included between these two marks. You may use them with
 an `awk` script to produce several printouts on one piece of paper by duplicating
 the code and putting some `translate` commands in front. Note, the normal
 PostScript units are 1/72 inch.

3.9 Exporting a layout

To export a layout choose *Export layout* from the *File* menu, then select the desired exporter.

3.9.1 Bill of materials (bom)

Produces a bill of materials (BOM) file and a centroid (XY) file.

3.9.2 G-code (gcode)

The gcode exporter can generate RS274/NGC G-CODE files to be used with a CNC mill to produce pcb’s by mechanically removing copper from the perimeter of all elements.

The elements are enlarged in order to compensate for the cutting tool size so that the remaining copper corresponds to the original size; however all polygons are left unchanged and will end up being a little smaller; this is not a problem because the electrical connection is done with traces, which are correctly enlarged.

A .cnc file is generated for every copper layer, with the bottom layer mirrored so that the milling is done right; of course it’s not possible to produce directly multi-layer (more than 2) pcb’s with this method, but the cnc files for intermediate layers are generated anyways.

A drill file is also generated, and it contains all drills regardless of the hole size; the drilling sequence is optimized in order to require the least amount of movement.

The export function generates an intermediate raster image before extracting the contour of copper elements, and this image is saved as well (in .png format) for inspection.

When the spacing between two elements is less than the tool diameter they will merge and no isolation will be cut between them; the control image should be checked for this behaviour.

Possible workarounds are: increasing spacing, decreasing the tool size, increasing the intermediate image resolution.

To maximize the chance of producing correct pcb’s it would be better to increase the DRC clearance to at least the tool diameter and use traces as thick as possible; the rule is: use the largest element that will not prevent the isolation cut.


The exporter parameters are:

- basename** base name for generated files
- dpi** intermediate image resolution; affects precision when extracting contours
- mill depth** should be the copper depth
- safe z** Z value when moving between polygons
- tool radius**
copper elements are enlarged by this amount
- drill depth**
depth of drills
- measurement unit**
for all parameters above, can be mm,um,inch,mil; g-code is always mm or inch


All .cnc files specify Z values as parameters, so that it's easy to change them without the need to run the exporter again.

Operation was verified with the EMC2 g-code interpreter.


Following is a sample layout that is converted with default settings:

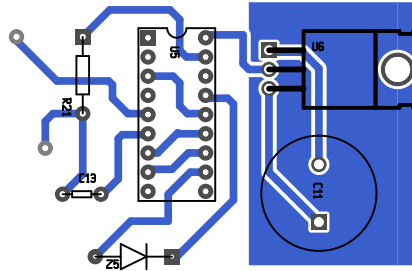

The control image shows that the spacing is sufficient:

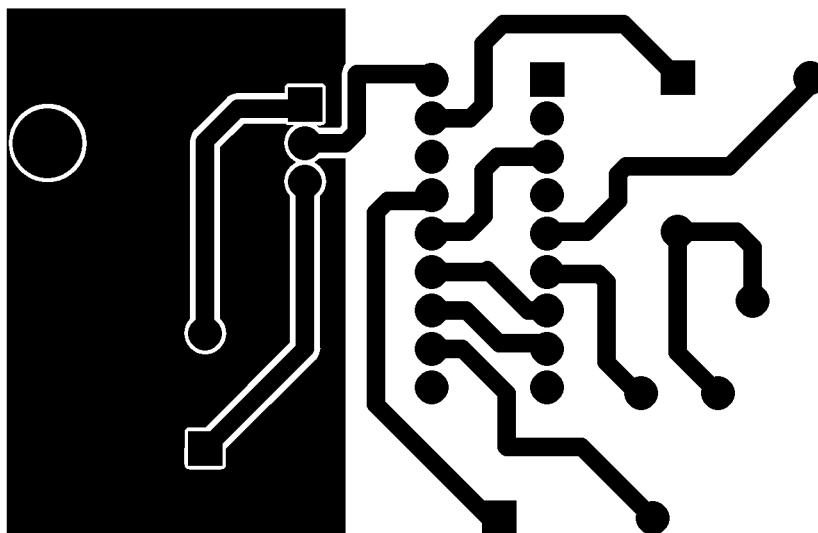

The final tool path follows the perimeter of all elements:

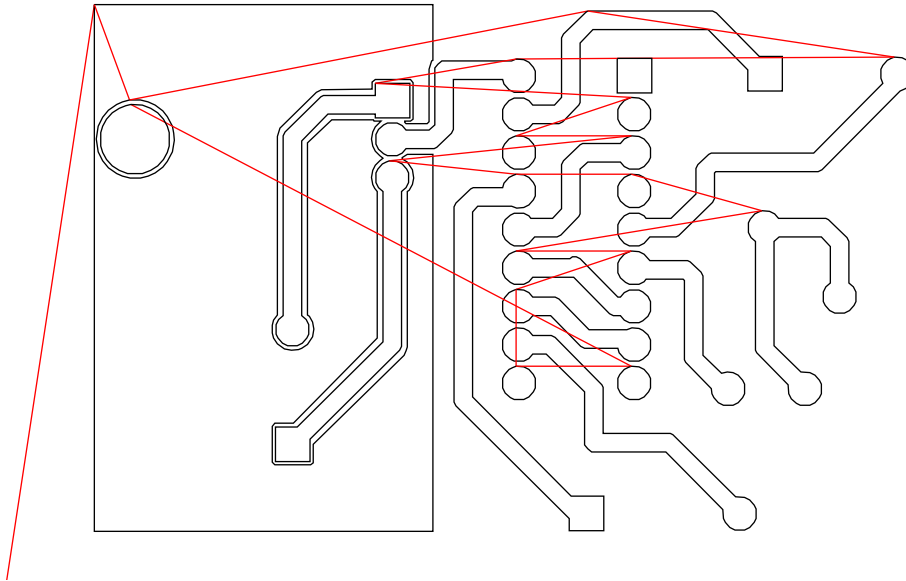

3.9.3 Gerber (gerber)

Produces RS274-X (a.k.a. gerber) photo plot files and Excellon drill files.

3.9.4 Postscript (ps)

Export as postscript. Can be later converted to pdf.

3.9.5 Encapsulated Postscript (eps)

Export as eps (encapsulated postscript) for inclusion in other documents. Can be later converted to pdf.

3.9.6 Image (png)

Produces GIF/JPEG/PNG image files.

3.9.7 Nelma (nelma)

Numerical analysis package export.

`Nelma` is a (command line) tool for numerically calculating various electrical properties of printed circuit boards or similar objects composed of conductors and dielectrics (however code is optimized for circuit board-like geometry).

It is currently capable of calculating capacitances between objects - nets on a PCB.

It returns a spice-compatible description of an equivalent circuit of stray capacitances that can be for example used for more accurate circuit simulation.

Alternatively it can also produce field data that can be plotted for example with Gnuplot.

Support for calculating resistances existed for a while but was later removed because it didn't receive much testing.

The `Nelma` exporter produces a PNG image file for every copper layer and an input file (.em).

The home page of `Nelma` can be found at <https://www.tablix.org/~avian/nelma/>.

3.9.8 GSvit (gsvit)

Numerical analysis package export.

`GSvit` covers set of numerical tools for Finite Difference in Time Domain calculations supporting use of Nvidia CUDA environment compatible graphics cards.

Main scientific purposes include research in nanotechnology and nanoscale optics, like scanning near-field optical microscopy, tip enhanced Raman scattering, rough surface scattering, etc.

However, as FDTD is an universal method, it can be used for any other purposes.

The `GSvit` exporter produces a PNG image file for every copper layer and a xml input file (.xem).

The home page of `GSvit` can be found at <http://gsvit.net>.

3.9.9 IPC-D-356 (ipcd356)

Produces an IPC-D-356 compliant netlist file for bare board testing.

3.10 Connection Lists

After completing parts of your layout you may want to check if all drawn connections match the ones you have in mind. This is probably best done in conjunction with a net-list file: see [Section 3.12 \[Rats Nest\], page 31](#). The following examples give more rudimentary ways to examine the connections.

- 1) create at least two elements and name them
- 2) create some connections between their pins
- 3) optionally add some vias and connections to them

Now select *lookup connection* from the *Connections* menu, move the cursor to a pin or via and press any mouse button. `Pcb` will look for all other pins and/or vias connected to the one you have selected and display the objects in a different color. Now try some of the reset options available from the same menu.

There also is a way to scan all connections of one element. Select *a single element* from the menu and press any button at the element's location. All connections of this element will be saved to the specified file. Either the layout name of the element or its canonical name is used to identify pins depending on the one which is displayed on the screen (may be changed by *Display* menu).

An automatic scan of all elements is initiated by choosing *all elements*. It behaves in a similar fashion to scanning a single element except the resource *resetAfterElement* is used to determine if connections should be reset before a new element is scanned. Doing so will produce very long lists because the power lines are rescanned for every element. By default the resource is set to *false* for this reason.

To scan for unconnected pins select *unused pins* from the same menu.

3.11 Arrow Tool

Some commands mentioned earlier in this chapter also are able to operate on all selected and visible objects. The Arrow tool is used to select/deselect objects and also to move objects or selections. If you click and release on an object with the Arrow tool, it will unselect everything else and select the object. Selected objects change color to reflect that they are selected. If you *Shift* click, it will add the object to (or remove) the object from the existing selection. If you drag with the mouse button down with the Arrow tool, one of several things could happen: if you first pressed the button on a selected object, you will be moving the selection to where you release the button. If you first pressed the button on an unselected object, you will be moving that object. If you first pressed the button over empty space, you will be drawing a box to select everything inside the box. The *Shift* key works the same way with box selections as it does with single objects.

Moving a single un-selected object is different from moving a selection. First of all, you can move the end of line, or a point in a polygon this way which is impossible by moving selections. Secondly, if rubber banding is turned on, moving a single object will rubber-band the attached lines. Finally, it is faster to move a single object this way since there is no need to select it first.

You can select any visible object unless it is locked. If you select an object, then turn off its visibility with the Layer controls, it won't be moved if you move the remaining visible selection.

If you have not configured to use strokes in the Pcb user interface, then the middle mouse button is automatically bound to the arrow tool, regardless of the active tool (which is bound to the first mouse button). So using the middle button any time is just like using the first mouse button with the Arrow tool active.

The entries of the *Selection* menu are hopefully self-explanatory. Many of the *Action Commands* can take various key words that make them function on all or some of the selected items.

3.12 Rats Nest

If you have a netlist that corresponds to the layout you are working on, you can use the rats-nest feature to add rat-lines to the layout. First you will need to load a netlist file (see *:rn*, Chapter 6 [User Commands], page 38). *<Key>w* adds rat-lines on the active layer using the current line thickness shown in the status line (usually you'll want them to be thin lines). Only those rat-lines that fill in missing connectivity (since you have probably routed some connections already) are added. If the layout is already completely wired, nothing will be added, and you will get a message that the wiring is complete.

Rat-lines are lines having the special property that they only connect to pins and pads at their end points. Rat-lines may be drawn differently to other lines to make them easier to identify since they have special behavior and cannot remain in a completed layout. Rat-lines are added in the minimum length straight-line tree pattern (always ending on pins or pads) that satisfies the missing connectivity in the circuit. Used in connection with moves and rotates of the elements, they are extremely useful for deciding where to place elements on the board. The rat-lines will always automatically rubberband to the elements whether or not the rubberband mode is on. The only way for you to move them is by moving the parts they connect to. This is because it is never desirable to have the rat-lines disconnected

from their element pins. Rat-lines will normally criss-cross all over which gives rise to the name "rats nest" describing a layout connected with them. If a SMD pad is unreachable on the active layer, a warning will be issued about it and the rat-line to that pad will not be generated.

A common way to use rats nests is to place some elements on the board, add the rat-lines, and then use a series of moves/rotates of the elements until the rats nest appears to have minimum tangling. You may want to iterate this step several times. Don't worry if the layout looks messy - as long as you can get a sense for whether the criss-crossing is better or worse as you move things, you're fine. After moving some elements around, you may want to optimize the rats nest `<Key>o` so that the lines are drawn between the closest points (this can change once you've moved components). Adding rat-lines only to selected pads/pins (`Shift<Key>w`) is often useful to layout a circuit a little bit at a time. Sometimes you'll want to delete all the rat-lines (`<Key>e`) or selected rat-lines (`Shift<Key>e`) in order to reduce confusion. With a little practice you'll be able to achieve a near optimal component placement with the use of a rats nest.

Rat-lines are not only used for assisting your element placement, they can also help you to route traces on the board. Use the `<Key>m` to convert a rat-line under the cursor into a normal line on the active layer. Inserting a point into a rat-line will also cause the two new lines to be normal lines on the board. Another way that you can use rat-lines is to use the `<Key>f` with the cursor over a pad or pin. All of the pins and pads and rat-lines belonging to that net will be highlighted. This is a helpful way to distinguish one net from the rest of the rats nest. You can then route those tracks, turn off the highlighting (`Shift<Key>f`) and repeat the process. This will work even if the layer that the rat-lines reside on is made invisible - so only the pins and pads are highlighted. Be sure to erase the rat-lines (`<Key>e` erases them all) once you've duplicated their connectivity by adding your own lines. When in doubt, the `<Key>o` will delete only those rat-lines that are no longer needed.

If connections exist on the board that are not listed in the netlist when `<Key>w` is pressed, warning messages are issued and the affected pins and pads are drawn in a special `warnColor` until the next `Notify()` event. If the entire layout agrees completely with the netlist, a message informs you that the layout is complete and no rat-lines will be added (since none are needed). If the layout is complete, but still has rat-lines then you will be warned that rat-lines remain. If you get no message at all it's probably because some elements listed in the net list can't be found and were reported in an earlier message. There shouldn't be any rat-lines left in a completed layout, only normal lines.

The `Shift<Key>w` is used to add rat-lines to only those missing connections among the selected pins and pads. This can be used to add rat-lines in an incremental manner, or to force a rat-line to route between two points that are not the closest points within the net. Often it is best to add the rats nest in an incremental fashion, laying out a sub-section of the board before going further. This is easy to accomplish since new rat-lines are never added where routed connectivity already makes the necessary connections.

3.13 Design Rule Checking

After you've finished laying out a board, you may want to check to be certain that none of your interconnections are too closely spaced or too tenuously touching to be reliably fabricated. The design rule checking (DRC) function does this for you. Use the command

":DRC()" (without the quotes of course) to invoke the checker. If there are no problem areas, you'll get a message to that effect. If any problem is encountered, you will get a message about it and the affected traces will be highlighted. One part of the tracks of concern will be selected, while the other parts of concern will have the "FindConnection" highlighting. The screen will automatically be centered in the middle of the object having the "FindConnection" (Green) highlighting. The middle of the object is also the coordinates reported to be "near" the problem. The actual trouble region will be somewhere on the boundary of this object. If the two parts are from different nets then there is some place where they approach each other closer than the minimum rule. If the parts are from the same net, then there is place where they are only barely connected. Find that place and connect them better.

After a DRC error is found and corrected you must run the DRC again because the search for errors is halted as soon as the first problem is found. Unless you've been extremely careless there should be no more than a few design rule errors in your layout. The DRC checker does not check for minimum spacing rules to copper text, so always be very careful when adding copper text to a layout. The rules for the DRC are specified in the application resource file. The minimum spacing value (in mils) is given by the *Settings.Bloat* value. The default is 7 mils. The minimum touching overlap (in mils) is given by the *Settings.Shrink* value. This value defaults to 5 mils. Check with your fabrication process people to determine the values that are right for you.

If you want to turn off the highlighting produced by the DRC, perform an undo (assuming no other changes have been made). To restore the highlighting, use redo. The redo will restore the highlighting quickly without re-running the DRC checker.

3.14 Trace Optimizer

PCB includes a flexible trace optimizer. The trace optimizer can be run after auto routing or hand routing to clean up the traces.

Auto-Optimize

Performs debumpify, unjaggy, orthopull, vianudge, and viatrim, in that order, repeating until no further optimizations are performed.

Debumpify

Looks for U shaped traces that can be shortened or eliminated.

Unjaggy

Looks for corners which could be flipped to eliminate one or more corners (i.e. jaggy lines become simpler).

Vianudge

Looks for vias where all traces leave in the same direction. Tries to move via in that direction to eliminate one of the traces (and thus a corner).

Viatrim

Looks for traces that go from via to via, where moving that trace to a different layer eliminates one or both vias.

Orthopull

Looks for chains of traces all going in one direction, with more traces orthogonal on one side than on the other. Moves the chain in that direction, causing a net reduction in trace length, possibly eliminating traces and/or corners.

SimpleOpts

Removing unneeded vias, replacing two or more trace segments in a row with a single segment. This is usually performed automatically after other optimizations.

Miter

Replaces 90 degree corners with a pair of 45 degree corners, to reduce RF losses and trace length.

3.15 Searching for elements

To locate text or a specific element or grouping of similar elements choose ‘**Select by name**’ from the **Select** menu, then choose the appropriate subsection. At the bottom of the screen the prompt *pattern:* appears. Enter the text or [Appendix D \[Regular Expressions\]](#), page 109 of the text to be found. Found text will be highlighted.

3.16 Measuring distances

To measure distances, for example the pin-to-pin pitch of a part to validate a footprint, place the cursor at the starting measurement point, then press *!Ctrl<Key>m*. This marks the current location with a *X*. The *X* mark is now the zero point origin for the relative cursor position display. The cursor display shows both absolute position and position relative to the mark as the mouse is moved away from the mark. If a mark is already present, the mark is removed and the cursor display stops displaying relative cursor coordinates.

3.17 Vendor Drill Mapping

Pcb includes support for mapping drill holes to a specified set of sizes used by a particular vendor. Many PCB manufacturers have a preferred set of drill sizes and charge extra when others are used. The mapping can be performed on an existing design and can also be enabled to automatically map drill holes as vias and elements are instantiated.

The first step in using the vendor drill mapping feature is to create a resource file describing the capabilities of your vendor. The file format is the resource file format described in [Section C.1 \[Resource Syntax\]](#), page 106. A complete example is given below.

```
# Optional name of the vendor
vendor = "Vendor Name"

# units for dimensions in this file.
# Allowed values: mil/inch/mm
units = mil

# drill table
drillmap = {
  # When mapping drill sizes, select the nearest size
  # or always round up. Allowed values: up/nearest
  round = up

  # The list of vendor drill sizes. Units are as specified
  # above.
```

```

20
28
35
38
42
52
59.5
86
125
152

# optional section for skipping mapping of certain elements
# based on reference designator, value, or description
# this is useful for critical parts where you may not
# want to change the drill size. Note that the strings
# are regular expressions.
skips = {
    {refdes "^J3$"} # Skip J3.
    {refdes "J3"} # Skip anything with J3 as part of the refdes.
    {refdes "^U[1-3]$" "^X.*"} # Skip U1, U2, U3, and anything starting with X.
    {value "^JOHNSTECH_.*"} # Skip all Johnstech footprints based on the value of a
    {descr "^AMP_MICTOR_767054_1$"} # Skip based on the description.
}
}

# If specified, this section will change the current DRC
# settings for the design. Units are as specified above.
drc = {
    copper_space = 7
    copper_width = 7
    silk_width = 10
    copper_overlap = 4
}

```

The vendor resource is loaded using the *LoadVendor* action. This is invoked by entering:

```
:LoadVendor(vendorfile)
```

from within Pcb. Substitute the file name of your vendor resource file for ‘*vendorfile*’. This action will load the vendor resource and modify all the drill holes in the design as well as the default via hole size for the various routing styles.

Once a vendor drill map has been loaded, new vias and elements will automatically have their drill hole sizes mapped to the vendor drill table. Automatic drill mapping may be disabled under the “Settings” menu. To re-apply an already loaded vendor drill table to a design, choose “Apply vendor drill mapping” from the “Connects” menu.

See [Section 8.2 \[Actions\], page 59](#) for a complete description of the actions associated with vendor drill mapping.

Note that the expressions used in the `skips` section are regular expressions. See [Appendix D \[Regular Expressions\], page 109](#) for an introduction to regular expressions.

4 Autorouter

`Pcb` includes an autorouter which can greatly speed up the layout of a circuit board. The autorouter is a rectangle-expansion type of autorouter based on “A Method for Gridless Routing of Printed Circuit Boards” by A. C. Finch, K. J. Mackenzie, G. J. Balsdon, and G. Symonds in the 1985 Proceedings of the 22nd ACM/IEEE Design Automation Conference. This reference is available from the ACM Digital Library at <http://www.acm.org/dl> for those with institutional or personal access to it. It’s also available from your local engineering library. The reference paper is not needed for using the autorouter.

Before using the autorouter, all elements need to be loaded into the layout and placed and the connectivity netlist must be loaded. Once the elements have been placed and the netlist loaded, the following steps will autoroute your design.

1. Turn off visibility of any layers that you don’t want the router to use.
2. Turn off via visibility if you don’t want the router to use any new vias.
3. Use only plain rectangles for power/ground planes that you want the router to use [use the rectangle tool!]
4. Make at least one connection from any plane you want the router to use to the net you want it to connect to.
5. Draw continuous lines (on all routing layers) to outline keep-out zones if desired.
6. Use routing styles in the netlist to have per-net routing styles. Note that the routing style will be used for an entire net. This means if you have a wide metal setting for a power net you will need to manually route breakouts from any fine pitch parts on their power pins because the router will not be able to change to a narrow trace to connect to the part.
7. Set the current routing style to whatever you’d like the router to use for any nets not having a defined route style in the netlist.
8. Disable any nets that you don’t want the autorouter to route (double-click them in the netlist window to add/remove the *).

NOTE: If you will be manually routing these later not using planes, it is usually better to let the autorouter route them then rip them up yourself afterwards. If you plan to use a ground/power plane manually, consider making it from one or more pure rectangles and letting the autorouter have a go at it.

9. Create a fresh rat’s nest. (*E* then *W*)
10. Select “show autorouter trials” in the settings menu if you want to watch what’s happening.
11. Choose “autoroute all rats” in the connection menu.
12. If you really want to muck with the router because you have a special design, e.g. all through-hole components you can mess with layer directional costs by editing the `autoroute.c` source file and changing the directional costs in lines 929-940. and try again. Even more mucking about with costs is possible in lines 4540-4569, but it’s probably not such a good idea unless you really just want to experiment.

After the design has been autorouted, you may want to run the trace optimizer. See section [Section 3.14 \[Trace Optimizer\]](#), page 33 for more information on the trace optimizer.

5 Toporouter

Pcb includes an Topological autorouter (Toporouter) which can greatly speed up the layout of a circuit board.

The Topological autorouter was implemented by Anthony Blake and is a topological type of autorouter based on:

“Layer Assignment for a Rubber Band Router” by Dayan, T. and Dai, W.W.M., Tech Report UCSC-CRL-92-50, Univ. of California, Santa Cruz, 1992.

“Topological Routing in SURF: Generating a Rubber-Band Sketch” by Dai, W.W.M and Dayan, T. and Staepelaere, D., Proc. 28th ACM/IEEE Design Automation Conference, 1991, pp. 39-44.

“SURF: Rubber-Band Routing System for Multichip Modules,” by David Staepelaere, Jeffrey Jue, Tal Dayan, Wayne Wei-Ming Dai, IEEE Design and Test of Computers ,vol. 10, no. 4, pp. 18-26, October/December, 1993.

“Rubber-band based topological router” by Dayan, T., PhD Thesis, Univ. of California, Santa Cruz, 1997.

“Geometric transformations for a rubber-band sketch” by David Staepelaere, Master’s thesis, Univ. of California, Santa Cruz, September 1992.

These reference papers are not needed for using the Topological autorouter.

Before using the Topological autorouter, all elements need to be loaded into the layout and placed, and the connectivity netlist must be loaded.

Once the elements have been placed and the netlist loaded, the following steps will route your design:

1. Turn off visibility of any layers that you don’t want the router to use.
2. Set the current routing style to whatever you’d like the router to use for any nets not having a defined route style in the netlist.

6 User Commands

The entering of user-commands is initiated by selecting *Command entry* in the menu or typing a (":"). This runs the action routine *Command()*, which replaces the bottom statusline with an input area or opens a separate command window. Error and diagnostic messages go to the Message Log, so it's a good idea to have this window open as well. Command entry is finished by either *<Key>Return* or *<Key>Escape* to confirm or to abort.

Commands can be entered in one of two styles, command entry syntax:

```
Command arg1 arg2
```

or action script syntax:

```
Action1(arg1, arg2); Action2(arg1, arg2);
```

To find out about how a command works, use the argument *usage*:

```
SaveTo usage
```

There is a command for usage of the complete set of commands.

Quoting arguments works similar to bash quoting:

- A backslash (\) is the escape character. It preserves the literal value of the next character that follows. To get a literal '\' use "\\\".
- Enclosing characters in single quotes preserves the literal value of each character within the quotes. A single quote may not occur between single quotes, even when preceded by a backslash.
- Enclosing characters in double quotes preserves the literal value of all characters within the quotes, with the exception of '\' which maintains its special meaning as an escape character.

Action commands allow you to initiate actions which are not bound to any menu item. They can be used to initiate any action with whatever arguments you enter. For example, to change the drilling hole diameter of all vias in the layout to 32 mils, you could select everything using the selection menu, then type:

```
:ChangeDrillSize(SelectedVias, 32mil)
```

Another example might be to set the grid to 2.5 mil by typing:

```
:SetValue(Grid, 2.5mil)
```

Note that some actions use the current cursor location, so be sure to place the cursor where you want before entering the command. For more actions, see the [Section 8.2 \[Actions\]](#), page 59 section.

7 Command-Line Options

The synopsis of the `pcb` command is:

```
pcb [OPTION ...] [LAYOUT-FILE.pcb] to start the application in GUI mode,  
or  
pcb [-h | -V | --copyright] for a list of options, version, and copyright,  
or  
pcb -p [OPTION ...] [LAYOUT-FILE.pcb] to print a layout,  
or  
pcb -x HID [OPTION ...] [LAYOUT-FILE.pcb] to export.
```

Possible values for the parameter ‘HID’ are:

‘bom’	Export a bill of materials
‘gcode’	Export to G-Code
‘gerber’	Export RS-274X (Gerber)
‘nelma’	Numerical analysis package export
‘png’	export GIF/JPEG/PNG
‘ps’	export postscript
‘eps’	export encapsulated postscript

There are several resources which may be set or reset in addition to the standard toolkit command-line options. For a complete list refer to [Section 8.1 \[Resources\]](#), page 53.

7.1 General Options

```
--help      Show help on command line options.  
--version   Show version.  
--verbose   Be verbose on stdout.  
--copyright Show copyright.  
--show-defaults Show option defaults.  
--show-actions Show available actions and exit.  
--dump-actions Dump actions (for documentation).  
--grid-units-mm <string>  
             Set default grid units. Can be mm or mil. Defaults to mil.
```

- `--clear-increment-mm <string>`
Set default clear increment (amount to change when user presses k or K) when user is using a metric grid unit.
- `--grid-increment-mm <string>`
Set default grid increment (amount to change when user presses g or G) when user is using a metric grid unit.
- `--line-increment-mm <string>`
Set default line increment (amount to change when user presses l or L) when user is using a metric grid unit.
- `--size-increment-mm <string>`
Set default size increment (amount to change when user presses s or S) when user is using a metric grid unit.
- `--clear-increment-mil <string>`
Set default clear increment (amount to change when user presses k or K) when user is using an imperial grid unit.
- `--grid-increment-mil <string>`
Set default grid increment (amount to change when user presses g or G) when user is using a imperial grid unit.
- `--line-increment-mil <string>`
Set default line increment (amount to change when user presses l or L) when user is using a imperial grid unit.
- `--size-increment-mil <string>`
Set default size increment (amount to change when user presses s or S) when user is using a imperial grid unit.
- `--backup-interval`
Time between automatic backups in seconds. Set to 0 to disable. The default value is 60.
- `--groups <string>`
Layer group string. Defaults to "1,c:2:3:4:5:6,s:7:8".
- `--route-styles <string>`
A string that defines the route styles. Parameters are (in order): line width, via hole size, via ring size, clearance, solder mask clearance. The units are cmils. Defaults to
"Signal,1000,3600,2000,1000,0:Power,2500,6000,3500,1000,0
:Fat,4000,6000,3500,1000,0:Skinny,600,2402,1181,600,0"
- `--element-path <string>`
A colon separated list of directories or commands (starts with '|'). The path is passed to the program specified in '`--element-command`'.
- `--action-script <string>`
If set, this file is executed at startup.
- `--action-string <string>`
If set, this string of actions is executed at startup.

- `--fab-author <string>`
Name of author to be put in the Gerber files.
- `--layer-stack <string>`
Initial layer stackup, for setting up an export. A comma separated list of layer names, layer numbers and layer groups.
- `--save-last-command`
If set, the last user command is saved.
- `--save-in-tmp`
If set, all data which would otherwise be lost are saved in a temporary file `'/tmp/PCB.%i.save'`. Sequence `'%i'` is replaced by the process ID.
- `--save-metric-only`
If set, save pcb files using only mm unit suffix rather than 'smart' mil/mm.
- `--reset-after-element`
If set, all found connections are reset before a new component is scanned.
- `--auto-buried-vias`
Enables automatically created vias (during line moves and layer switch) to be buried/blind vias
- `--ring-bell-finished`
Execute the bell command when all rats are routed.

7.2 General GUI Options

- `--pinout-offset-x <num>`
Horizontal offset of the pin number display. Defaults to 100mil.
- `--pinout-offset-y <num>`
Vertical offset of the pin number display. Defaults to 100mil.
- `--pinout-text-offset-x <num>`
Horizontal offset of the pin name display. Defaults to 800mil.
- `--pinout-text-offset-y <num>`
Vertical offset of the pin name display. Defaults to -100mil.
- `--draw-grid`
If set, draw the grid at start-up.
- `--clear-line`
If set, new lines clear polygons.
- `--full-poly`
If set, new polygons are full ones.
- `--unique-names`
If set, you will not be permitted to change the name of an component to match that of another component.
- `--snap-pin`
If set, pin centers and pad end points are treated as additional grid points that the cursor can snap to.

- `--all-direction-lines`
Allow all directions, when drawing new lines.
- `--show-number`
Pinout shows number.

7.3 GTK+ GUI Options

- `--listen` Listen for actions on stdin.
- `--bg-image <string>`
File name of an image to put into the background of the GUI canvas. The image must be a color PPM image, in binary (not ASCII) format. It can be any size, and will be automatically scaled to fit the canvas.
- `--pcb-menu <string>`
Location of the 'gpcb-menu.res' file which defines the menu for the GTK+ GUI.

7.4 lesstif GUI Options

- `--listen` Listen for actions on stdin.
- `--bg-image <string>`
File name of an image to put into the background of the GUI canvas. The image must be a color PPM image, in binary (not ASCII) format. It can be any size, and will be automatically scaled to fit the canvas.
- `--pcb-menu <string>`
Location of the 'pcb-menu.res' file which defines the menu for the lesstif GUI.

7.5 Colors

- `--black-color <string>`
Color value for black. Default: '#000000'
- `--white-color <string>`
Color value for white. Default: '#ffffff'
- `--background-color <string>`
Background color of the canvas. Default: '#e5e5e5'
- `--crosshair-color <string>`
Color of the crosshair. Default: '#ff0000'
- `--cross-color <string>`
Color of the cross. Default: '#cdcd00'
- `--via-color <string>`
Color of vias. Default: '#7f7f7f'
- `--via-selected-color <string>`
Color of selected vias. Default: '#00ffff'

```
--pin-color <string>
    Color of pins. Default: '#4d4d4d'

--pin-selected-color <string>
    Color of selected pins. Default: '#00ffff'

--pin-name-color <string>
    Color of pin names and pin numbers. Default: '#ff0000'

--element-color <string>
    Color of components. Default: '#000000'

--rat-color <string>
    Color of ratlines. Default: '#b8860b'

--invisible-objects-color <string>
    Color of invisible objects. Default: '#cccccc'

--invisible-mark-color <string>
    Color of invisible marks. Default: '#cccccc'

--element-selected-color <string>
    Color of selected components. Default: '#00ffff'

--rat-selected-color <string>
    Color of selected rats. Default: '#00ffff'

--connected-color <string>
    Color to indicate physical connections. Default: '#00ff00'

--found-color <string>
    Color to indicate logical connections. Default: '#ff00ff'

--off-limit-color <string>
    Color of off-canvas area. Default: '#cccccc'

--grid-color <string>
    Color of the grid. Default: '#ff0000'

--layer-color-<n> <string>
    Color of layer <n>, where <n> is an integer from 1 to 16.

--layer-selected-color-<n> <string>
    Color of layer <n>, when selected. <n> is an integer from 1 to 16.

--warn-color <string>
    Color of offending objects during DRC. Default value is "#ff8000"

--mask-color <string>
    Color of the mask layer. Default value is "#ff0000"
```

7.6 Layer Names

```
--layer-name-1 <string>
    Name of the 1st Layer. Default is "top".
```

`--layer-name-2 <string>`
Name of the 2nd Layer. Default is "ground".

`--layer-name-3 <string>`
Name of the 3rd Layer. Default is "signal2".

`--layer-name-4 <string>`
Name of the 4rd Layer. Default is "signal3".

`--layer-name-5 <string>`
Name of the 5rd Layer. Default is "power".

`--layer-name-6 <string>`
Name of the 6rd Layer. Default is "bottom".

`--layer-name-7 <string>`
Name of the 7rd Layer. Default is "outline".

`--layer-name-8 <string>`
Name of the 8rd Layer. Default is "spare".

7.7 Paths

`--lib-newlib <string>`
Top level directory for the newlib style library.

`--lib-name <string>`
The default filename for the library.

`--default-font <string>`
The name of the default font.

`--file-path <string>`
A colon separated list of directories or commands (starts with '|'). The path is passed to the program specified in '`--file-command`' together with the selected filename.

`--font-path <string>`
A colon separated list of directories to search the default font. Defaults to the default library path.

`--lib-path <string>`
A colon separated list of directories that will be passed to the commands specified by '`--element-command`' and '`--element-contents-command`'.

7.8 Sizes

All parameters should be given with an unit. If no unit is given, 1/100 mil (cmil) will be used. Write units without space to the number like 3mm, not 3 mm. Valid Units are:

'km' Kilometer
'm' Meter
'cm' Centimeter

'mm' Millimeter
'um' Micrometer
'nm' Nanometer
'in' Inch (1in = 0.0254m)
'mil' Mil (1000mil = 1in)
'cmil' Centimil (1/100 mil)

--via-thickness <num>
Default diameter of vias. Default value is 60mil.

--via-drilling-hole <num>
Default diameter of holes. Default value is 28mil.

--via-solder-mask-clearance <num>
Default soldermask clearance around vias. Default value is 0mil.

--line-thickness <num>
Default thickness of new lines. Default value is 10mil.

--rat-thickness <num><unit>
Thickness of rats. If no unit is given, PCB units are assumed (i.e. 100 means "1 nm"). This option allows for a special unit px which sets the rat thickness to a fixed value in terms of screen pixels. Maximum fixed thickness is 100px. Minimum saling rat thickness is 101nm. Default value is 10mil.

--keepaway <num>
Default minimum distance between a track and adjacent copper. Default value is 10mil.

--default-PCB-width <num>
Default width of the canvas. Default value is 6000mil.

--default-PCB-height <num>
Default height of the canvas. Default value is 5000mil.

--text-scale <num>
Default text scale. This value is in percent. Default value is 100.

--alignment-distance <num>
Specifies the distance between the board outline and alignment targets. Default value is 2mil.

--grid <num>
Initial grid size. Default value is 10mil.

--minimum polygon area <num>
Minimum polygon area.

--paste-adjust <num>
Adjust pad thickness in paste layer. Default value is 0. Shrinking the pads is done with a negative amount.
Example:
pcb -x gerber --paste-adjust -0.07mm filename.pcb

7.9 Commands

pcb uses external commands for input output operations. These commands can be configured at start-up to meet local requirements. The command string may include special sequences %f, %p or %a. These are replaced when the command is called. The sequence %f is replaced by the file name, %p gets the path and %a indicates a package name.

- `--font-command <string>`
Command to load a font.
- `--file-command <string>`
Command to read a file.
- `--element-command <string>`
Command to read a footprint.
Defaults to "M4PATH='%p';export M4PATH;echo 'include(%f)' | m4"
- `--print-file <string>`
Command to print to a file.
- `--lib-command-dir <string>`
Path to the command that queries the library.
- `--lib-command <string>`
Command to query the library.
Defaults to "QueryLibrary.sh '%p' '%f' %a"
- `--lib-contents-command <string>`
Command to query the contents of the library.
Defaults to "ListLibraryContents.sh %p %f" or, on Windows builds, an empty string (to disable this feature).
- `--save-command <string>`
Command to save to a file.
- `--rat-command <string>`
Command for reading a netlist. Sequence %f is replaced by the netlist filename.

7.10 DRC Options

All parameters should be given with an unit. If no unit is given, 1/100 mil (cmil) will be used for backward compability. Valid units are given in section [Section 7.8 \[Sizes\], page 44](#).

- `--bloat <num>`
Minimum spacing. Default value is 10mil.
- `--shrink <num>`
Minimum touching overlap. Default value is 10mil.
- `--min-width <num>`
Minimum width of copper. Default value is 10mil.
- `--min-silk <num>`
Minimum width of lines in silk. Default value is 10mil.

- `--min-drill <num>`
Minimum diameter of holes. Default value is 15mil.
- `--min-ring <num>`
Minimum width of annular ring. Default value is 10mil.

7.11 BOM Creation

- `--bomfile <string>`
Name of the BOM output file. Parameter `<string>` can include a path.
- `--xyfile <string>`
Name of the XY output file. Parameter `<string>` can include a path.
- `--attrs <string>`
Name of the attributes input file. Parameter `<string>` can include a path. The input file can be any path, the format matches what gschem uses. One attribute per line, and whitespace is ignored. Example:
- ```
device
manufacturer
manufacturer_part_number
vendor
vendor_part_number
```
- `--xy-unit <unit>`  
Unit of XY dimensions. Defaults to mil. Parameter `<unit>` can be 'km', 'm', 'cm', 'mm', 'um', 'nm', 'px', 'in', 'mil', 'dmil', 'cmil', or 'inch'.

## 7.12 G-code Options

- `--basename <string>`  
File name prefix and suffix, layer names will be inserted before the suffix. Parameter `<string>` can include a path.
- `--measurement-unit <unit>`  
Measurement unit used in the G-code output. Defaults to mil. Parameter `<unit>` can be 'km', 'm', 'cm', 'mm', 'um', 'nm', 'px', 'in', 'mil', 'dmil', 'cmil', or 'inch'.
- `--dpi <int>`  
Accuracy of the mill path generation in pixels/inch.
- `--safe-Z <real>`  
Safe Z for traverse movements of all operations.
- `--iso-mill-depth <real>`  
Isolation milling depth.
- `--iso-tool-diameter <real>`  
Isolation milling tool diameter.
- `--iso-tool-plunge <real>`  
Isolation milling feedrate when plunging into the material.

- `--iso-tool-feedrate <real>`  
Isolation milling feedrate.
- `--predrill`  
Whether to pre-drill all drill spots with the isolation milling tool. Drill depth is iso-mill-depth here. This feature eases and enhances accuracy of manual drilling.
- `--drill-depth <real>`  
Drilling depth.
- `--drill-feedrate <real>`  
Drilling feedrate.
- `--drill-mill`  
Whether to produce drill holes equal or bigger than the milling tool diameter with the milling tool. With the milling tool bigger holes can be accurately sized without changing the tool.
- `--outline-mill-depth <real>`  
Milling depth when milling the outline. Currently, only the rectangular extents of the board are milled, no polygonal outlines or holes.
- `--outline-tool-diameter <real>`  
Diameter of the tool used for outline milling.
- `--outline-mill-plunge <real>`  
Outline milling feedrate when plunging into the material.
- `--outline-mill-feedrate <real>`  
Outline milling feedrate.
- `--advanced-gcode`  
Whether to produce G-code for advanced interpreters, like using variables or drill cycles. Not all machine controllers understand this, but it allows better hand-editing of the resulting files.

### 7.13 Gerber Export

- `--gerberfile <string>`  
Gerber output file prefix. Parameter `<string>` can include a path.
- `--all-layers`  
Output contains all layers, even empty ones.
- `--verbose`  
Print file names and aperture counts on stdout.
- `--metric` Generate metric Gerber and drill files
- `--copy-outline <string>`  
Copy the outline onto other layers. Parameter `<string>` can be `'none'`, `'mask'`, `'silk'` or `'all'`.

`--name-style <string>`  
Naming style for individual gerber files. Parameter `<string>` can be `'fixed'`, `'single'`, `'first'`, `'eagle'`, `'hackvana'` or `'oshpark'`.

## 7.14 Postscript Export

`--psfile <string>`  
Name of the postscript output file. Can contain a path.

`--drill-helper`  
Print a centering target in large drill holes.

`--align-marks`  
Print alignment marks on each sheet. This is meant to ease alignment during exposure.

`--outline`  
Print the contents of the outline layer on each sheet.

`--mirror` Print mirror image.

`--fill-page`  
Scale output to make the board fit the page.

`--auto-mirror`  
Print mirror image of appropriate layers.

`--ps-color`  
Postscript output in color.

`--ps-bloat <num>`  
Amount to add to trace/pad/pin edges.

`--ps-invert`  
Draw objects as white-on-black.

`--media <media-name>`  
Size of the media, the postscript is fitted to. The parameter `<media-name>` can be any of the standard names for paper size: `'A0'` to `'A10'`, `'B0'` to `'B10'`, `'Letter'`, `'11x17'`, `'Ledger'`, `'Legal'`, `'Executive'`, `'A-Size'`, `'B-size'`, `'C-Size'`, `'D-size'`, `'E-size'`, `'US-Business_Card'`, `'Intl-Business_Card'`.

`--psfade <num>`  
Fade amount for assembly drawings (0.0=missing, 1.0=solid).

`--scale <num>`  
Scale value to compensate for printer sizing errors (1.0 = full scale).

`--multi-file`  
Produce multiple files, one per page, instead of a single multi page file.

`--xcalib <num>`  
Paper width. Used for x-Axis calibration.

`--ycalib <num>`  
Paper height. Used for y-Axis calibration.

- `--drill-copper`  
Draw drill holes in pins / vias, instead of leaving solid copper.
- `--show-legend`  
Print file name and scale on printout.

## 7.15 Encapsulated Postscript Export

- `--eps-file <string>`  
Name of the encapsulated postscript output file. Can contain a path.
- `--eps-scale <num>`  
Scale EPS output by the parameter 'num'.
- `--screen-layer-order`  
Export layers as shown on screen.
- `--monochrome`  
Convert output to monochrome.
- `--only-visible`  
Limit the bounds of the EPS file to the visible items.

## 7.16 PNG Options

- `--outfile <string>`  
Name of the file to be exported to. Parameter <string> can include a path.
- `--dpi`  
Scale factor in pixels/inch. Set to 0 to scale to size specified in the layout.
- `--x-max`  
Width of the png image in pixels. No constraint, when set to 0.
- `--y-max`  
Height of the png output in pixels. No constraint, when set to 0.
- `--xy-max`  
Maximum width and height of the PNG output in pixels. No constraint, when set to 0.
- `--screen-layer-order`  
Export layers in the order shown on screen.
- `--monochrome`  
Convert output to monochrome.
- `--only-visible`  
Limit the bounds of the exported PNG image to the visible items.
- `--use-alpha`  
Make the background and any holes transparent.
- `--fill-holes`  
Drill holes in pins/pads are filled, not hollow.
- `--format <string>`  
File format to be exported. Parameter <string> can be 'PNG', 'GIF', or 'JPEG'.

- `--png-bloat <num><dim>`  
Amount of extra thickness to add to traces, pads, or pin edges. The parameter '`<num><dim>`' is a number, appended by a dimension '`mm`', '`mil`', or '`pix`'. If no dimension is given, the default dimension is 1/100 mil.
- `--photo-mode`  
Export a photo realistic image of the layout.
- `--photo-flip-x`  
In photo-realistic mode, export the reverse side of the layout. Left-right flip.
- `--photo-flip-y`  
In photo-realistic mode, export the reverse side of the layout. Up-down flip.
- `--photo-mask-colour <colour>`  
In photo-realistic mode, export the solder mask as this colour. Parameter `<colour>` can be '`green`', '`red`', '`blue`', '`purple`', '`black`', or '`white`'.
- `--photo-plating <colour>`  
In photo-realistic mode, export the exposed copper as though it has this type of plating. Parameter `<colour>` can be '`tinned`', '`gold`', '`silver`', or '`copper`'.
- `--photo-silk-colour <colour>`  
In photo-realistic mode, export the silk screen as this colour. Parameter `<colour>` can be '`white`', '`black`', or '`yellow`'.

## 7.17 Nelma Options

- `--basename <string>`  
File name prefix.
- `--dpi <num>`  
Horizontal scale factor (grid points/inch).
- `--copper-height <num>`  
Copper layer height (um).
- `--substrate-height <num>`  
Substrate layer height (um).
- `--substrate-epsilon <num>`  
Substrate relative epsilon.

## 7.18 IPC-D-356 Netlist Export

- `--netlist-file <string>`  
Name of the IPC-D-356 Netlist output file. Parameter `<string>` can include a path.

## 7.19 gsvit Options

- `-- basename <string>`  
File name prefix.

`--dpi <num>`  
Horizontal scale factor (grid points/inch).

## 7.20 lpr Printing Options

`--lprcommand <string>`  
Command to use for printing. Defaults to `lpr`. This can be used to produce PDF output with a virtual PDF printer. Example:  
`--lprcommand "lp -d CUPS-PDF-Printer"`.

In addition, all [Section 7.14 \[Postscript Export\]](#), page 49 options are valid.

## 8 X11 Interface

This chapter gives an overview about the additional X11 resources which are defined by `Pcb` as well as the defined action routines.

### 8.1 Non-Standard X11 Application Resources

In addition to the toolkit resources, `Pcb` defines the following resources:

`'absoluteGrid (boolean)'`

Selects if either the grid is relative to the position where it has changed last or absolute, the default, to the origin (0,0).

`'alignmentDistance (dimension)'`

Specifies the distance between the boards outline to the alignment targets.

`'allDirectionLines (boolean)'`

Enables (default) or disables clipping of new lines to 45 degree angles.

`'backgroundImage (string)'`

If specified, this image will be drawn as the background for the board. The purpose of this option is to allow you to use a scan of an existing layout as a prototype for your new layout. To do this, there are some limitations as to what this image must be. The image must be a PPM binary image (magic number 'P6'). It must have a maximum pixel value of 255 or less (i.e. no 16-bit images). It must represent the entire board, as it will be scaled to fit the board dimensions exactly. Note that it may be scaled unevenly if the image doesn't have the same aspect ratio of your board. You must ensure that the image does not use more colors than are available on your system (mostly this is for pseudo-color displays, like old 8-bit displays). For best results, I suggest the following procedure using The Gimp: Load your image (any type). Image->Scale if needed. Image->Colors->Curves and for each of Red, Green, and Blue channel move the lower left point up to about the 3/4 line (value 192). This will make your image pale so it doesn't interfere with the traces you'll be adding. Image->Mode->Indexed and select, say, 32 colors with Normal F-S dithering. File->Save As, file type by extension, use '.ppm' as the extension. Select Raw formatting.

`'backupInterval (int)'`

`Pcb` has an automatic backup feature which saves the current data every *n* seconds. The default is 300 seconds. A value of zero disables the feature. The backup file is named `'/tmp/PCB.%i.backup'` by default (this may have been changed at compilation time via the `BACKUP_NAME` variable in `'globalconfig.h'`). *%i* is replaced by the process ID. See also, the command-line option `-backup-interval`.

`'Bloat (dimension)'`

Specifies the minimum spacing design rule in mils.

`'connectedColor (color)'`

All pins, vias, lines and rectangles which are selected during a connection search are drawn with this color. The default value is determined by *XtDefaultForeground*.

`'cross hairColor (color)'`

This color is used to draw the cross hair cursor. The color is a result of a *XOR* operation with the contents of the Layout area. The result also depends on the default colormap of the X11 server because only the colormap index is used in the boolean operation and *Pcb* doesn't create its own colormap. The default setting is *XtDefaultForeground*.

`'elementColor (color)'``'elementSelectedColor (color)'`

The elements package part is drawn in these colors, for normal and selected mode, respectively, which both default to *XtDefaultForeground*.

`'elementCommand (string)'`

*Pcb* uses a user defined command to read element files. This resource is used to set the command which is executed by the users default shell. Two escape sequences are defined to pass the selected filename (*%f*) and the current search path (*%p*). The command must write the element data to its standard output. The default value is

```
M4PATH="%p";export M4PATH;echo 'include(%f)' | m4
```

Using the GNU version of *m4* is highly recommended. See also, the command-line option *-element-command*.

`'elementPath (string)'`

A colon separated list of directories or commands (starts with '|'). The path is passed to the program specified in *elementCommand* together with the selected element name. A specified command will be executed in order to create entries for the fileselect box. It must write its results to *stdout* one entry per line. See also, the user-command *le[!]*.

`'fileCommand (string)'`

The command is executed by the user's default shell whenever existing layout files are loaded. Data is read from the command's standard output. Two escape sequences may be specified to pass the selected filename (*%f*) and the current search path (*%p*). The default value is:

```
cat %f
```

See also, the command-line option *-file-command*.

`'filePath (string)'`

A colon separated list of directories or commands (starts with '|'). The path is passed to the program specified in *fileCommand* together with the selected filename. A specified command will be executed in order to create entries for the fileselect box. It must write its results to *stdout* one entry per line. See also, the user-command *l[!]*.



**‘fontCommand (string)’**

Loading new symbol sets also is handled by an external command. You again may pass the selected filename and the current search path by passing %f and %p in the command string. Data is read from the commands standard output. This command defaults to

```
cat %f
```

See also, the command-line option *-font-command*.

**‘fontFile (string)’**

The default font for new layouts is read from this file which is searched in the directories as defined by the resource *fontPath*. Searching is only performed if the filename does not contain a directory component. The default filename is ‘default\_font’.

**‘fontPath (string)’**

This resource, a colon separated list of directories, defines the searchpath for font files. See also, the resource *fontFile*.

**‘grid (int)’**

This resource defines the initial value of one cursor step. It defaults to *100 mil* and any changes are saved together with the layout data.

**‘gridColor (color)’**

This color is used to draw the grid. The color is a result of a *INVERT* operation with the contents of the Layout area. The result also depends on the default colormap of the X11 server because only the colormap index is used in the boolean operation and Pcb doesn’t create its own colormap. The default setting is *XtDefaultForeground*.

**‘invisibleObjectsColor (color)’**

Elements located on the opposite side of the board are drawn in this color. The default is *XtDefaultForeground*.

**‘layerColor1..MAX\_LAYER (color)’****‘layerSelectedColor1..MAX\_LAYER (color)’**

These resources define the drawing colors of the different layers in normal and selected state. All values are preset to *XtDefaultForeground*.

**‘layerGroups (string)’**

The argument to this resource is a colon separated list of comma separated layer numbers (1..MAX\_LAYER). All layers within one group are switched on/off together. The default setting is *1:2:3:...:MAX\_LAYER* which means all layers are handled separately. Grouping layers one to three looks like *1,2,3:4:...:MAX\_LAYER*

**‘layerName1..MAX\_LAYER (string)’**

The default name of the layers in a new layout are determined by these resources. The defaults are empty strings.

**‘libraryCommand (string)’**

Pcb uses a command to read element data from libraries. The resource is used to set the command which is executed by the users default shell. Three escape

sequences are defined to pass the selected filename (%f), the current search path (%p) as well (%a) as the three parameters *template*, *value* and *package* to the command. It must write the element data to its standard output. The default value is

```
NONE/share/pcb/oldlib/QueryLibrary.sh %p %f %a
```

‘libraryContentsCommand (string)’

Similar to *libraryCommand*, Pcb uses the command specified by this resource to list the contents of a library.

```
NONE/share/pcb/oldlib/ListLibraryContents.sh %p %f
```

is the default.

‘libraryFilename (string)’

The resource specifies the name of the library. The default value is *pcplib* unless changed at compile time with the LIBRARYFILENAME variable in ‘globalconfig.h’.

‘libraryPath (string)’

A colon separated list of directories that will be passed to the commands specified by *elementCommand* and *elementContentsCommand*.

‘lineThickness (dimension)’

The value, in the range [1..250] (the range may be changed at compile time with the MIN\_LINESIZE and MAX\_LINESIZE variables in ‘globalconfig.h’), defines the initial thickness of new lines. The value is preset to *ten mil*.

‘media (<predefined> | <width>x<height>+-<left\_margin>+-<top\_margin>)’

The default (user defined) media of the PostScript device. Predefined values are *a3*, *a4*, *a5*, *letter*, *tabloid*, *ledger*, *legal*, and *executive*. The second way is to specify the medias width, height and margins in mil. The resource defaults to *a4* size unless changed at compile time with the DEFAULT\_MEDIASIZE variable in ‘globalconfig.h’.

‘offLimitColor (color)’

The area outside the current maximum settings for width and height is drawn with this color. The default value is determined by *XtDefaultBackground*.

‘pinColor (color)’

‘pinSelectedColor(color)’

This resource defines the drawing color of pins and pads in both states. The values are preset to *XtDefaultForeground*.

‘pinoutFont (string)’

This fonts are used to display pin names. There is one font for each zoom value. The values are preset to *XtdefaultFont*.

‘pinoutNameLength (int)’

This resource limits the number of characters which are displayed for pin names in the pinout window. By default the string length is limited to *eight* characters per name.

`'pinoutOffsetX (int)'`

`'pinoutOffsetY (int)'`

These resources determine the offset in *mil* of the circuit from the upper left corner of the window when displaying pinout information. Both default to *100 mil*.

`'pinoutTextOffsetX (int)'`

`'pinoutTextOffsetY (int)'`

The resources determine the distance in mil between the drilling hole of a pin to the location where its name is displayed in the pinout window. They default to *X:50* and *Y:0*.

`'pinoutZoom (int)'`

Sets the zoom factor for the pinout window according to the formula:  $scale = 1:(2 \text{ power value})$ . Its default value is *two* which results in a *1:4* scale.

`'printCommand (string)'`

Default file for printouts. If the name starts with a `'|'` the output is piped through the command. A `%f` is replaced by the current filename. There is no default file or command.

`'raiseLogWindow (boolean)'`

The log window will be raised when new messages arrive if this resource is set *true*, the default.

`'ratCommand (string)'`

Default command for reading a netlist. A `%f` is replaced by the netlist filename. Its default value is `"cat %f"`.

`'ratPath (string)'`

Default path to look for netlist files. It's default value is `"."`

`'resetAfterElement (boolean)'`

If set to *true*, all found connections will be reset before a new element is scanned. This will produce long lists when scanning the whole layout for connections. The resource is set to *false* by default. The feature is only used while looking up connections of all elements.

`'ringBellWhenFinished (boolean)'`

Whether to ring the bell (the default) when a possibly lengthy operation has finished or not. See also, the command-line option `-ring-bell-finished`.

`'routeStyle (string)'`

Default values for the menu of routing styles (seen in the sizes menu). The string is a comma separated list of name, line thickness, via diameter, and via drill size. e.g. `"Fat,50,100,40:Skinny,8,35,20:75Ohm,110,110,20"` See also, the command-line option `-route-styles` and *Sizes Menu*

`'rubberBandMode (boolean)'`

Whether rubberband move and rotate (attached lines stretch like rubberbands) is enabled (the default).

`'saveCommand (string)'`

This command is used to save data to a layout file. The filename may be indicated by placing `%f` in the string. It must read the data from its standard input. The default command is:

```
cat - > %f
```

See also, the command-line option `-save-command`.

`'saveInTMP (boolean)'`

Enabling this resource will save all data which would otherwise be lost in a temporary file `'/tmp/PCB.%i.save'`. The file name may be changed at compile time with the `EMERGENCY_NAME` variable in `'globalconfig.h'`. `%i` is replaced by the process ID. As an example, loading a new layout when the old one hasn't been saved would use this resource. See also, the command-line option `-save-in-tmp`.

`'saveLastCommand (boolean)'`

Enables the saving of the last entered user command. The option is *disabled* by default. See also, the command-line option `-save-last-command`.

`'Shrink (dimension)'`

Specifies the minimum overlap (touching) design rule in mils.

`'size (<width>x<height>)'`

Defines the width and height of a new layout. The default is `7000x5000` unless changed at compile time with the `DEFAULT_SIZE` variable in `'globalconfig.h'`.

`'stippledPolygons (boolean)'`

Determines whether to display polygons on the screen with a stippled pattern. Stippling can create some amount of transparency so that you can still (to some extent) see layers beneath polygons. It defaults to `False`.

`'textScale (dimension)'`

The font scaling in percent is defined by this resource. The default is `100` percent.

`'useLogWindow (boolean)'`

Several subroutines send messages to the user if an error occurs. This resource determines if they appear inside the log window or as a separate dialog box. See also, the resource `raiseLogWindow` and the command line option `-loggeometry`. The default value is `true`.

`'viaColor (color)'``'viaSelectedColor (color)'`

This resource defines the drawing color of vias in both states. The values are preset to `XtDefaultForeground`.

`'viaThickness (dimension)'``'viaDrillingHole (dimension)'`

The initial thickness and drilling hole of new vias. The values must be in the range `[30..400]` (the range may be changed at compile time with the `MIN_PINORVIASIZE` and `MAX_PINEORVIASIZE` variables in `'globalconfig.h'`), with

at least 20 mil of copper. The default thickness is *40 mil* and the default drilling hole is *20 mil*.

‘volume (int)’

The value is passed to `XBell()` which sets the volume of the X speaker. The value lies in the range -100..100 and it defaults to the maximum volume of *100*.

‘warnColor (color)’

This resource defines the color to be used for drawing pins and pads when a warning has been issued about them.

‘zoom (int)’

The initial value for output scaling is set according to the following formula:  $scale = 1:(2 \text{ power value})$ . It defaults to *three* which results in an output scale of *1:8*.

Refer also to [Chapter 7 \[Command-Line Options\]](#), page 39.

## 8.2 Actions

All user accessible commands may be bound to almost any X event. Almost no default binding for commands is done in the binaries, so it is vital for the application that at least a system-wide application resource file exists. This file normally resides in the ‘`share/pcb`’ directory and is called ‘`Pcb`’. The bindings to which the manual refers to are the ones as defined by the shipped resource file. Besides binding an action to an X11 event, you can also execute any action command using a “:” command (see [Chapter 6 \[User Commands\]](#), page 38).

Take special care about translations related to the functions keys and the pointer buttons because most of the window managers use them too. Change the file according to your hardware/software environment. You may have to replace all occurrences of *baseTranslations* to *translations* if you use a X11R4 server.

Passing *Object* as an argument to an action routine causes the object at the cursor location to be changed, removed or whatever. If more than one object is located at the cross hair position the smallest type is used. If there are two of the same type the newer one is taken. *SelectedObjects* will handle all selected and visible objects.

‘AddRats(AllRats|SelectedRats)’

Adds rat-lines to the layout using the loaded netlist file (see the *:rn*, [Chapter 6 \[User Commands\]](#), page 38.). Rat lines are added on the active layer using the current line thickness shown in the status line. Only missing connectivity is added by the AddRats command so if, for example, the layout is complete nothing will be added. Rat lines may be drawn different to other lines on the screen to make them easier to identify since they cannot appear in a completed layout. The rat-lines are added in the minimum length straight-line tree pattern (always ending on pins or pads) that satisfies the missing connectivity in the circuit. If a SMD pad is unreachable on the active layer, a warning will be issued about it and the rat-line to that pad will not be generated. If connections exist on the board which are not listed in the netlist while AllRats are being added, warning messages will be issued and the affected pins and pads will be drawn in a special *warnColor* until the next *Notify()* event. If the entire layout agrees

completely with the net-list a message informs you that the layout is complete and no rat-lines are added (since none are needed). If *SelectedRats* is passed as the argument, only those missing connections that might connect among the selected pins and pads are drawn. Default:

```
None<Key>w: AddRats(AllRats)
!Shift<Key>w: AddRats(SelectedRats)
None<Key>o: DeleteRats(AllRats) AddRats(AllRats)
!Shift<Key>o: DeleteRats(SelectedRats) AddRats(SelectedRats)
```

‘ApplyVendor()’

Applies an already loaded vendor drill map to the design.

```
ApplyVendor()
```

‘Atomic(Save|Restore|Block|Close)’

Controls the undo grouping of sequences of actions. Before the first action in a group, Atomic(Save) should be issued. After each action that might be undoable, Atomic(Restore) should be issued. Atomic(Block) concludes and save the undo grouping if there was anything in the group to undo. Atomic(Close) concludes and save the undo grouping even if nothing was actually done. Thus it might produce an "empty" undo. This can be useful when you want to use undo in a group of actions.

‘Bell([-100..100])’

Rings the bell of your display. If no value is passed the setting of the resource *volume* will be used.

‘ChangeClearSize(Object, value[, unit])’

‘ChangeClearSize(SelectedPins|SelectedVias, value[, unit])’

The effect of this action depends on if the soldermask display is presently turned on or off. If soldermask is displayed, then the soldermask relief size will be changed. If soldermask display is turned off, then the clearance to polygons will be changed. *unit* is "mil" or "mm". If not specified the units will default to the internal unit of 0.01 mil.

```
!Mod1<Key>k: ChangeClearSize(Object, +2, mil)
!Mod1 Shift<Key>k: ChangeClearSize(Object, -2, mil)
```

‘ChangeDrillSize(Object, value[, unit])’

‘ChangeDrillSize(SelectedPins|SelectedVias, value[, unit])’

This action routine changes the drilling hole of pins and vias. If *value* starts with + or -, then it adds (or subtracts) *value* from the current hole diameter, otherwise it sets the diameter to the value. *unit* is "mil" or "mm". If not specified the units will default to the internal unit of 0.01 mil. Default:

```
!Mod1<Key>s: Change2ndSize(Object, +5, mil)
!Mod1 Shift<Key>s: Change2ndSize(Object, -5, mil)
```

‘ChangeFlag(Object|SelectElements|SelectedPins|SelectedVias|Selected,thermal|octagon|square,’

Sets/clears the indicated flag. This adds/removes thermals, adds/removes the flag which indicates a pin/pad should be square, or adds/removes the flag which indicates a pin/pad should be octagonal.

```

:ChangeFlag(SelectedVias,thermal,1)
:ChangeFlag(SelectedPads,square,0)

```

‘ChangeHole(Object|SelectedVias)’

This action routine converts a via to and from a hole. A hole is a via that has no copper annulus. The drill size for the via determines the hole diameter.

```

!Ctrl<Key>h: ChangeHole(Object)

```

‘ChangeName(Object)’

‘ChangeName(Layer|Layout)’

Changes the name of the visible object at the cursor location. A text object doesn't have a name therefore the text string itself is changed. The element name currently used for display is always the one changed with this command. See *Display(Description|NameOnPCB|Value)* for details. Passing *Layer* changes the current layers name. Default:

```

None<Key>n: ChangeName(Object)

```

‘ChangeOctagon(Object|SelectElements|SelectedPins|SelectedVias|Selected)’

Toggles what shape the affected pin(s) or via(s) will be drawn when they are not square. The shape will either be round or octagonal. Default:

```

!Ctrl<Key>o: ChangeOctagon(Object)

```

‘ChangePinName(ElementName, PinNumber, PinName)’

Changes the name for a specified pin or pad number on a specified element. This action is typically used to forward annotate pin/pad names from a schematic to the layout.

```

ChangePinName(U1, 14, VDD)

```

‘ChangeSize(Object, value[, unit])’

‘ChangeSize(SelectedLines|SelectedPins|SelectedVias, value[, unit])’

‘ChangeSize(SelectedPads|SelectedTexts|SelectedNames, value[, unit])’

‘ChangeSize(SelectedElements, value[, unit])’

To change the size of an object you have to bind these action to some X event (or use *:ChangeSize(...)*). If *value* begins with a + or - then the value will be added (or subtracted) from the current size, otherwise the size is set equal to *value*. Range checking is done to insure that none of the maximum/minimums of any size are violated. If *Object* is passed then a single object at the cursor location is changed. If any of the *Selected* arguments are passed then all selected and visible objects of that type are changed. If the type being modified is an element, then the thickness of the silkscreen lines defining the element is changed. *unit* is "mil" or "mm". If not specified the units will default to the internal unit of 0.01 mil. Default:

```

None<Key>s: ChangeSize(Object, +5)
!Shift<Key>s: ChangeSize(Object, -5)

```

‘ChangeSquare(Object|SelectedElements|SelectedPins)’

Toggles the setting of the square flag. The flag is used to identify a certain pin, normally the first one, of circuits. It is also used to make SMD pads have square ends.

None<Key>q: ChangeSquare(Object)

‘ClrFlag(Object|SelectElements|SelectedPins|SelectedVias|Selected,thermal|octagon|square)’

Clears the indicated flag. This removes thermals, removes the flag which indicates a pin/pad should be square, or removes the flag which indicates a pin/pad should be octagonal.

:ClrFlag(SelectedVias,thermal)

‘Command()’

Calling *Command()* pops up an input line at the bottom of the window which allows you to enter commands. Including all action commands! The dialog ends when *None<Key>Return* to confirm or *None<Key>Escape* to abort is entered. Default:

<Key>colon: Command()

‘Connection(Find)’

‘Connection(ResetFoundLinesAndRectangles|ResetPinsViasAndPads|Reset)’

The *Connection()* action is used to mark all connections from one pin, line or via to others. The *ResetFoundLinesAndRectangles*, *ResetFoundPinsAndVias* and *Reset* arguments may be used to reset all marked lines and rectangles, vias and pins or all of them. The search starts with the pin or via at the cursor position. All found objects are drawn with the color defined by the resource *connectedColor*. See also, *Display(Description|NameOnPCB|Value)*. Default:

!Shift<Key>c: Connection(Reset)

None<Key>f: Connection(Find)

!Shift<Key>f: Connection(Reset)

‘DeleteRats(AllRats|SelectedRats)’

This routine deletes either all rat-lines in the layout, or only the selected and visible ones. Non-rat-lines and other layout objects are unaffected. Default:

None<Key>e: DeleteRats(AllRats)

!Shift<Key>e: DeleteRats(SelectedRats)

‘DisableVendor()’

Disables automatic drill size mapping to the loaded vendor drill table.

DisableVendor()

‘DisperseElements(All|Selected)’

Disperses either all elements or only the selected elements in the layout. This action should be used at the start of a design to spread out all footprints before any placement or routing is done.

DisperseElements(All)



```
'Display(Description|NameOnPCB|Value)'
'Display(Toggle45Degree|CycleClip)'
'Display(Grid|ToggleGrid)'
'Display(ToggleRubberBandMode)'
'Display(Center|ClearAndRedraw|Redraw)'
'Display(Pinout|PinOrPadName)'
```

This action routines handles some output related settings. It is used to center the display around the cursor location and to redraw the output area optionally after clearing the window. Centering is done with respect to the *grid* setting. Displaying the grid itself may be switched on and off by *Grid* but only if the distance between two pixels exceeds 4 pixels. *Pcb* is able to handle several labels of an element. One of them is a description of the functionality (eg resistor), the second should be a unique identifier (R1) whereas the last one is a value (100k). The *Display()* action selects which of the names is displayed. It also controls which name will be affected by the *ChangeName* command. If *ToggleGrid* is passed, *Pcb* changes between relative ('rel' in the statusline) and absolute grid (an 'abs' in the statusline). Relative grid means the pointer position when the command is issued is used as the grid origin; while (0,0) is used in the absolute grid case. Passing *Pinout* displays the pinout of the element at the current cursor location whereas *PinOrPadName* toggles displaying of the pins or pads name under the cursor. If none of them matches but the cursor is inside of an element, the flags is toggled for all of its pins and pads. For details about rubberbands see also the details about *Mode*. Default:

```
None<Key>c: Display(Center)
None<Key>d: Display(PinOrPadName)
!Shift<Key>d: Display(Pinout)
None<Key>r: Display(ClearAndRedraw)
None<Key>.: Display(Toggle45Degree)
None<Key>/: Display(CycleClip)
```

'DRC()' Initiates design rule checking of the entire layout. Must be repeated until no errors are found.

'ExecuteFile(filename)'

Executes the PCB actions contained in the specified file. This can be used to automate a complex sequence of operations.

```
:ExecuteFile(custom.cmd)
```

The command file contains a list of PCB actions. Blank lines are ignored and lines starting with a # are treated as comment lines. For example

```
This is a comment line
Display(Grid)
SetValue(Zoom,2)
DRC()
```

'EditLayerGroups()'

Pops up a dialog box to edit the layergroup setting. The function is also available from the *Objects* menu. There are no defaults.

‘EnableVendor()’

Enables automatic drill size mapping to the loaded vendor drill table.

EnableVendor()

‘Load(ElementToBuffer|Layout|LayoutToBuffer|Netlist)’

This routine pops up a fileselect box to load layout, element data, or netlist. The passed filename for layout data is saved and may be reused. *ElementToBuffer* and *LayoutToBuffer* load the data into the current buffer. There are no defaults.

‘LoadVendor(vendorfile)’

Loads the specified vendor resource file.

LoadVendor(myvendor.res)

‘MarkCrosshair()’

This routine marks the current cursor location with an X, and then the cursor display shows both absolute position and position relative to the mark. If a mark is already present, this routine removes it and stops displaying relative cursor coordinates. Defaults:

!Ctrl<key>m: MarkCrosshair()

‘Mode(Copy|InsertPoint|Line|Move|None|PasteBuffer|Polygon|Thermal)’

‘Mode(Remove|Rectangle|RubberbandMove|Text|Via)’

‘Mode(Cycle)’

‘Mode(Notify)’

‘Mode(Save|Restore)’

Switches to a new mode of operation. The active mode is displayed by a thick line around the matching mode selector button. Most of the functionality of *Pcb* is implemented by selecting a mode and calling *Mode(Notify)*. The arguments *Line*, *Polygon*, *Rectangle*, *Text* and *Via* are used to create the appropriate object whenever *Mode(Notify)* is called. Some of them, such as *Polygon*, need more than one call for one object to be created. *InsertPoint* adds points to existing polygons or lines. *Save* and *Restore* are used to temporarily save the mode, switch to another one, call *Mode(Notify)* and restore the saved one. Have a look at the application resource file for examples. *Copy* and *Move* modes are used to change an object’s location and, optionally, to create a new one. The first call of *Mode(Notify)* attaches the object at the pointer location to the cross hair whereas the second one drops it to the layout. The *rubberband* version of move performs the move while overriding the current rubberband mode. Passing *PasteBuffer* attaches the contents of the currently selected buffer to the cross hair. Each call to *Mode(Notify)* pastes this contents to the layout. *Mode(Cycle)* cycles through the modes available in the mode-button pallet. *Mode(None)* switches all modes off. Default:

|                     |                                                    |
|---------------------|----------------------------------------------------|
| <Key>Escape:        | Mode(None)                                         |
| <Key>space:         | Mode(Cycle)                                        |
| None<Key>BackSpace: | Mode(Save) Mode(Remove) Mode(Notify) Mode(Restore) |
| None<Key>Delete:    | Mode(Save) Mode(Remove) Mode(Notify) Mode(Restore) |
| None<Key>F1:        | Mode(Via)                                          |
| None<Key>F2:        | Mode(Line)                                         |

```

None<Key>F3: Mode(PasteBuffer)
None<Key>F4: Mode(Rectangle)
None<Key>F5: Mode(Text)
None<Key>F6: Mode(Polygon)
None<Key>F7: Mode(Thermal)
None<Key>F8: Mode(Arc)
None<Key>Insert: Mode(InsertPoint)
None<Key>[: Mode(Save) Mode(Move) Mode(Notify)
None<Key>]: Mode(Notify) Mode(Restore)
None<Btn1>: Mode(Notify)
!Shift Ctrl<Btn1>: Mode(Save) Mode(Remove) Mode(Notify) Mode(Restore)
None<Btn2Down>: Mode(Save) Mode(Move) Mode(Notify)
None<Btn2Up>: Mode(Notify) Mode(Restore)
!Mod1<Btn2Down>: Mode(Save) Mode(Copy) Mode(Notify)
!Mod1<Btn2Up>: Mode(Notify) Mode(Restore)
Shift BTNMOD<Btn2Down>: Mode(Save) Mode(RubberbandMove) Mode(Notify)

```

‘MovePointer(delta\_x, delta\_y)’

With this function it is possible to move the cross hair cursor by using the cursor keys. The X server’s pointer follows because the necessary events are generated by Pcb. All movements are performed with respect to the currently set grid value. Default:

```

None<Key>Up: MovePointer(0, -1)
!Shift<Key>Up: MovePointer(0, -10)
None<Key>Down: MovePointer(0, 1)
!Shift<Key>Down: MovePointer(0, 10)
None<Key>Right: MovePointer(1, 0)
!Shift<Key>Right: MovePointer(10, 0)
None<Key>Left: MovePointer(-1, 0)
!Shift<Key>Left: MovePointer(-10, 0)

```

‘MoveToCurrentLayer(Object|SelectedObjects)’

The function moves a single object at the cross hair location or all selected objects to the current layer. Elements are not movable by this function. They have to be deleted and replaced on the other side. If a line segment is moved and the movement would result in a loss of connectivity to another segment then via(s) are automatically added to maintain the connectivity.

```

None<Key>m: MoveToCurrentLayer(Object)
!Shift<Key>m: MoveToCurrentLayer(SelectedObjects)

```

‘New()’ Clear the current layout and starts a new one after entering its name. Refer to the resource *backup* for more information. No defaults.

‘PasteBuffer(AddSelected|Clear|1..5)’

‘PasteBuffer(Rotate, 1..3)’

‘PasteBuffer(Convert)’

This action routine controls and selects the pastebuffer as well as all cut-and-paste operations. Passing a buffer number selects one in of the range 1..5. The statusline is updated with the new number. *Rotate* performs a number

of 90 degree counter clockwise rotations of the buffer contents. *AddSelected* as first argument copies all selected and visible objects into the buffer. Passing *Clear* removes all objects from the currently selected buffer. *Convert* causes the contents of the buffer (lines, arc, vias) to be converted into an element definition. Refer to [Section 3.5.8 \[Pastebuffer\], page 24](#) for examples. Default:

```
!Ctrl<Key>x: PasteBuffer(Clear) PasteBuffer(AddSelected)
 Mode(PasteBuffer)
!Shift Ctrl<Key>x: PasteBuffer(Clear) PasteBuffer(AddSelected)
 RemoveSelected() Mode(PasteBuffer)
!Mod1<Key>c: PasteBuffer(Clear) PasteBuffer(AddSelected)
!Mod1<key>x: PasteBuffer(Clear) PasteBuffer(AddSelected)
 RemoveSelected()
!Shift<Key>1: PasteBuffer(1)
!Shift<Key>2: PasteBuffer(2)
!Shift<Key>3: PasteBuffer(3)
!Shift<Key>4: PasteBuffer(4)
!Shift<Key>5: PasteBuffer(5)
None<Key>F3: Mode(PasteBuffer)
```

‘Polygon(Close|PreviousPoint)’

Polygons need a special action routine to make life easier. Calling *Polygon(PreviousPoint)* resets the newly entered corner to the previous one. The Undo action will call *Polygon(PreviousPoint)* when appropriate to do so. *Close* creates the final segment of the polygon. This may fail if clipping to 45 degree lines is switched on, in which case a warning is issued. Default:

```
None<Key>p: Polygon(Close)
!Shift<Key>p: Polygon(Close)
```

‘Print()’ Pops up a print control box that lets you select the output device, scaling and many more options. Each run creates all files that are supported by the selected device. These are mask files as well as drilling files, silk screens and so on. The table shows the filenames for all possible files:

| POSIX (extension) | 8.3 filename |
|-------------------|--------------|
| -----             | -----        |
| *_componentmask.* | cmsk.*       |
| *_componentsilk.* | cslk.*       |
| *_soldermask.*    | smsk.*       |
| *_soldersilk.*    | sslk.*       |
| *_drill.*         | dril.*       |
| *_groundplane.*   | gpl.*        |
| *_group[1..8].*   | [.8].*       |

The output may be sent to a post-processor by starting the filename with the *pipe* ("|") character. Any "%f" in a command is replaced with the current filename. The function is available from the *file* menu. There are no defaults.

‘Quit()’ Quits the application after confirming the operation. Default:

```
<Message>WM_PROTOCOLS: Quit()
```

`'Redo()'` This routine allows you to recover from the last undo command. You might want to do this if you thought that undo was going to revert something other than what it actually did (in case you are confused about which operations are un-doable), or if you have been backing up through a long undo list and over-shoot your stopping point. Any change that is made since the undo in question will trim the redo list. For example if you add ten lines, then undo three of them you could use redo to put them back, but if you move a line on the board before performing the redo, you will lose the ability to "redo" the three "undone" lines. Default:

```
!Shift<Key>r: Redo()
```

`'RemoveSelected()'`

This routine removes all visible and selected objects. There are no defaults.

`'Report(Object|DrillReport)'`

This routine pops up a dialog box describing the various characteristics of an object (or piece of an object such as a pad or pin) in the layout at the cursor position, or a report about all of the drill holes in the layout. There are no defaults.

`'RouteStyle(1|2|3|4)'`

This routine copies the sizes corresponding to the numbered route style into the active line thickens, via diameter, and via drill size. Defaults:

```
!Ctrl<Key>1: RouteStyle(1)
...
!Ctrl<Key>NUM_STYLES: RouteStyle(NUM_STYLES)
```

The variable NUM\_STYLES is set at compile time in `'globalconfig.h'`.

`'Save(Layout|LayoutAs)'`

`'Save(AllConnections|AllUnusedPins|ElementConnections)'`

Passing *Layout* saves the layout using the file from which it was loaded or, if it is a new layout, calls *Save(LayoutAs)* which queries the user for a filename. The values: *AllConnections*, *AllUnusedPins* and *ElementConnections* start a connection scan and save all connections, all unused pins or the connections of a single element to a file. There are no defaults.

`'Select(All|Block|Connection|ToggleObject)'`

`'Select(ElementByName|ObjectByName|PadByName|PinByName)'`

`'Select(TextByName|ViaByName)'`

Toggles either the selection flag of the object at the cross hair position (*ToggleObject*) or selects all visible objects, all inside a rectangle or all objects which have been found during the last connection scan. The *ByName* functions use a [Appendix D \[Regular Expressions\], page 109](#) search, always case insensitive, to select the objects. Default:

```
None<Btn3Down>: Select(ToggleObject)
None<Btn3Down>,None<Btn3Motion>: See resource file - this is complex
```

`'SetFlag(Object|SelectElements|SelectedPins|SelectedVias|Selected,thermal|octagon|square)'`

Sets the indicated flag. This adds thermals, sets the flag which indicates a pin/pad should be square, or sets the flag which indicates a pin/pad should be octagonal.

`:SetFlag(Selected,thermal)`

`'SetValue(Grid|LineSize|TextScale|ViaDrillingHole|ViaSize|Zoom, value)'`

Some internal values may be changed online by this function. The first parameter specifies which data has to be changed. The other one determines if the resource is set to the passed value, if *value* is specified without sign, or increments/decrements if it is specified with a plus or minus sign. The function doesn't change any existing object only the initial values of new objects. Use the *ChangeSize()* and *ChangeDrillSize()* to change existing objects. Default:

```
None<Key>g: SetValue(Grid, +5)
!Shift<Key>g: SetValue(Grid, -5)
None<Key>l: SetValue(LineSize, +5)
!Shift<Key>l: SetValue(LineSize, -5)
None<Key>t: SetValue(TextScale, +10)
!Shift<Key>t: SetValue(TextScale, -10)
None<Key>v: SetValue(ViaSize, +5)
!Shift<Key>v: SetValue(ViaSize, -5)
!Mod1<Key>v: SetValue(ViaDrillingHole, +5)
!Mod1 Shift<Key>v: SetValue(ViaDrillingHole, -5)
None<Key>z: SetValue(Zoom, -1)
!Shift<Key>z: SetValue(Zoom, +1)
```

`'SwapSides()'`

This routine changes the board side you are viewing. Default:

```
None<Key>Tab: SwapSides()
```

`'SwitchDrawingLayer(value)'`

Makes layer number 1..MAX\_LAYER the current one. Default:

```
None<Key>1: SwitchDrawingLayer(1)
...
None<Key>MAX_LAYER: SwitchDrawingLayer(MAX_LAYER)
```

`'ToggleHideName(Object|SelectedElements)'`

Toggles whether the element's name is displayed or hidden. If it is hidden you won't see it on the screen and it will not appear on the silk layer when you print the layout.

```
None<Key>h: ToggleHideName(Object)
!Shift<Key>h: ToggleHideName(SelectedElements)
```

`'ToggleVendor()'`

Toggles automatic drill size mapping to the loaded vendor drill table.

```
ToggleVendor()
```

`'ToggleVisibility(Layer)'`

Toggles the visibility of the layer.

```

Mod1<Key>1: ToggleVisibility(1)
Mod1<Key>2: ToggleVisibility(2)
Mod1<Key>3: ToggleVisibility(3)
Mod1<Key>4: ToggleVisibility(4)

```

```
'Undo()'
```

```
'Undo(ClearList)'
```

The unlimited undo feature of Pcb allows you to recover from most operations that materially affect your work. Calling *Undo()* without any parameter recovers from the last (non-undo) operation. *ClearList* is used to release the allocated memory. *ClearList* is called whenever a new layout is started or loaded. See also *Redo*. Default:

```

None<Key>u: Undo()
!Shift Ctrl<Key>u: Undo(ClearList)

```

```
'UnloadVendor()'
```

Unloads the loaded vendor drill table.

```
UnloadVendor()
```

```
'Unselect(All|Block|Connection)'
```

Unselects all visible objects, all inside a rectangle or all objects which have been found during the last connection scan. Default:

```

!Shift <Btn3Down>: Mode(Save) Mode(None) Unselect(Block)
!Shift <Btn3Up>: Unselect(Block) Mode(Restore)

```

### 8.3 Default Translations

This section covers some default translations of key and button events as defined in the shipped default application resource file. Most of them have already been listed in [Section 8.2 \[Actions\], page 59](#). Pcb makes use of a nice X11 feature; calling several action routines for one event.

```
'None<Key>BackSpace:'
```

```
'None<key>Delete:'
```

```
'!Shift<Key>BackSpace:'
```

```
'!Shift Ctrl<Btn1>:'
```

The object at the cursor location is removed by *None<Key>BackSpace* or *Shift Ctrl<Btn1>* whereas *Shift<Key>BackSpace* also removes all other objects that are fully-connected to the one at the cursor location.

```
'!Mod1 Ctrl<Key>Left:'
```

```
'!Mod1 Ctrl<Key>Right:'
```

```
'!Mod1 Ctrl<Key>Up:'
```

```
'!Mod1 Ctrl<Key>Down:'
```

Scroll one page in one of the four directions.

```
'None<Key>Left:, !Shift<Key>Left:'
```

```
'None<Key>Right:, !Shift<Key>Right:'
```

```
'None<Key>Up:, !Shift<Key>Up:'
```

```
'None<Key>Down:, !Shift<Key>Down:'
```

Move cross hair either one or ten points in grid.

`'None<Key>Return:'`

Finished user input, selects the 'default' button of dialogs.

`'None<Key>Escape:'`

*Mode(Reset)*, aborts user input, selects the 'abort' button of dialogs or resets all modes.

`'None<Btn2Down>, Btn2<Motion>, None<Btn2Up>:'`

`'!Mod1<Btn2Down>, Btn2<Motion>, !Mod1<Btn2Up>:'`

The first sequence moves the object or element name at the cursor location.

The second one copies the objects. Copying isn't available for element names.



## 9 File Formats


All files used by `Pcb` are read from the standard output of a command or written to the standard input of one as plain seven bit `ASCII`. This makes it possible to use any editor to change the contents of a layout file. It is the only way for element or font description files to be created. To do so you'll need to study the example files `'example/*'` and `'default_font'` which are shipped with `Pcb`. For an overview refer to [Chapter 2 \[Intro\], page 5](#).

The following sections provide the necessary information about the syntax of the files. Netlist files are not created by `Pcb`, but it does use them. For information on the format of a netlist file see the `:rn`, [Chapter 6 \[User Commands\], page 38](#). The commands described allow you to add almost any additional functionality you may need. Examples are compressed read and write access as well as archives. The commands themselves are defined by the resources `elementCommand`, `fileCommand`, `fontCommand`, `libraryCommand`, `libraryContentsCommand` and `saveCommand`. Note that the commands are not saved along with the data. It is considered an advantage to have the layout file contain all necessary information, independent of any other files.

One thing common to all files is they may include comments, newlines, and carriage returns at any place except within quoted strings.

### 9.1 Pad and Line Representation

Pads and lines (copper traces, silk screen lines, etc) are represented by the line end points and the aperture used to draw the line. It is important to understand this when creating the pads for a new footprint. The following figure illustrates a pad or line which is drawn using a square aperture. The end points  $(X_0, Y_0)$ ,  $(X_1, Y_1)$  specify the center of the aperture. The size parameter specifies the size of the aperture.

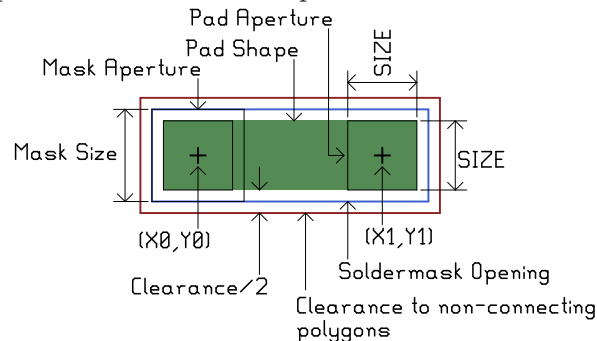

Pads and lines are represented in this way because this is how lines are specified in `RS-274X` (Gerber) files which are used for creating the masks used in board manufacturing. In fact, older mask making equipment created lines in precisely this fashion. A physical aperture was used to pass light through onto a photosensitive film.

### 9.2 Layout File Format

The layout file describes a complete layout including symbols, vias, elements and layers with lines, rectangles and text. This is the most complex file of all. As `Pcb` has evolved, the file format has changed several times to accommodate new features. `Pcb` has always been able to read all older versions of the `.pcb` file. This allows the migration of older designs to

newer versions of the program. Obviously older versions of `Pcb` will not be able to properly read layout files stored in newer versions of the file format.

In practice it is very common for footprint libraries to contain elements which have been defined in various versions of the `Pcb` file format. When faced with trying to understand an element file or layout file which includes syntax not defined here, the best approach is to examine the file `'src/parse_y.y'` which is the definitive definition of the file format.

The PCB layout file contains the following contents, in this order (individual items are defined in [Section 9.8 \[File Syntax\], page 75](#)):

|                                               |                                                          |
|-----------------------------------------------|----------------------------------------------------------|
| <code>PCB</code>                              | This names the board and sets its size                   |
| <code>Grid</code>                             | Optional.                                                |
| <code>Cursor</code>                           | Optional.                                                |
| <code>Flags</code>                            | Optional.                                                |
| <code>Groups</code>                           | Optional.                                                |
| <code>Styles</code>                           | Optional.                                                |
| <code>Symbols</code>                          | Optional.                                                |
| <code>Vias, Rats, Layers, and Elements</code> | These may occur in any order, at this point in the file. |
| <code>Netlists</code>                         | Optional.                                                |

### 9.3 Element File Format

Element files are used to describe one component which then may be used several times within one or more layouts. You will normally split the file into two parts, one for the pinout and one for the package description. Using `m4` allows you to define pin names as macros in one file and include a package description file which evaluates the macros. See the resource *elementCommand* for more information. The pins (and pads) must appear in sequential order in the element file (new in 1.5) so that pin 1 must be the first `PIN(...)` in the file.

Doing things this way makes it possible to use one package file for several different circuits. See the sample files `'dil*'`.

The lowest x and y coordinates of all sub-objects of an element are used as an attachment point for the cross hair cursor of the main window, unless the element has a mark, in which case that's the attachment point.

### 9.4 Font File Format

A number of user defined Symbols are called a font. There is only one per layout. All symbols are made of lines. See the file `'default_font'` as an example.

A font file is simply a text file that contains the defined symbols making up the font. The font file text can be inserted into a layout file after the Styles definition.

If a layout file does not contain a font, component labels will be invisible, although component outlines, pins and pads will be visible.

The lowest x and y coordinates of all lines of a font are transformed to (0,0).

Font symbols are typically 4000mil high, and are rendered with `SymbolLine` primitives. Arcs and polygons are not supported in font symbols.

A typical symbol:

```
Symbol[''' 1200]
(
 SymbolLine[0 1000 0 2334 800]
 SymbolLine[1523 1000 1523 2334 800]
)
```

In the example above, 1200 indicates the intercharacter spacing required after the symbol, in this case the symbol is the double quote `''`. The `SymbolLine` definitions define the lines making up the symbol as `[x1 y1 x2 y2 linewidth]`. Standard height symbols, such as the letter H or N, span 1000 to 5000 in the y axis, where 0,0 is at the upper left. Taller symbols, such as a bracket, may span 0 to 6000 in the y axis. Symbols for use as `Pcb` fonts can be generated from fonts intended for use in pen plotters or engravers, known as centerline fonts, or one stroke fonts. Outline fonts, such as TTF fonts, if converted to `Pcb` format, are usually converted into polygons which are incompatible with font symbol rendering.

A practical means by which a new font symbol can be created is to export the character as an Encapsulated Postscript (EPS) image, and run a utility such as `pstoedit` to convert to `Pcb` compatible line descriptions.

```
pstoedit artwork.eps -psarg "-r1000x1000" -f pcb artwork.pcb
```

The `-r1000x1000` command makes the paths adhere to a 1000x1000 grid. The resulting `'artwork.pcb'` file can be used to create a font symbol. An efficient way to convert multiple symbols is to export an entire glyph table as EPS, run the `pstoedit` utility to create a `PCB` file with all of the font symbols of interest, and after loading the `PCB` file, select one font symbol at a time and save the `PCB` file using `CTRL-S`. In a console terminal:

```
cat artwork.pcb | grep "elected" > SelectedSymbol.txt
```

will extract the line descriptors for the selected symbol, which can then be used to create a font symbol, after extraction of the `x1,y1,x2,y2` coordinates, followed by suitable scaling and translation of the coordinates.

A set of font symbols can be combined to create a font file.

## 9.5 Netlist File Format

Netlists read by `Pcb` must have this simple text form:

```
netname [style] NAME-PINNUM NAME2-PINNUM2 NAME3-PINNUM3 ... [\]
```

for each net on the layout. where "netname" is the name of the net which must be unique for each net, [style] is an optional route-style name, NAME is the layout-name name given to an element, and PINNUM is the (usually numeric) pin number of the element that connects to the net (for details on pin numbering see [Section 2.4 \[Element Objects\], page 6](#)). Spaces or tabs separate the fields. If the line ends with a `"\"` the net continues on the next line and the `"\"` is treated exactly as if it were a space. If a NAME ends with a lower-case letter, all lower-case letters are stripped from the end of the NAME to determine the matching layout-name name. For example:

```
Data U1-3 U2abc-4 FLOP1a-7 Uabc3-A9
```

specifies that the net called "Data" should have pin 3 of U1 connected to pin 4 of U2, to pin 7 of FLOP1 and to pin A9 of Uabc3. Note that element name and pin number strings are case-sensitive. It is up to you to name the elements so that their layout-name names agrees with the netlist.

## 9.6 Library Contents File Format

There is nothing like a special library format. The ones that have been introduced in 1.4.1 just use some nice (and time consuming) features of GNU `m4`. The only predefined format is the one of the contents file which is read during startup. It is made up of two basic line types:

```
menu entry = "TYPE="name
contents line = template":"package":"value":"description
name = String
template = String
package = String
value = String
description = String
String = <anything except ":", "\n" and "\r">
```

No leading white spaces or comments are allowed in this file. If you need either one, define a command that removes them before loading. Have a look to the *libraryContentsCommand* resource.

The menu entry will appear in the selection menu at the top and of the library window.

## 9.7 Library File Format

This section provides an overview about the existing `m4` definitions of the elements. There are basically two different types of files. One to define element specific data like the pinout, package and so on, the other to define the values. For example the static RAM circuits 43256 and 62256 are very similar. They therefore share a common definition in the macro file but are defined with two different value labels.

The macro file entry:

```
define('Description_43256_dil', 'SRAM 32Kx8')
define('Param1_43256_dil', 28)
define('Param2_43256_dil', 600)
define('PinList_43256_dil', 'pin1', 'pin2', ...')
```

And the list file:

```
43256_dil:N:43256:62256
```

The macro must define a description, the pin list and up to two additional parameters that are passed to the package definitions. The first one is the number of pins whereas the second one defines for example the width of a package.

It is very important to select a unique identifier for each macro. In the example this would be *43256\_dil* which is also the templates name. It is required by some low-level macros that *Description\_*, *Param1\_*, *Param2\_* and *PinList\_* are prepended.

The list file uses a syntax:

```
template:package:value[:more values]
```

This means that the shown example will create two element entries with the same package and pinout but with different names.

A number of packages are defined in 'common.m4'. Included are:

```
DIL packages with suffix D, DW, J, JD, JG, N, NT, P
PLCC
T03
generic connectors
DIN 41.612 connectors
zick-zack (SD suffix)
15 pin multiwatt
```

If you are going to start your own library please take care about m4 functions. Be aware of quoting and so on and, most important check your additional entry by calling the macro:

```
CreateObject('template', 'value', 'package suffix')
```

If quoting is incorrect an endless loop may occur (broken by a out-of-memory message).

The scripts in the 'lib' directory handle the creation of libraries as well as of their contents files. Querying is also supported.

I know quite well that this description of the library implementation is not what some out there expect. But in my opinion it's much more useful to look at the comments and follow the macros step by step.

## 9.8 File Syntax

A special note about units: Older versions of pcb used mils (1/1000 inch) as the base unit; a value of 500 in the file meant half an inch. Newer versions uses a "high resolution" syntax, where the base unit is 1/100 of a mil (0.000010 inch); a value of 500 in the file means 5 mils. As a general rule, the variants of each entry listed below which use square brackets are the high resolution formats and use the 1/100 mil units, and the ones with parentheses are the older variants and use 1 mil units. Note that when multiple variants are listed, the most recent (and most preferred) format is the first listed.

The square bracket syntax specifies only the enclosed values as high resolution. Whenever child elements need high resolution, they have to use square brackets on their own, as in this example:

```
Symbol['!' 12] # 12 is a high resolution value
(# <--- this pair is only for grouping and can never be a square
 SymbolLine[0 4500 0 5000 8] # high resolution
 SymbolLine(0 10 0 35 8) # standard resolution
```

Symbolic and numeric flags (SFlags and NFlags) are described in [Section 9.9 \[Object Flags\]](#), page 88.

### 9.8.1 Arc

Current syntax:

```
Arc [X Y RadiusX RadiusY Thickness Clearance StartAngle DeltaAngle SFlags]
```

Legacy syntax:

```
Arc (X Y RadiusX RadiusY Thickness Clearance StartAngle DeltaAngle NFlags)
Arc (X Y RadiusX RadiusY Thickness StartAngle DeltaAngle NFlags)
```

*X Y*        Coordinates of the center of the arc.

*RadiusX RadiusY*

The *RadiusX* and *RadiusY*, from the center to the edge (centerline of the trace). The bounds of the circle of which this arc is a segment, is thus  $2 * RadiusX$  by  $2 * RadiusY$ .

*Thickness*    The width of the copper trace which forms the arc.

*Clearance*    The amount of space cleared around the arc when the line passes through a polygon. The clearance is added to the thickness to get the thickness of the clear; thus the space between the arc and the polygon is  $Clearance/2$  wide.

*StartAngle*

The angle of one end of the arc, in degrees. In PCB, an angle of zero points left (negative X direction), and 90 degrees points down (positive Y direction).

*DeltaAngle*

The sweep of the arc. This may be negative. Positive angles sweep counter-clockwise.

*SFlags*        Symbolic or numeric flags.

*NFlags*        Numeric flags.

### 9.8.2 Attribute

```
Attribute ("Name" "Value")
```

Attributes allow boards and elements to have arbitrary data attached to them, which may or may not be used by PCB itself, but may be of use by other programs or users.

*Name*        The name of the attribute

*Value*        The value of the attribute. Values are always stored as strings, even if the value is interpreted as, for example, a number.

Below are some examples of global (board wide) attributes:

```
Attribute("PCB::grid::unit" "mil")
```

```
Attribute("PCB::grid::size" "39.37mil")
```

```
Attribute("PCB::grid::unit" "mm")
```

and some examples for attributes in an element (local):

```

Element["lock" "BGA676N100P26X26-2700X2700X260" "U?" "FG676" 20.0000mm 20.0000mm 0.0000mm]
(
 Attribute("author" "PCB Contributors")
 Attribute("dist-license" "GPL2")
 Attribute("use-license" "unlimited2")
 Attribute("status" "Experimental")
 Attribute("attributes in footprint" "1")
 Attribute("package body length" "27.000000")
 Attribute("package body width" "27.000000")
 Attribute("package height" "2.600000")
)

```

### 9.8.3 Connect

```
Connect ("PinPad")
```

*PinPad* The name of a pin or pad which is included in this net. Pin and Pad names are named by the refdes and pin name, like "U14-7" for pin 7 of U14, or "T4-E" for pin E of T4.

### 9.8.4 Cursor

Legacy syntax:

```

Cursor [X Y Zoom]
Cursor (X Y Zoom)

```

*X Y* Location of the cursor when the board was saved. As of November 2012 the cursor position is not written to file anymore. Older versions of pcb ignore the absence of this line in the pcb file.

*Zoom* The current zoom factor. Note that a zoom factor of "0" means 1 mil per screen pixel, N means  $2^N$  mils per screen pixel, etc. The first variant accepts floating point numbers. The special value "1000" means "zoom to fit"  
This field is ignored by PCB.

### 9.8.5 DRC

```

DRC [Bloat Shrink Line Silk Drill Ring]
DRC [Bloat Shrink Line Silk]
DRC [Bloat Shrink Line]

```

*Bloat* Minimum spacing between copper.

*Shrink* Minimum copper overlap to guarantee connectivity.

*Line* Minimum line thickness.

|              |                                                         |
|--------------|---------------------------------------------------------|
| <i>Silk</i>  | Minimum silk thickness.                                 |
| <i>Drill</i> | Minimum drill size.                                     |
| <i>Ring</i>  | Minimum width of the annular ring around pins and vias. |

### 9.8.6 Element

Current syntax:

```
Element [SFlags "Desc" "Name" "Value" MX MY TX TY TDir TScale TSFlags] (
 ... contents ...
)
```

Legacy syntax:

```
Element (NFlags "Desc" "Name" "Value" MX MY TX TY TDir TScale TNFlags) (
Element (NFlags "Desc" "Name" "Value" TX TY TDir TScale TNFlags) (
Element (NFlags "Desc" "Name" TX TY TDir TScale TNFlags) (
Element ("Desc" "Name" TX TY TDir TScale TNFlags) (
 ... contents ...
)
```

|                |                                                                                                                                            |
|----------------|--------------------------------------------------------------------------------------------------------------------------------------------|
| <i>SFlags</i>  | Symbolic or numeric flags, for the element as a whole.                                                                                     |
| <i>NFlags</i>  | Numeric flags, for the element as a whole.                                                                                                 |
| <i>Desc</i>    | The description of the element. This is one of the three strings which can be displayed on the screen.                                     |
| <i>Name</i>    | The name of the element, usually the reference designator.                                                                                 |
| <i>Value</i>   | The value of the element.                                                                                                                  |
| <i>MX MY</i>   | The location of the element's mark. This is the reference point for placing the element and its pins and pads.                             |
| <i>TX TY</i>   | The upper left corner of the text (one of the three strings).                                                                              |
| <i>TDir</i>    | The relative direction of the text. 0 means left to right for an unrotated element, 1 means up, 2 left, 3 down.                            |
| <i>TScale</i>  | Size of the text, as a percentage of the "default" size of of the font (the default font is about 40 mils high). Default is 100 (40 mils). |
| <i>TSFlags</i> | Symbolic or numeric flags, for the text.                                                                                                   |
| <i>TNFlags</i> | Numeric flags, for the text.                                                                                                               |

Elements may contain pins, pads, element lines, element arcs, attributes, and (for older elements) an optional mark. Note that element definitions that have the mark coordinates in the element line, only support pins and pads which use relative coordinates. The pin and pad coordinates are relative to the mark. Element definitions which do not include the mark coordinates in the element line, may have a Mark definition in their contents, and only use pin and pad definitions which use absolute coordinates.



### 9.8.7 ElementArc

Current syntax:

```
ElementArc [X Y Width Height StartAngle DeltaAngle Thickness]
```

Legacy syntax:

```
ElementArc (X Y Width Height StartAngle DeltaAngle Thickness)
```

*X Y* Coordinates of the center of the arc. These are relative to the Element's mark point for new element formats, or absolute for older formats.

*Width Height*

The width and height, from the center to the edge. The bounds of the circle of which this arc is a segment, is thus  $2 * Width$  by  $2 * Height$ .

*StartAngle*

The angle of one end of the arc, in degrees. In PCB, an angle of zero points left (negative X direction), and 90 degrees points down (positive Y direction).

*DeltaAngle*

The sweep of the arc. This may be negative. Positive angles sweep counter-clockwise.

*Thickness* The width of the silk line which forms the arc.

### 9.8.8 ElementLine

Current syntax:

```
ElementLine [X1 Y1 X2 Y2 Thickness]
```

Legacy syntax:

```
ElementLine (X1 Y1 X2 Y2 Thickness)
```

*X1 Y1 X2 Y2*

Coordinates of the endpoints of the line. These are relative to the Element's mark point for new element formats, or absolute for older formats.

*Thickness* The width of the silk for this line.

### 9.8.9 FileVersion

```
FileVersion[Version]
```

*Version* File format version. This version number represents the date when the pcb file format was last changed.

Any version of pcb build from sources equal to or newer than this number should be able to read the file. If this line is not present in the input file then file format compatibility is not checked.

### 9.8.10 Flags

```
Flags(Number)
```

*Number* A number, whose value is normally given in hex, individual bits of which represent pcb-wide flags as defined in [Section 9.10 \[PCBFlags\]](#), page 89.

### 9.8.11 Grid

Current syntax:

```
Grid [Step OffsetX OffsetY Visible]
```

Legacy syntax:

```
Grid (Step OffsetX OffsetY Visible)
Grid (Step OffsetX OffsetY)
```

*Step* Distance from one grid point to adjacent points. This value may be a floating point number for the first two variants.

*OffsetX OffsetY*  
The "origin" of the grid. Normally zero.

*Visible* If non-zero, the grid will be visible on the screen.

### 9.8.12 Groups

```
Groups("String")
```

*String*

Encodes the layer grouping information. Each group is separated by a colon, each member of each group is separated by a comma. Group members are either numbers from 1..N for each layer, and the letters **c** or **s** representing the component side and solder side of the board. Including **c** or **s** marks that group as being the top or bottom side of the board.

```
Groups("1,2,c:3:4:5,6,s:7,8")
```

### 9.8.13 Layer

```
Layer (LayerNum "Name" "Flags") (
 ... contents ...
)
```

*LayerNum* The layer number. Layers are numbered sequentially, starting with 1. The last two layers (9 and 10 by default) are solder-side silk and component-side silk, in that order. The two silk layers also mark top and bottom side; the layer group where the solder-side silk layer is member in is the solder side group. Analogous for the other side.

*Name* The layer name.

For layout files predating layer flags the name also defines the layer type in some situations. For example, a layer named *outline* was considered to be the layer defining the extents of the board.

*Flags* Layer flags. Currently this is the layer type, like *copper*, *silk* or *outline*. For a complete list see `layertype_name[]` in `layerflags.c`.

With layer flags missing, the type of layer is guessed at load time, mostly by the layer name. This mechanism ensures compatibility with older layouts.

*contents* The contents of the layer, which may include attributes, lines, arcs, rectangles, text, and polygons.

### 9.8.14 Line

Current syntax:

```
Line [X1 Y1 X2 Y2 Thickness Clearance SFlags]
```

Legacy syntax:

```
Line (X1 Y1 X2 Y2 Thickness Clearance NFlags)
Line (X1 Y1 X2 Y2 Thickness NFlags)
```

*X1 Y1 X2 Y2*

The end points of the line

*Thickness* The width of the line

*Clearance* The amount of space cleared around the line when the line passes through a polygon. The clearance is added to the thickness to get the thickness of the clear; thus the space between the line and the polygon is  $Clearance/2$  wide.

*SFlags* Symbolic or numeric flags

*NFlags* Numeric flags.

### 9.8.15 Mark

Legacy syntax:

```
Mark [X Y]
Mark (X Y)
```

*X Y*        Coordinates of the Mark, for older element formats that don't have the mark as part of the Element line.

### 9.8.16 Net

```
Net ("Name" "Style") (
 ... connects ...
)
```

*Name*        The name of this net.

*Style*        The routing style that should be used when autorouting this net.

### 9.8.17 Netlist

```
Netlist () (
 ... nets ...
)
```

### 9.8.18 Pad

Current syntax:

```
Pad [rX1 rY1 rX2 rY2 Thickness Clearance Mask "Name" "Number" SFlags]
```

Legacy syntax:

```
Pad (rX1 rY1 rX2 rY2 Thickness Clearance Mask "Name" "Number" NFlags)
Pad (aX1 aY1 aX2 aY2 Thickness "Name" "Number" NFlags)
Pad (aX1 aY1 aX2 aY2 Thickness "Name" NFlags)
```

*rX1 rY1 rX2 rY2*

Coordinates of the endpoints of the pad, relative to the element's mark. Note that the copper extends beyond these coordinates by half the thickness. To make a square or round pad, specify the same coordinate twice.

*aX1 aY1 aX2 aY2*

Same, but absolute coordinates of the endpoints of the pad.

*Thickness*    width of the pad.

*Clearance* add to thickness to get clearance width.

*Mask* width of solder mask opening.

*Name* name of pin

*Number* number of pin

*SFlags* symbolic or numerical flags

*NFlags* numerical flags only

### 9.8.19 PCB

Current syntax:

```
PCB ["Name" Width Height]
```

Legacy syntax:

```
PCB ("Name" Width Height)
PCB ("Name")
```

*Name* Name of the PCB project

*Width Height*

Size of the board

If you don't specify the size of the board, a very large default is chosen.

### 9.8.20 Pin

Current syntax:

```
Pin [rX rY Thickness Clearance Mask Drill "Name" "Number" SFlags]
```

Legacy syntax:

```
Pin (rX rY Thickness Clearance Mask Drill "Name" "Number" NFlags)
Pin (aX aY Thickness Drill "Name" "Number" NFlags)
Pin (aX aY Thickness Drill "Name" NFlags)
Pin (aX aY Thickness "Name" NFlags)
```

*rX rY* coordinates of center, relative to the element's mark

*aX aY* absolute coordinates of center.

*Thickness* outer diameter of copper annulus

*Clearance* add to thickness to get clearance diameter

*Mask* diameter of solder mask opening

|               |                             |
|---------------|-----------------------------|
| <i>Drill</i>  | diameter of drill           |
| <i>Name</i>   | name of pin                 |
| <i>Number</i> | number of pin               |
| <i>SFlags</i> | symbolic or numerical flags |
| <i>NFlags</i> | numerical flags only        |

### 9.8.21 PolyArea

```
PolyArea [Area]
```

*Area* Minimum area of polygon island to retain. If a polygon has clearances that cause an isolated island to be created, then will only be retained if the area exceeds this minimum area.

### 9.8.22 Polygon

Current syntax:

```
Polygon (SFlags) (
 ... [X Y] ...
 Hole (
 ... [X Y] ...
)
 ...
)
```

Legacy syntax:

```
Polygon (SFlags) (
 ... (X Y) ...
 Hole (
 ... (X Y) ...
)
 ...
)
```

*SFlags* Symbolic or numeric flags.

*X Y* Coordinates of each vertex. You must list at least three coordinates.

*Hole (...)* Defines a hole within the polygon's outer contour. There may be zero or more such sections.

### 9.8.23 Rat

Current syntax:

```
Rat [X1 Y1 Group1 X2 Y2 Group2 SFlags]
```

Legacy Syntax:

```
Rat (X1 Y1 Group1 X2 Y2 Group2 NFlags)
```

*X1 Y1 X2 Y2*

The endpoints of the rat line.

*Group1 Group2*

The layer group each end is connected on.

*SFlags* Symbolic or numeric flags.

*NFlags* Numeric flags.

### 9.8.24 Styles

```
Styles("String")
```

*String*

Encodes the four routing styles `pcb` knows about. The four styles are separated by colons. Each style consists of five parameters as follows:

*Name* The name of the style.

*Thickness* Width of lines and arcs.

*Diameter* Copper diameter of pins and vias.

*Drill* Drill diameter of pins and vias.

*Keepaway* Minimum spacing to other nets. If omitted, 10 mils is the default.

*Via Mask Aperture (optional)*

The diameter of the solder mask opening around vias. A value of 0 produces a tented via. This parameter is omitted if 0 for backwards compatibility.

Current syntax example:

```
Styles["Logic,1000,3600,2000,1000,0:Power,2500,6000,3500,1000,70mil:
Line,4000,6000,3500,1000:Breakout,600,2402,1181,600"]
```

Legacy syntax example:

```
Styles("Signal,10,40,20:Power,25,60,35:Fat,40,60,35:Skinny,8,36,20")
```

Note that strings in actual files cannot span lines; the above example is split across lines only to make it readable.

### 9.8.25 Symbol

Current syntax:

```
Symbol [Char Delta] (
 ... symbol lines ...
)
```

Legacy syntax:

```
Symbol (Char Delta) (
 ... symbol lines ...
)
```

*Char*        The character or numerical character value this symbol represents. Characters must be in single quotes.

*Delta*       Additional space to allow after this character.

### 9.8.26 SymbolLine

Current syntax:

```
SymbolLine [X1 Y1 X2 Y2 Thickness]
```

Legacy syntax:

```
SymbolLine (X1 Y1 X2 Y2 Thickness)
```

*X1 Y1 X2 Y2*

The endpoints of this line.

*Thickness*   The width of this line.

### 9.8.27 Text

Current syntax:

```
Text [X Y Direction Scale "String" SFlags]
```

Legacy syntax:

```
Text (X Y Direction Scale "String" NFlags)
Text (X Y Direction "String" NFlags)
```

*X Y*         The location of the upper left corner of the text.



*Direction* 0 means text is drawn left to right, 1 means up, 2 means right to left (i.e. upside down), and 3 means down.

*Scale* Size of the text, as a percentage of the “default” size of of the font (the default font is about 40 mils high). Default is 100 (40 mils).

*String* The string to draw.

*SFlags* Symbolic or numeric flags.

*NFlags* Numeric flags.

### 9.8.28 Thermal

```
Thermal [Scale]
```

*Scale* Relative size of thermal fingers. A value of 1.0 makes the finger width twice the clearance gap width (measured across the gap, not diameter). The normal value is 0.5, which results in a finger width the same as the clearance gap width.

### 9.8.29 Via

Current syntax:

```
Via [X Y Thickness Clearance Mask Drill BuriedFrom BuriedTo "Name" SFlags]
Via [X Y Thickness Clearance Mask Drill "Name" SFlags]
```

Legacy syntax:

```
Via (X Y Thickness Clearance Mask Drill "Name" NFlags)
Via (X Y Thickness Clearance Drill "Name" NFlags)
Via (X Y Thickness Drill "Name" NFlags)
Via (X Y Thickness "Name" NFlags)
```

*X Y* coordinates of center

*Thickness* outer diameter of copper annulus

*Clearance* add to thickness to get clearance diameter

*Mask* diameter of solder mask opening

*Drill* diameter of drill

*BuriedFrom*  
upper layer from which the buried via starts

*BuriedTo* lower layer to which the buried via ends

*Name* string, name of via (vias have names?)

*SFlags* symbolic or numerical flags

*NFlags* numerical flags only

Example:

```
Via[15.0000mm 11.0000mm 24.00mil 12.00mil 0.0000 11.81mil 0 5 "" ""]
```

The above example gives a via at coordinates x=15.0000 mm, y=11.0000mm, with a 24.00mil thickness, a 6.00mil clearance, a 0.0000 gap, a -12.00mil mask (tented), a 11.81mil drill width, starting at the top layer ("0"), ending at the 3rd copper layer ("2"), and has no names and no flags.

## 9.9 Object Flags

Note that object flags can be given numerically (like 0x0147) or symbolically (like "found,showname,square". Some numeric values are reused for different object types. The table below lists the numeric value followed by the symbolic name.

0x0001 pin

If set, this object is a pin. This flag is for internal use only.

0x0002 via

Likewise, for vias.

0x0004 found

If set, this object has been found by `FindConnection()`.

0x0008 hole

For pins and vias, this flag means that the pin or via is a hole without a copper annulus.

0x0008 nopaste

For pads, set to prevent a solderpaste stencil opening for the pad. Primarily used for pads used as fiducials.

0x0010 rat

If set for a line, indicates that this line is a rat line instead of a copper trace.

0x0010 pininpoly

For pins and pads, this flag is used internally to indicate that the pin or pad overlaps a polygon on some layer.

0x0010 clearpoly

For polygons, this flag means that pins and vias will normally clear these polygons (thus, thermals are required for electrical connection). When clear, polygons will solidly connect to pins and vias.

0x0010 hidename

For elements, when set the name of the element is hidden.

0x0020 showname

For elements, when set the names of pins are shown.

0x0020 clearline

For lines and arcs, the line/arc will clear polygons instead of connecting to them.

0x0020 fullpoly

For polygons, the full polygon is drawn (i.e. all parts instead of only the biggest one).

- 0x0040 **selected**  
Set when the object is selected.
- 0x0080 **onsolder**  
For elements and pads, indicates that they are on the solder side.
- 0x0080 **auto**  
For lines and vias, indicates that these were created by the autorouter.
- 0x0100 **square**  
For pins and pads, indicates a square (vs round) pin/pad.
- 0x0200 **rubberend**  
For lines, used internally for rubber band moves.
- 0x0200 **warn**  
For pins, vias, and pads, set to indicate a warning.
- 0x0400 **usetherm**  
Obsolete, indicates that pins/vias should be drawn with thermal fingers.
- 0x0400  
Obsolete, old files used this to indicate lines drawn on silk.
- 0x0800 **octagon**  
Draw pins and vias as octagons.
- 0x1000 **drc**  
Set for objects that fail DRC.
- 0x2000 **lock**  
Set for locked objects.
- 0x4000 **edge2**  
For pads, indicates that the second point is closer to the edge. For pins, indicates that the pin is closer to a horizontal edge and thus pinout text should be vertical.
- 0x8000 **marker**  
Marker used internally to avoid revisiting an object.
- 0x10000 **connected**  
If set, this object has been as physically connected by `FindConnection()`.

## 9.10 PCBFlags

- 0x00001 Pinout displays pin numbers instead of pin names.
- 0x00002 Use local reference for moves, by setting the mark at the beginning of each move.
- 0x00004 When set, only polygons and their clearances are drawn, to see if polygons have isolated regions.
- 0x00008 Display DRC region on crosshair.
- 0x00010 Do all move, mirror, rotate with rubberband connections.
- 0x00020 Display descriptions of elements, instead of refdes.

|          |                                                                              |
|----------|------------------------------------------------------------------------------|
| 0x00040  | Display names of elements, instead of refdes.                                |
| 0x00080  | Auto-DRC flag. When set, PCB doesn't let you place copper that violates DRC. |
| 0x00100  | Enable 'all-direction' lines.                                                |
| 0x00200  | Switch starting angle after each click.                                      |
| 0x00400  | Force unique names on board.                                                 |
| 0x00800  | New lines/arc clear polygons.                                                |
| 0x01000  | Crosshair snaps to pins and pads.                                            |
| 0x02000  | Show the solder mask layer.                                                  |
| 0x04000  | Draw with thin lines.                                                        |
| 0x08000  | Move items orthogonally.                                                     |
| 0x10000  | Draw autoroute paths real-time.                                              |
| 0x20000  | New polygons are full ones.                                                  |
| 0x40000  | Names are locked, the mouse cannot select them.                              |
| 0x80000  | Everything but names are locked, the mouse cannot select anything else.      |
| 0x100000 | New polygons are full polygons.                                              |
| 0x200000 | When set, element names are not drawn.                                       |

## 10 Library Creation

This chapter provides a detailed look at how footprint libraries are created and used. The chapter is split into two sections, the first section covers the "old" style libraries which use the `m4` macro processor and the second section covers the "new" style libraries.

Despite the names "old" and "new", both styles of libraries are useful and the "old" style should not be discounted because of its name. The advantage of the old style libraries is that one can define a family of footprints, say a DIP package, and then quickly produce all the members of that family. Because the individual packages make use of a base definition, corrections made to the base definition propagate to all the members of a family. The primary drawback to using this library approach is that the effort to create a single footprint is more than a graphical interface and may take even longer if the user has not used the `m4` macro language previously.

The new style of footprint libraries stores each footprint in its own file. The footprints are created graphically by placing pads and then converting a group of pads to a component. This library method has the advantage of being quick to learn and it is easy to build single footprints quickly. If you are building a family of parts, however, the additional effort in creating each one individually makes this approach undesirable. In addition, creating a part with a large pin count can be quite tedious when done by hand.

### 10.1 Old Style (`m4`) Libraries

The old style libraries for `pcb` use the `m4` macro processor to allow the definition of a family of parts. There are several files associated with the old style library. The file `'common.m4'` is the top level file associated with the library. `'common.m4'` defines a few utility macros which are used by other portions of the library, and then includes a predefined set of library files (the lines like `include(geda.inc)`).

#### 10.1.1 Overview of Oldlib Operation

The big picture view of the old style library system is that the library is simply a collection of macro definitions. The macros are written in the `m4` macro language. An example of a macro and what it expands to is the following. One of the predefined footprints in the library which comes with `PCB` is the `PKG_S08` macro. Note that all the footprint macros begin with `PKG_`. For this particular example, `PKG_S08` is a macro for an 8-pin small outline surface mount package. All of the footprint macros take 3 arguments. The first is the canonical name of the footprint on the board. In this case "S08" is an appropriate name. The second argument is the reference designator on the board such as "U1" or "U23". The third and final argument is the value. For an integrated circuit this is usually the part number such as "MAX4107" or "78L05" and for a component such as a resistor or capacitor it is the resistance or capacitance. The complete call to the macro in our example is `'PKG_S08(S08, U1, MAX4107)'`. When processed by `m4` using the macros defined in the `PCB` library, this macro expands to

```
Element(0x00 "S08" "U1" "MAX4107" 146 50 3 100 0x00)
(
 Pad(10 25 38 25 20 "1" 0x00)
 Pad(10 75 38 75 20 "2" 0x100)
```

```

Pad(10 125 38 125 20 "3" 0x100)
Pad(10 175 38 175 20 "4" 0x100)
Pad(214 175 242 175 20 "5" 0x100)
Pad(214 125 242 125 20 "6" 0x100)
Pad(214 75 242 75 20 "7" 0x100)
Pad(214 25 242 25 20 "8" 0x100)
ElementLine(0 0 151 0 10)
ElementArc(126 0 25 25 0 180 10)
ElementLine(101 0 252 0 10)
ElementLine(252 0 252 200 10)
ElementLine(252 200 0 200 10)
ElementLine(0 200 0 0 10)
Mark(29 25)
)

```

which is the actual definition of the footprint that the PCB program works with. As a user of PCB the only time you will need or want to run `m4` directly is when you are debugging a new library addition. In normal operation, the calls to `m4` are made by helper scripts that come with PCB.

Tools such as `gsch2pcb` (used to interface the gEDA schematic capture program to PCB layout) will call `m4` to produce an initial PCB layout that includes all the components on a schematic. In addition, when manually instantiating parts from within PCB, `m4` will be called by PCB's helper scripts to produce the footprints.

## 10.1.2 The Library Scripts

There are several scripts that are used for processing the `m4` libraries. This section briefly describes these scripts and details how they are used by PCB.

### 10.1.2.1 Scripts Used During Compilation

The scripts described in this section are used during compilation of PCB. They are run automatically by the build system, but are described here to help document the complete library processing that occurs. During the build of PCB, the following actions are taken. The `CreateLibrary.sh` script is run to produce an M4 "frozen file". This frozen file is simply a partially processed M4 input file which can be loaded by M4 more quickly than the original input file.

A typical call to `CreateLibrary.sh` used during the compilation of PCB is:

```

./CreateLibrary.sh -I . pcblib ./common.m4 TTL_74xx_DIL.m4
connector.m4 crystal.m4 generic.m4 genericsm4 gtag.m4
jerry.m4 linear.m4 logic.m4 lsi.m4 memory.m4 optical.m4 pci.m4
resistor_0.25W.m4 resistor_adjust.m4 resistor_array.m4
texas_inst_amplifier.m4 texas_inst_voltage_reg.m4
transistor.m4 geda.m4

```

The `'-I .'` says to search in the current directory for the `'m4'` files. The output frozen file is `'pcblib'`. The main `'common.m4'` file is listed as well as all of the `'*.m4'` files which define the components in the library.

In addition, a library contents file is created during the build with the `CreateLibraryContents.sh` script. A typical call to `CreateLibrary.sh` used during the compilation of PCB is:

```
./CreateLibraryContents.sh -I . ./common.m4 TTL_74xx_DIL.list
connector.list crystal.list generic.list genericsmc.list gtag.list
jerry.list linear.list logic.list lsi.list memory.list optical.list
pci.list resistor_0.25W.list resistor_adjust.list resistor_array.list
texas_inst_amplifier.list texas_inst_voltage_reg.list transistor.list
geda.list > pcplib.contents
```

The `'pcplib.contents'` file is used by the PCB program to define the libraries and components which will be displayed when you bring up the library window from within PCB. An example of part of the `'pcplib.contents'` file is:

```
TYPE=~TTL 74xx DIL
7400_dil:N:7400:4 dual-NAND
7401_dil:N:7401:4 dual-NAND OC
7402_dil:N:7402:4 dual-NOR
TYPE=~geda
geda_DIP6:DIP6:DIP6: Dual in-line package, narrow (300 mil)
geda_DIP8:DIP8:DIP8: Dual in-line package, narrow (300 mil)
geda_DIP14:DIP14:DIP14: Dual in-line package, narrow (300 mil)
geda_ACY300:ACY300:ACY300: Axial non-polar component,
```

The `TYPE=` lines define the library name that will show up in the library window in PCB. The other lines define the actual components in the library.

### 10.1.2.2 Scripts Used by PCB at Runtime

When PCB is first executed, it makes a call to the `ListLibraryContents.sh` script. This script provides the PCB program with the contents of the library contents file created when PCB was compiled. A typical call to `ListLibraryContents.sh` is

```
../lib/ListLibraryContents.sh ../tmp/pcb-20030903/src/./lib pcplib
```

This command says to search the path `'../tmp/pcb-20030903/src/./lib'` for a file called `'pcplib.contents'` (the `'contents'` part is added automatically) and display the contents of the file. PCB parses this output and generates the library window entries.

When you pick a library component from the library window, PCB calls the `QueryLibrary.sh` script to actually pull the footprint into the layout. For example, when the ACY300 component is selected from the `~geda` library, the generated call may be:

```
/tmp/pcb-20030903/src/./lib/QueryLibrary.sh
../tmp/pcb-20030903/src/./lib pcplib geda_ACY300 ACY300
ACY300
```

If you were to run this command by hand you would see the PCB code for the element:

```
Element(0x00 "Axial non-polar component," "" "ACY300" 245 70 0 100 0x00)
(
Pin(0 25 50 20 "1" 0x101)
Pin(300 25 50 20 "2" 0x01)
```

```

ElementLine(0 25 75 25 10)
ElementLine(225 25 300 25 10)

ElementLine(75 0 225 0 10)
ElementLine(225 0 225 50 10)
ElementLine(225 50 75 50 10)
ElementLine(75 50 75 0 10)

ElementArc(X1 Y 50 50 270 180 10)
ElementArc(X2 Y 50 50 90 180 10)

Mark(75 25)
)

```

### 10.1.3 Creating an Oldlib Footprint

This section provides a complete example of defining a family of footprints using the M4 style library. As a vehicle for this example, a family of footprints for surface mount resistors and capacitors will be developed. The file ‘example.inc’ should have been installed on your system as ‘\$prefix/share/examples/oldlib/example.inc’ where ‘\$prefix’ is often times ‘/usr/local’.

The ‘example.inc’ file defines a macro called COMMON\_PKG\_RCSMT which is a generic definition for a surface mount footprint with two identical, rectangular pads. This macro will be called with different parameters to fill out the family of parts. The arguments to the COMMON\_PKG\_RCSMT are:

```

the definition for surface mount resistors and capacitors
$1: canonical name
$2: name on PCB
$3: value
$4: pad width (in direction perpendicular to part)
$5: pad length (in direction parallel with part)
$6: pad spacing (center to center)
$7: distance from edge of pad to silk (in direction
perpendicular to part)
$8: distance from edge of pad to silk (in direction parallel
with part)
$9: Set to "no" to skip silk screen on the sides of the part
define('COMMON_PKG_RCSMT',
 'define('XMIN', 'eval(-1*'$6'/2 - '$5'/2 - '$8')')
 define('XMAX', 'eval('$6'/2 + '$5'/2 + '$8')')
 define('YMIN', 'eval(-1*'$4'/2 - '$7')')
 define('YMAX', 'eval('$4'/2 + '$7')')
 Element(0x00 "$1" "$2" "$3" eval(XMIN+20) eval(YMAX+20) 0 100 0x00)
 (
 ifelse(0, eval($4>$5),
 # Pads which have the perpendicular pad dimension less

```



```

than or equal to the parallel pad dimension
Pad(eval(-1*($6 + $5 - $4)/2) 0
 eval((-1*$6 + $5 - $4)/2) 0 eval($4) "1" 0x100)
Pad(eval(-1*(-1*$6 + $5 - $4)/2) 0
 eval(($6 + $5 - $4)/2) 0 eval($4) "2" 0x100)
,
Pads which have the perpendicular pad dimension greater
than or equal to the parallel pad dimension
Pad(eval(-1*$6/2) eval(-1*($4 - $5)/2)
 eval(-1*$6/2) eval((($4 - $5)/2) eval($5) "1" 0x100)
Pad(eval($6/2) eval(-1*($4 - $5)/2)
 eval($6/2) eval((($4 - $5)/2) eval($5) "2" 0x100)
)

silk screen
ends
ElementLine(XMIN YMIN XMIN YMAX 10)
ElementLine(XMAX YMAX XMAX YMIN 10)
sides
ifelse($9,"no",
#skip side silk
,
ElementLine(XMIN YMIN XMAX YMIN 10)
ElementLine(XMAX YMAX XMIN YMAX 10)
)
Mark(0 0)
)')

```

Note that the part has been defined with the mark located at (0,0) and that the pads have been placed with the mark at the common centroid of the footprint. While not a requirement, this is highly desirable when developing a library that will need to interface with a pick and place machine used for factory assembly of a board.

The final part of 'example.inc' defines particular versions of the generic footprint we have created. These particular versions correspond to various industry standard package sizes.

```

0402 package
#
30x30 mil pad, 15 mil metal-metal spacing=>
15 + 15 + 15 = 45 center-to-center
define('PKG_RC0402',
 'COMMON_PKG_RCSMT('$1', '$2', '$3', 30, 30, 45, 0, 10, "no")')

0603 package
#
40x40 mil pad, 30 mil metal-metal spacing=>
30 + 20 + 20 = 70 center-to-center
define('PKG_RC0603',

```

```

COMMON_PKG_RCSMT('$1', '$2', '$3', 40, 40, 70, 10, 10)')

1206 package
#
40x60 mil pad, 90 mil metal-metal spacing=>
90 + 20 + 20 = 130 center-to-center
define('PKG_RC1206',
COMMON_PKG_RCSMT('$1', '$2', '$3', 60, 40, 130, 10, 10)')

```

At this point, the `example.inc` file could be used by third party tools such as `gsch2pcb`. However to fully integrate our footprints into PCB we need to create the `example.m4` and `example.list` files. The `example.m4` file defines descriptions for the new footprints.

```

define('Description_my_RC0402',
 'Standard SMT resistor/capacitor (0402)')
define('Description_my_RC0603',
 'Standard SMT resistor/capacitor (0603)')
define('Description_my_RC1206',
 'Standard SMT resistor/capacitor (1206)')

```

Finally we need to create the `example.list` file.

```

my_RC0402:RC0402:RES0402
my_RC0402:RC0402:CAP0402
my_RC0603:RC0603:RES0603
my_RC0603:RC0603:CAP0603
my_RC1206:RC1206:RES1206
my_RC1206:RC1206:CAP1206

```

The first field in the list file has the name corresponding to the Description definitions in `example.m4`. The second field is the template name which corresponds to the macros `PKG_*` we defined in `example.inc` with the leading `PKG_` removed. It is the second field which controls what footprint will actually appear on the board. The final field is the name of the part type on the board. The first line in our `example.list` file will produce a menu entry in the library window that reads:

```

CAP0402, Standard SMT resistor/capacitor (0402)

```

The `CAP0402` portion comes directly from the third field in `example.list` and the longer description comes from descriptions macros in `example.m4`. Please note that any extra white space at the end of a line in the `.list` files will cause them to not work properly.

### 10.1.4 Troubleshooting Old Style Libraries

A powerful technique to help debug problems with libraries is to invoke the `m4` processor directly. This approach will provide error output which is not visible from within PCB. The following example shows how one might try to debug an 8 pin small outline (SO8) package. The macro name for the package is `PKG_SO8`. In this example, the canonical name that is to be associated with the part is `SO8`, the reference designator is `U1`, and the value is `MAX4107` (the part number).

```

echo "PKG_SO8(SO8, U1, MAX4107)" | \
 gm4 common.m4 - | \
 awk '/^[\t]*$/ {next} {print}' | \

```

more

The `awk` call simply removes blank lines which make the output hard to read.

For this particular example, the output is:

```
Element(0x00 "S08" "U1" "MAX4107" 146 50 3 100 0x00)
(
Pad(10 25 38 25 20 "1" 0x00)
Pad(10 75 38 75 20 "2" 0x100)
Pad(10 125 38 125 20 "3" 0x100)
Pad(10 175 38 175 20 "4" 0x100)
Pad(214 175 242 175 20 "5" 0x100)
Pad(214 125 242 125 20 "6" 0x100)
Pad(214 75 242 75 20 "7" 0x100)
Pad(214 25 242 25 20 "8" 0x100)
ElementLine(0 0 151 0 10)
ElementArc(126 0 25 25 0 180 10)
ElementLine(101 0 252 0 10)
ElementLine(252 0 252 200 10)
ElementLine(252 200 0 200 10)
ElementLine(0 200 0 0 10)
Mark(29 25)
)
```

## 10.2 New Style Libraries

Footprints for the new style library are created graphically using the PCB program. A single footprint is saved in each file.

### 10.2.1 Creating Newlib Footprints

To create

1. Start PCB with an empty layout.
2. Make the component layer active.
3. For a leaded part, select the via tool and place vias where the pads for the part should go. For surface mount pads, draw line segments. Note that until the footprint is completed, the surface mount pads will remain rounded. Currently a rectangle or polygon may not be used as a pad.
4. For each via and line segment which will become a pad, select it and press 'n' to be able to enter a name. Enter the pin number and press enter.
5. Make the silk layer active.
6. Using the line and arc tools, draw a silk screen outline for the part.
7. Using the selection tool, select all of the pins and silk screen for the part.
8. Place the pointer above the reference point for the part. This is typically the common centroid. Keeping the pointer there, shift-right-click to bring up the popup menu and choose "convert selection to element".
9. At this point, the vias, line segments, and silk screen will have been converted to an element. To change any of the line segments to have square ends rather than round

ends, select the pads by holding down the shift key and clicking each pad with the center mouse button. Now under the Select menu, "Change square-flag of selected objects" section, choose "Pins".

10. Select the element, shift-right-click to bring up the popup menu, and choose "Copy Selection to Buffer". Now left-click on the center of the new element.
11. Under the buffer menu, choose "save buffer elements to file" to save the new footprint to a file.
12. Press ESC to exit from buffer mode.

### 10.2.2 Modifying Newlib Footprints

1. In the Pcb program, instantiate the footprint you wish to modify.
2. Using the selection tool, select the footprint.
3. Now left-click on the selected element, this brings up a popup menu, choose "Cut to Buffer" from the popup menu.
4. Under the buffer menu, choose "break buffer element to pieces", and then left-click to place the broken apart footprint to an open area of the layout. Note that you must use the items under the buffer menu, the items with the same names in the popup menu do not work.
5. Make your desired modifications to the footprint and then convert the pieces back to an element using the same procedure as when starting from scratch on a new footprint.

## 11 Schematic Capture for PCB

When designing a circuit board of any complexity, a schematic capture front-end for the design is highly desired. Any schematic capture program which is able to generate a netlist in a user defined format as well as a bill of materials can be made to work with PCB. Currently, we are aware of two freely available schematic capture programs which can interface with PCB. This chapter shows how a design can be taken from start to finish using either of these two tools for schematic capture and PCB for layout.

### 11.1 gEDA

This section shows how to use gEDA as the schematic capture front-end for a PCB design. This section is not intended to be complete documentation on gEDA and it is assumed that the user has at least some familiarity with the gEDA suite of programs.

The basic steps in a gEDA + PCB design flow are:

1. Set up project directories
2. Set up gEDA (gschem/gnetlist) config files
3. Set up gsch2pcb config files
4. Capture schematics using `gschem` (part of gEDA)
5. Create any unique PCB footprints needed for the design
6. Generate initial PCB design using `gsch2pcb` (part of gEDA)
7. Layout circuit board using `pcb`
8. Make any additional schematic changes with `gschem` and forward annotate to PCB with `gsch2pcb`
9. Generate photoplot files (RS-274X, also known as "Gerber") for board vendor

#### 11.1.1 Set Up Project Directories

Although not required, a typical project directory will contain the schematics and board layout at the top level. Schematic symbols and circuit board footprints which are unique to this project are stored in subdirectories. For this example, 'sym' contains the project specific schematic symbols and 'pkg' contains the project specific footprints. Set up the project subdirectory and subdirectories by executing:

```
mkdir ~/myproj
cd ~/myproj
mkdir sym
mkdir pkg
mkdir pkg/newlib
mkdir pkg/m4
```

#### 11.1.2 Set Up gEDA Config Files

The gEDA tools, specifically `gschem` and `gnetlist`, use configuration files to set the search path for symbol libraries in addition to other user preferences. Create a file in the top level project directory called 'gschemrc'. Add the following lines to that file:

```
;; list libraries here. Order matters as it sets the
;; search order
(component-library "./sym")
```

This sets the local search path for the schematic capture program `gschem`. Now the netlister, `gnetlist`, must also be configured. This can be done by copying the file `gschemrc` to `gnetlistrc` by running `cp gschemrc gnetlistrc`. Alternatively, you can create a soft link so only a single file needs to be updated if additional symbol paths are added. The link is created by running `ln -s gschemrc gnetlistrc`.

### 11.1.3 Set Up `gsch2pcb` Config Files

The program `gsch2pcb`, not to be confused with the older `gschem2pcb` script, is used to link the schematic to layout. `gsch2pcb` is responsible for creating the netlist used to provide connectivity information to PCB as well creating an initial layout with all components instantiated in the design. Forward annotation of schematic changes to the layout is also done using `gsch2pcb`. `gsch2pcb` uses a project file to set up the schematic file names, PCB library locations, and output file names. Create a project file called `project` using the following as an example:

```
List all the schematics to be netlisted
and laid out on the pc board.
schematics first.sch second.sch third.sch

For an output-name of foo, gsch2pcb generates files
foo.net, foo.pcb, and foo.new.pcb. If there is no
output-name specified, the file names are derived from
the first listed schematic, i.e. first.net, etc.
output-name preamp
```

### 11.1.4 Capture Schematics Using `gschem`

This section is fairly brief and assumes familiarity with using the `gschem` schematic capture program. As you are creating your schematics, be sure to observe the following rules:

- Make sure that each component in the schematic has a `footprint` attribute that corresponds to a footprint in the PCB library or a footprint you plan on creating.
- Make sure all reference designators are unique. One way to ensure this is to run the `refdes_renum` script (part of `gEDA`) after the schematics are created.

### 11.1.5 Create Any Unique PCB Footprints

Create the new footprints you design needs using either the `m4` style or `newlib` style of PCB libraries. Refer to [Chapter 10 \[Library Creation\]](#), page 91 for details on this process. For `m4` style footprints, store them in the `pkg/m4` subdirectory and for `newlib` footprints, store them in the `pkg/newlib` subdirectory.

### 11.1.6 Generate Initial PCB Design Using `gsch2pcb`

The `gsch2pcb` program connects the schematic and layout. Its basic operation is to call `gnetlist` to generate the connectivity netlist that PCB used to verify connectivity and to instantiate all elements found in the schematic to a new layout. The default, as of `gsch2pcb` version 0.9, is to use any found m4 style parts first and then search for newlib style if no old style part was found. By using the `--use-files` or `-f` flag to `gsch2pcb` priority is given to newlib style parts even if m4 style are found. You may wish to verify this in the `gsch2pcb` documentation in case this changes in the future. To start your layout, run `'gsch2pcb project'` where `'project'` is the project file created previously. This will create a new netlist file, `'preamp.net'`, and a new layout file, `'preamp.pcb'`.

### 11.1.7 Layout Circuit Board

Run PCB on the new layout by running `'pcb preamp.pcb'`. Load the netlist file by selecting "load netlist file" from the "file" menu. In the file selection dialog box, choose `'preamp.net'`. This loads connectivity information into PCB.

Using the selection tool, grab and move apart the various footprints with the middle mouse button. Once the parts are moved apart from each other, choose "optimize rats-nest" from the "Connects" menu. This menu choice will display and optimize the rats nest. Use the rats nest to help guide placement of the parts. You may wish to re-run the "optimize rats-nest" command after moving parts around.

After the placement is complete, use the line tool to add traces to the board. As traces are added, the corresponding rats line will disappear.

### 11.1.8 Forward Annotation of Schematic Changes

If schematic changes are made after the layout has started, `gsch2pcb` can be used to forward annotate these changes to the layout. To forward annotate schematic changes, run `'gsch2pcb project'`. This command will create the files `'preamp.new.pcb'`, `'preamp.net'`, and modify the file `'preamp.pcb'`. The modifications to `'preamp.pcb'` include forward annotation of schematic component value changes, adds any new components, and removes any deleted components.

### 11.1.9 Generate Photoplot Files (RS-274X)

After the layout is complete, choose "edit layer-groupings" from the "Settings" menu. The LayerGroups form lets you specify which layers will appear in each output layer group. For example, in the default form, layer group 1 has "front" and "front side" in it. The output file `'1.gbr'` if DOS file names are used, or `'somenam_front.gbr'` if long file names are used will contain the "front" and "front side" layers in it. Usually the defaults are sufficient, but this form is still a useful reference.

Choose "print layout..." from the "File" menu. In the print dialog box, select "Gerber/RS-274X" for the device driver. Select the "outline", "alignment", and "drillhelper" options. To get DOS compatible file names, select the "DOS (8.3) names" option, otherwise enter "preamp" for the filename. Press "OK".

The following output files should have been created in the project directory. The names in parentheses correspond to the DOS compatible output file names.

```
'preamp_frontsilk.gbr (csilk.gbr)'
 Top side silk screen.

'preamp_frontmask.gbr (cmask.gbr)'
 Top side soldermask relief.

'preamp_front.gbr (1.gbr)'
 Top copper.

'preamp_backmask.gbr (smask.gbr)'
 Bottom side soldermask relief.

'preamp_back.gbr (2.gbr)'
 Bottom Copper.

'preamp_fab.gbr (fab.gbr)'
 Fabrication drawing. Also known as the drill drawing. This drawing is used
 for reference by the board vendor but is not directly used in the fabrication
 process.

'preamp_plated-drill.cnc (pdrill.cnc)'
 NC Drill format file for the plated through holes.

'preamp_unplated-drill.cnc (udrill.cnc)'
 NC Drill format file for the unplated through holes.

'preamp_bom.txt (bom.txt)'
 A bill of materials for the layout.

'preamp_xy.txt (xy.txt)'
 Centroid (X-Y) data for driving automated assembly equipment.
```

## 11.2 xcircuit

If anyone cares to contribute this section, it will get added. Please submit changes to the bug tracking system for PCB which can be found on <https://bugs.launchpad.net/pcb>.



## Appendix A Installation

Compiling and installing the package should be straightforward. If any problems occur, please contact the current maintainers at [geda-user@delorie.com](mailto:geda-user@delorie.com) to find a solution and include it into the next release.

Bug reports can also be filed on <https://bugs.launchpad.net/pcb>.

This section covers the steps which are necessary to compile the package.

### A.1 Quick Start

Starting with version 2.0, Pcb has switched to a GNU autoconf/automake build system. Installation of Pcb consists of three steps: configuration, building, and installing. In a typical installation, these steps are as simple as

```
./configure
make
make install
```

### A.2 Running the configure Script

The `configure` script accepts all of the standard GNU configure options. For a complete list of configuration options, run `./configure --help`.

`'INFOLIBDIR'`

must be set to the directory where your GNU info files are located.

`'PCBLIBDIR'`

is the path of a directory where the font files will be installed.

`'DEFAULTFONT'`

the name of the default font file.

`'DEFAULTLIBRARY'`

the name of the default library.

`'GNUM4'`

the name of GNU's m4 version.

`'BTNMOD'`

If your window manager has already bound *Mod1* together with some function keys you may want to change this setting. This is true for HP-VUE.

If you do not have the appropriate permissions you should run `'./pcbtest.sh'` in the `'src'` directory to run Pcb from the installation directory.

If you find things which must be changed to compile on your system, please add the appropriate autoconf tests (if you are familiar with that) and mail a copy to [geda-user@delorie.com](mailto:geda-user@delorie.com), this is a mailing list with subscription required.

Bug reports can also be filed on <https://bugs.launchpad.net/pcb>.

## Appendix B Trouble Shooting

There are some known problems. Most of them are related to missing parts of a standard X11 distribution. Some others are caused by third party applications such as X servers. To make this list more complete please report your problems and, if available, solutions to the bug report tracker on <https://bugs.launchpad.net/pcb>. In any case, read [Section B.8 \[X11\], page 105](#).

By the way, you **MUST HAVE AN ANSI COMPILER** to make Pcb work.

Another source of problems are older versions of `flex` and `bison`. Pcb definitely works with `flex-2.4.7` and `bison-1.22` or later. The problems will result in a *syntax error* while parsing files. This should only be a problem if you have modified the `flex` or `bison` input files.

The following list gives you just an idea because I'm not able to test all Pcb releases on all platforms.

### B.1 HP Series 700 and 800

You have to install several X11 include files or, better, install a complete X11R5 release. Hewlett-Packard doesn't support the Athena Widgets. So the header files and libraries are missing from the application media, but they are available as a patch. They also do not ship the ANSI compiler with the normal operating system release so you have to buy one or use GCC. Some of the tools are available as patches.

In addition, Pcb has been successfully tested on these platforms with HPUX 9.\*, 10.\* running self-compiled X11R5.

### B.2 Sun SPARC architecture

There are no known problems with Sun machines if they use X11R5 instead of OpenWindows. Pcb compiled successfully with all kinds of SPARCstations Solaris-2. [345].

For problems with OpenWindows refer to [Section B.8 \[X11\], page 105](#).

### B.3 Silicon Graphics

Pcb has been tested on some boxes running either IRIX-4.0.5 or IRIX-5.3. The former one uses a X11R4 server. There are no problems. For known problems with X11R4, see [Section B.8 \[X11\], page 105](#).

### B.4 DEC Alpha

Pcb compiled and runs without problems on DEC UNIX V3.2c.

### B.5 SCO Unix

John DuBois <spccdt@deephth.armory.com> wrote:

```
SCO-ODT-3.0 requires the latest version of t1s003, the Athena
widget library (available from sosco.sco.com). The main problems
I have encountered are it core dumps fairly often, especially
while loading/dropping elements...
```

I'll see what I am able to do as soon as I have access to an SCO system.

## B.6 Linux

Since the X11 version of Pcb has been developed on a Linux system here are no known problems other than the massive back log of bug reports on <https://bugs.launchpad.net/pcb>.

## B.7 FreeBSD and NetBSD

Pcb has been tested on NetBSD and works without any problems. You may also be able to find a NetBSD package at <ftp://ftp.netbsd.org/pub/NetBSD/packages/cad/pcb/README.html> or a FreeBSD port at <http://www.freebsd.org/cgi/url.cgi?ports/cad/pcb/pkg-descr>.

## B.8 Problems related to X11

There are a some problems related to X11R4 or systems derived from X11 such as OpenWindows. See Section B.2 [Sun], page 104. You at least have to change all occurrences of *baseTranslations* in the resource files to *translations* if you are using a X11R4 server. Look at the X11R5 *Intrinsics* manual for details.

The panner widget (print dialog box) appears only in release X11R5 and later. It really simplifies adjusting the offsets. With earlier releases the printout will always appear in the center of the page.

You may have some problems in a mixed X11-OpenWindows environment.

Pcb has been tested successfully with X11R6 under Linux 1.1.59 and later.

## B.9 Problems related to TeX

If your TeX installation complains about a missing ‘*texinfo.tex*’ file copy the one included in this release (directory ‘doc’ to your TeX macro directory. Note, there are probably newer versions of this file available from some sites. TeX-3.0 failed, TeX-3.14 worked just fine. Check out <http://www.tug.org/begin.html> for more information and manuals.

## Appendix C Customizing the Menu

The menu system is driven off a data file that contains *resources*. A resource is a hierarchical description of a data tree which, in this case, is mapped to the hierarchical menus used by Pcb.

### C.1 Resource Syntax

A resource file is a simple text file. It contains curly braces to group things, spaces between things, and double quotes when strings need to include spaces. There are four fundamental ways of adding data to a resource.

First, a string (either a single word or a quoted string with spaces, we call both “strings” in this appendix) can be added all by itself, to add a string resource to the current resource. This is used, for example, to define the string printed on a menu button. In this example, four strings are added to the *File* resource:

```
File = {
 Sample
 "longer sample"
 some text
}
```

Second, a named string may be added by giving two strings separated by an equals sign. This is used to specify X resources and a few other optional parameters of menus, for example. Note that a string all by itself is thus an “unnamed” string.

```
{"Layer groups" foreground=red sensitive=false}
```

Third, an unnamed subresource may be added. This is used to create submenus and menu buttons. To add a subresource, simply group other things in curly braces. This example describes a resource containing one string and three subresources:

```
{File
 {New do_new()}
 {Save do_save()}
 {Quit do_quit()}
}
```

Lastly, a named subresource may be added by prefixing an unnamed subresource with a string and an equals sign, just as when naming strings. This syntax is used to name the resources used for the main menu and popup menus:

```
MainMenu = {
 ...
}
```

Additionally, the menu parser allows for “hooks” whereby portions of the menu system can be programmatically created at runtime by the application. These hooks are invoked by a single word preceded by an at sign, such as this example where most of the Sizes menu is created automatically:

```
{Sizes
 @sizes
 {"Adjust active sizes ..." AdjustStyle(0)}
```

```
}

```

In addition to all that, any unquoted pound sign (#) begins a comment. Commented text continues until the end of the containing line. Comments may begin at the beginning of a line, or after other text on the line:

```
This is a comment
MainMenu = { # This is also a comment

```

## C.2 Menu Definitions

To best understand this section, you should find the ‘pcb-menu.res’ file that your Pcb uses and refer to it for examples (see [Section C.3 \[Menu Files and Defaults\], page 108](#)). Note that the lesstif GUI uses ‘pcb-menu.res’ and the GTK+ GUI uses ‘gpcb-menu.res’. The file format is identical however and if so desired, one can make one file be a soft link to the other.

A resource defines a menu when it meets certain semantic requirements. The menu hierarchy is reflected as a hierarchy of unnamed subresources, with the first string of each subresource defining the label used for the menu button. A subresource that itself contains subresources becomes a submenu, a subresource that does not becomes a button.

A submenu should only contain subresources for the buttons or submenus within that submenu. Two exceptions are allowed: an initial string sets the label, and the string “-” (a single dash) will create a separator.

A button should not contain subresources, but will contain many strings, named and unnamed. The first member shall be an unnamed string which is the label for the button. Any other unnamed strings within the button’s resource will be used as actions (much like the .Xdefaults action strings), which are functions that will be called when the button is pressed (or popped up, or created, depending on the action). As a convenience, if a left parenthesis is seen, the current “word” will continue at least until the matching right parenthesis. This allows you to pass strings with spaces as arguments to actions without needing to quote the action.

Named resources in button resources will be used as X resources. Such resources can be used to set the font, color, and spacing of buttons. As a convenience, “fg” can be used as an abbreviation for “foreground”.

Within the menu’s resource file, Pcb will look for a few key named subresources. At the moment, there are just two key named subresources. `MainMenu` will be used for the main menu bar and `Mouse` will be used to define mouse actions. In the future, other named subresources will be used for popup resources.

Given all this, a small sample ‘pcb-menu.res’ would be:

```
MainMenu = {
 {File
 {"Open..." Load(Layout)}
 -
 {"Quit" Quit() fg=red font=10x20}
 }
}
```

Within the Pcb sources are specially crafted comments that mark all the actions, flags, menu hooks, and whatnot that Pcb offers. Read the file ‘`src/gather-actions`’ in the Pcb source tree for documentation for these comments.

### C.3 Menu Files and Defaults

Pcb will look for a file which defines its menus, trying the following names (the example is for the lesstif GUI, the GTK+ GUI has “`gpcb-menu.res`” in place of “`pcb-menu.res`”):

```
./pcb-menu.res
$HOME/.pcb-menu.res
$PCBLIBDIR/pcb-menu.res
<internal>
```

Note that *pcblibdir* defaults to ‘`/usr/local/share/pcb`’ (hence, ‘`/usr/local/share/pcb/pcb-menu.res`’). The ‘`<internal>`’ entry refers to a menu definition within the Pcb application itself. The master file for all this is the file ‘`src/pcb-menu.res`’ in the Pcb source tree. This master source is used to create the internal menu definition as well as being installed in ‘`$pcblibdir`’.

## Appendix D Element Search/Regular Expressions

### D.1 Element Search/Regular Expressions

Pcb's search is based on POSIX 1003.2 Regular Expressions. Full POSIX Regular Expressions are supported by Pcb if the regex library was available when Pcb was built. One difference from the regular expressions found in tools like awk or grep is that PCB implicitly adds a “^” to the beginning of a regular expression and “\$” to the end of the regular expression. For example, if you enter “C1”, the actual regular expression used internally is “^C1\$”. Another difference is that search patterns in pcb are not case sensitive. That is, “CON” is treated the same as “con”.

It is easier to show by example how to search than explain POSIX 1003.2. With regular expressions most characters are just themselves, but some are special:

- ‘\*’           Matches 0 or more instances of preceding character.
- ‘+’           Matches 1 or more instances of preceding character.
- ‘?’           Matches 0 or 1 instances of preceding character.
- ‘.’           Matches any single character other than the newline character.
- ‘|’           The vertical bar is the alternation operator. It combines two regular expressions. The result matches if either of them matches.
- ‘\’           A backslash indicates the next character should not be interpreted literally if it normally is, and should be interpreted literally if it normally isn't.
- ‘{n}’         An integer n enclosed in curly brackets matches the preceding item if it occurs exactly n times.
- ‘[ ]’         A pair of square brackets matches every character they contain. Characters may be given explicitly, or as ranges.
- ‘-’           A hyphen in the context of square brackets denotes the range between the preceding and the following character. E.g., the range of digits is “0-9” . The range of letters from C to K is “C-K” .
- ‘^ inside square brackets’  
              Inside square brackets the caret is an anti operator. Its presence makes the square brackets match anything except the contents of the brackets.
- ‘( )’         Round parenthesis group parts of a regular expression. This is very much like they do in math formulas.

If you need a special character literally, you can escape it with a backslash.

The following examples illustrate how regular expressions can be used to specify element names (reference designators) to search for.

- ‘C5’           Select the element whose name is exactly “C5”.
- ‘C5 | R3’      Select C5 and R3.
- ‘C.\*’         Select all elements whose name start with the letter “C”, such as C5, or C42, or CF1.

- 'C.\*1' Select all elements that start with "C" and end with "1", such as C1, or C51 or C5/9B71.
- 'R10?' Search for R1 or R10, but will not select R100 or R105. The question mark is a quantifier for the character "0".
- 'R128+' Selects R128, R1288, R12888, etc.
- 'TB. ' Select all terminal blocks having exactly one character designator after "TB" such as TB1, TBA, or TBx but not TB.
- 'TB. .' Select all terminal blocks having a two character designator such as TB21 or TB1a.
- 'TB.\*' Select all terminal blocks with any designator.
- '.\*31' Select all items, whose name ends with "31" such as Q31, or R31, or R531.
- 'Q[12]' Select Q1 and Q2.
- '[A-D].\*' Select all items, whose name starts with "A", "B", "C", or "D".
- '.\*N{2}.\*' Select all items, whose name contains two "N" in a row such as CONN23, or connA, but not CON5.
- '[^D].\*' Select all items that do not start with the letter "D", such as C2, or R34, but not D34.



## Appendix E Standard Drill Size Tables

### E.1 American Standard Wire Size Drills

| Drill Size | Diameter (inches) | Drill Size | Diameter (inches) | Drill Size | Diameter (inches) |
|------------|-------------------|------------|-------------------|------------|-------------------|
| 97         | .0059             | 96         | .0063             | 95         | .0067             |
| 94         | .0071             | 93         | .0075             | 92         | .0079             |
| 91         | .0083             | 90         | .0087             | 89         | .0091             |
| 88         | .0095             | 87         | .0100             | 86         | .0105             |
| 85         | .0110             | 84         | .0115             | 83         | .0120             |
| 82         | .0125             | 81         | .0130             | 80         | .0135             |
| 79         | .0145             | 78         | .0160             | 77         | .0180             |
| 76         | .0200             | 75         | .0210             | 74         | .0225             |
| 73         | .0240             | 72         | .0250             | 71         | .0260             |
| 70         | .0280             | 69         | .0292             | 68         | .0310             |
| 67         | .0320             | 66         | .0330             | 65         | .0350             |
| 64         | .0360             | 63         | .0370             | 62         | .0380             |
| 61         | .0390             | 60         | .0400             | 59         | .0410             |
| 58         | .0420             | 57         | .0430             | 56         | .0465             |
| 55         | .0520             | 54         | .0550             | 53         | .0595             |
| 52         | .0635             | 51         | .0670             | 50         | .0700             |
| 49         | .0730             | 48         | .0760             | 47         | .0785             |
| 46         | .0810             | 45         | .0820             | 44         | .0860             |
| 43         | .0890             | 42         | .0935             | 41         | .0960             |
| 40         | .0980             | 39         | .0995             | 38         | .1015             |
| 37         | .1040             | 36         | .1065             | 35         | .1100             |
| 34         | .1110             | 33         | .1130             | 32         | .1160             |
| 31         | .1200             | 30         | .1285             | 29         | .1360             |
| 28         | .1405             | 27         | .1440             | 26         | .1470             |
| 25         | .1495             | 24         | .1520             | 23         | .1540             |
| 22         | .1570             | 21         | .1590             | 20         | .1610             |
| 19         | .1660             | 18         | .1695             | 17         | .1730             |
| 16         | .1770             | 15         | .1800             | 14         | .1820             |
| 13         | .1850             | 12         | .1890             | 11         | .1910             |
| 10         | .1935             | 9          | .1960             | 8          | .1990             |
| 7          | .2010             | 6          | .2040             | 5          | .2055             |
| 4          | .2090             | 3          | .2130             | 2          | .2210             |
| 1          | .2280             |            |                   |            |                   |

### E.2 American Standard Letter Size Drills

| Drill Size | Diameter (inches) | Drill Size | Diameter (inches) | Drill Size | Diameter (inches) |
|------------|-------------------|------------|-------------------|------------|-------------------|
| A          | .2340             | B          | .2380             | C          | .2420             |

|   |       |   |       |   |       |
|---|-------|---|-------|---|-------|
| D | .2460 | E | .2500 | F | .2570 |
| G | .2610 | H | .2660 | I | .2720 |
| J | .2770 | K | .2810 | L | .2900 |
| M | .2950 | N | .3020 | O | .3160 |
| P | .3230 | Q | .3320 | R | .3390 |
| S | .3480 | T | .3580 | U | .3680 |
| V | .3770 | W | .3860 | X | .3970 |
| Y | .4040 | Z | .4130 |   |       |

### E.3 Fractional Inch Size Drills

| Drill Size | Diameter (inches) | Drill Size | Diameter (inches) | Drill Size | Diameter (inches) |
|------------|-------------------|------------|-------------------|------------|-------------------|
| 1/64       | .0156             | 1/32       | .0313             | 3/64       | .0469             |
| 1/16       | .0625             | 5/64       | .0781             | 3/32       | .0938             |
| 7/64       | .1094             | 1/8        | .1250             | 9/64       | .1406             |
| 5/32       | .1562             | 11/64      | .1719             | 3/16       | .1875             |
| 13/64      | .2031             | 7/32       | .2188             | 15/64      | .2344             |
| 1/4        | .2500             | 17/64      | .2656             | 9/32       | .2812             |
| 19/64      | .2969             | 5/16       | .3125             | 21/64      | .3281             |
| 11/32      | .3438             | 23/64      | .3594             | 3/8        | .3750             |
| 25/64      | .3906             | 13/32      | .4062             | 27/64      | .4219             |
| 7/16       | .4375             | 29/64      | .4531             | 15/32      | .4688             |
| 31/64      | .4844             | 1/2        | .5000             | 33/64      | .5156             |
| 17/32      | .5313             | 35/64      | .5469             | 9/16       | .5625             |
| 37/64      | .5781             | 19/32      | .5938             | 39/64      | .6094             |
| 5/8        | .6250             | 41/64      | .6406             | 21/32      | .6562             |
| 43/64      | .6719             | 11/16      | .6875             | 45/64      | .7031             |
| 23/32      | .7188             | 47/64      | .7344             | 3/4        | .7500             |
| 49/64      | .7656             | 25/32      | .7812             | 51/64      | .7969             |
| 13/16      | .8125             | 53/64      | .8281             | 27/32      | .8438             |
| 55/64      | .8594             | 7/8        | .8750             | 57/64      | .8906             |
| 29/32      | .9062             | 59/64      | .9219             | 15/16      | .9375             |
| 61/64      | .9531             | 31/32      | .9688             | 63/64      | .9844             |
| 1          | 1.0000            |            |                   |            |                   |

### E.4 Metric Drills

| Drill Size | Diameter (inches) | Drill Size | Diameter (inches) | Drill Size | Diameter (inches) |
|------------|-------------------|------------|-------------------|------------|-------------------|
| 0.20 mm    | .00787            | 0.25 mm    | .00984            | 0.30 mm    | .0118             |
| 0.35 mm    | .0138             | 0.40 mm    | .0158             | 0.45 mm    | .0177             |
| 0.50 mm    | .0197             | 0.55 mm    | .0217             | 0.60 mm    | .0236             |
| 0.65 mm    | .0256             | 0.70 mm    | .0276             | 0.75 mm    | .0295             |
| 0.80 mm    | .0315             | 0.85 mm    | .0335             | 0.90 mm    | .0354             |
| 0.95 mm    | .0374             | 1.00 mm    | .0394             | 1.05 mm    | .0413             |

|          |       |          |       |          |       |
|----------|-------|----------|-------|----------|-------|
| 1.10 mm  | .0433 | 1.15 mm  | .0453 | 1.20 mm  | .0472 |
| 1.25 mm  | .0492 | 1.30 mm  | .0512 | 1.35 mm  | .0531 |
| 1.40 mm  | .0551 | 1.45 mm  | .0571 | 1.50 mm  | .0591 |
| 1.55 mm  | .0610 | 1.60 mm  | .0630 | 1.65 mm  | .0650 |
| 1.70 mm  | .0669 | 1.75 mm  | .0689 | 1.80 mm  | .0709 |
| 1.85 mm  | .0728 | 1.90 mm  | .0748 | 1.95 mm  | .0768 |
| 2.00 mm  | .0787 | 2.05 mm  | .0807 | 2.10 mm  | .0827 |
| 2.15 mm  | .0846 | 2.20 mm  | .0866 | 2.25 mm  | .0886 |
| 2.30 mm  | .0906 | 2.35 mm  | .0925 | 2.40 mm  | .0945 |
| 2.45 mm  | .0965 | 2.50 mm  | .0984 | 2.55 mm  | .1004 |
| 2.60 mm  | .1024 | 2.65 mm  | .1043 | 2.70 mm  | .1063 |
| 2.75 mm  | .1083 | 2.80 mm  | .1102 | 2.85 mm  | .1122 |
| 2.90 mm  | .1142 | 2.95 mm  | .1161 | 3.00 mm  | .1181 |
| 3.10 mm  | .1220 | 3.15 mm  | .1240 | 3.20 mm  | .1260 |
| 3.25 mm  | .1280 | 3.30 mm  | .1299 | 3.40 mm  | .1339 |
| 3.50 mm  | .1378 | 3.60 mm  | .1417 | 3.70 mm  | .1457 |
| 3.75 mm  | .1476 | 3.80 mm  | .1496 | 3.90 mm  | .1535 |
| 4.00 mm  | .1575 | 4.10 mm  | .1614 | 4.20 mm  | .1654 |
| 4.25 mm  | .1673 | 4.30 mm  | .1693 | 4.40 mm  | .1732 |
| 4.50 mm  | .1772 | 4.60 mm  | .1811 | 4.70 mm  | .1850 |
| 4.75 mm  | .1870 | 4.80 mm  | .1890 | 4.90 mm  | .1929 |
| 5.00 mm  | .1969 | 5.10 mm  | .2008 | 5.20 mm  | .2047 |
| 5.25 mm  | .2067 | 5.30 mm  | .2087 | 5.40 mm  | .2126 |
| 5.50 mm  | .2165 | 5.60 mm  | .2205 | 5.70 mm  | .2244 |
| 5.75 mm  | .2264 | 5.80 mm  | .2283 | 5.90 mm  | .2323 |
| 6.00 mm  | .2362 | 6.10 mm  | .2402 | 6.20 mm  | .2441 |
| 6.25 mm  | .2461 | 6.30 mm  | .2480 | 6.40 mm  | .2520 |
| 6.50 mm  | .2559 | 6.60 mm  | .2598 | 6.70 mm  | .2638 |
| 6.75 mm  | .2657 | 6.80 mm  | .2677 | 6.90 mm  | .2717 |
| 7.00 mm  | .2756 | 7.10 mm  | .2795 | 7.20 mm  | .2835 |
| 7.25 mm  | .2854 | 7.30 mm  | .2874 | 7.40 mm  | .2914 |
| 7.50 mm  | .2953 | 7.60 mm  | .2992 | 7.70 mm  | .3031 |
| 8.00 mm  | .3150 | 8.10 mm  | .3189 | 8.20 mm  | .3228 |
| 8.25 mm  | .3248 | 8.30 mm  | .3268 | 8.40 mm  | .3307 |
| 8.50 mm  | .3346 | 8.60 mm  | .3386 | 8.70 mm  | .3425 |
| 8.75 mm  | .3445 | 8.80 mm  | .3465 | 8.90 mm  | .3504 |
| 9.00 mm  | .3543 | 9.10 mm  | .3583 | 9.20 mm  | .3622 |
| 9.25 mm  | .3642 | 9.30 mm  | .3661 | 9.40 mm  | .3701 |
| 9.50 mm  | .3740 | 9.60 mm  | .3780 | 9.70 mm  | .3819 |
| 9.75 mm  | .3839 | 9.80 mm  | .3858 | 9.90 mm  | .3898 |
| 10.00 mm | .3937 | 10.10 mm | .3976 | 10.20 mm | .4016 |
| 10.25 mm | .4035 | 10.30 mm | .4055 | 10.40 mm | .4094 |
| 10.50 mm | .4134 | 10.60 mm | .4173 | 10.70 mm | .4213 |
| 10.80 mm | .4252 | 10.90 mm | .4291 | 11.00 mm | .4331 |
| 11.10 mm | .4370 | 11.20 mm | .4409 | 11.25 mm | .4429 |
| 11.30 mm | .4449 | 11.40 mm | .4488 | 11.50 mm | .4528 |
| 11.60 mm | .4567 | 11.70 mm | .4606 | 11.75 mm | .4626 |

|          |       |          |       |          |       |
|----------|-------|----------|-------|----------|-------|
| 11.80 mm | .4646 | 11.90 mm | .4685 | 12.00 mm | .4724 |
| 12.50 mm | .4921 | 13.00 mm | .5118 | 13.50 mm | .5315 |
| 14.00 mm | .5512 | 14.50 mm | .5709 | 15.00 mm | .5906 |
| 15.50 mm | .6102 | 16.00 mm | .6299 | 16.50 mm | .6496 |
| 17.00 mm | .6693 | 17.50 mm | .6890 | 18.00 mm | .7087 |
| 18.50 mm | .7283 | 19.00 mm | .7480 | 19.50 mm | .7677 |
| 20.00 mm | .7874 | 20.50 mm | .8071 | 21.00 mm | .8268 |
| 21.50 mm | .8465 | 22.00 mm | .8661 | 22.50 mm | .8858 |
| 23.00 mm | .9055 | 23.50 mm | .9252 | 24.00 mm | .9449 |
| 24.50 mm | .9646 | 25.00 mm | .9843 |          |       |

## Appendix F Centroid (X-Y) File Format

### F.1 Overview

### F.2 File Format

The centroid output file is in a standard comma separated values (CSV) format. Comment lines begin with a “#”. The output file contains a header with a version number for the file format, some comments containing the author and title of the board, and a comment describing the remainder of the file format.

An example centroid file is shown below.

```
PcbXY Version 1.0
Date: Fri Jul 22 03:40:08 2005 UTC
Author: PCB User
Title: MyBoard - PCB X-Y
RefDes, Description, Value, X, Y, rotation, top/bottom
X,Y in mils. rotation in degrees.

R61,"0603","10",2610.00,3560.00,90,top
J5,"AMPHENOL_ARFX1231","unknown",2390.00,4220.00,180,top
C13,"0402","0.01u",2340.00,3014.00,270,top
```

### F.3 Computation of Centroid and Rotation

The center of each element is found by averaging the (X,Y) coordinates for the center of each pin and pad in the element. For example if an element has 2 pins, 1 at (1,0) and another at (1,4) then the centroid will be at (1,2).

The calculation of rotation is a bit more complex. Currently a rotation is not stored for each element but rather the rotated element is stored. In other words if the element from the library has a pin at (0,0) and (0,2) and it has been rotated by 90 degrees, then the ‘.pcb’ file will store (0,0) and (2,0) for the pin locations with no indication that they have been rotated from the original.

In the event that the element has only 1 pin, then the rotation is set to zero. If the element has only one pad (as opposed to a through-hole pin), then the rotation of the pad is used.

When the element has multiple pins, the location of pin #1 is placed in the coordinate system which has the centroid of the part at (0,0). Then which quadrant pin #1 falls in determines the rotation. Zero degrees of rotation is defined as pin #1 being in the upper left quadrant. Increasing angles correspond to counterclockwise rotation so a rotation of 90 degrees places pin #1 in the lower left quadrant. Currently, the only allowed rotations are 0, 90, 180, and 270 degrees.

If pin #1 happens to be at the centroid of the part, then pin #2 is examined to see which quadrant it is located in. The same rules apply for the definitions of rotation. In

other words, when pin #1 is at the centroid of the part and pin #2 is in the upper left quadrant, the rotation is declared to be zero degrees.

# Appendix G Annotation File Format

## G.1 Overview

## G.2 File Format

The annotation output file is an ASCII file that can be used to communicate layout changes that affect the netlist back to a schematic tool. Currently the only place this file is used is if when the `Renumber()` action is called within `Pcb`. `Renumber()` will renumber all the reference designators (instance names) in the layout. The result of the renumbering will be written out to an annotation file which can be used to propagate the changes to the schematic sources. See [Section H.1.64 \[Renumber Action\], page 141](#) for details on the `Renumber()` action. If you are using `gschem` (part of `gEDA/gaf`) as your schematic entry tool then refer to `pcb_backannotate(1)` for details on how to use the annotation file to make the changes to the schematics.

The annotation file format is fairly simple. Each line consists of a command followed by arguments. Blank lines and lines consisting of only whitespace are ignored. There are no line continuations.

An example annotation file is shown below.

```
COMMENT PCB Annotation File
FILEVERSION 20061031
RENAME "C17" "C1"
RENAME "U5" "U1"
RENAME "U6" "U2"
RENAME "C21" "C2"
RENAME "R14" "R1"
RENAME "C7" "C3"
RENAME "C8" "C4"
RENAME "C6" "C5"
```

### G.2.1 \*COMMENT\*

Command for a comment. The text of a comment is ignored by tools which process the annotation file.

```
COMMENT text
```

### G.2.2 \*FILEVERSION\*

Indicates what version of the annotation file is in use. The date code corresponds to the date when the current version was added to the `Pcb` sources.

```
FILEVERSION datecode
```

**G.2.3 \*RENAME\***

Renames an element. The arguments are enclosed in double quotes and are the original name and the new name.

```
RENAME "old" "new"
```



## Appendix H Action Reference

Many actions take a `delta` parameter as the last parameter, which is an amount to change something. That `delta` may include units, as an additional parameter, such as `Action(Object,5,mm)`. If no units are specified, the default is PCB's native units (currently 1/100 mil). Also, if the delta is prefixed by `+` or `-`, the size is increased or decreased by that amount. Otherwise, the size size is set to the given amount.

```
Action(Object,5,mil)
Action(Object,+0.5,mm)
Action(Object,-1)
```

Actions which take a `delta` parameter which do not accept all these options will specify what they do take.

Many actions act on indicated objects on the board. They will have parameters like `ToggleObject` or `SelectedVias` to indicate what group of objects they act on. Unless otherwise specified, these parameters are defined as follows:

`Object`

`ToggleObject`

Affects the object under the mouse pointer. If this action is invoked from a menu or script, the user will be prompted to click on an object, which is then the object affected.

`Selected`

`SelectedObjects`

Affects all objects which are currently selected. At least, all selected objects for which the given action makes sense.

`SelectedPins`

`SelectedVias`

`SelectedType`

*etc* Affects all objects which are both selected and of the *Type* specified.

### H.1 Core actions

#### H.1.1 AddRats

```
AddRats(AllRats|SelectedRats|Close)
```

Add one or more rat lines to the board.

`AllRats` Create rat lines for all loaded nets that aren't already connected on with copper.

`SelectedRats`

Similarly, but only add rat lines for nets connected to selected pins and pads.

`Close` Selects the shortest unselected rat on the board.

### H.1.2 ApplyVendor

```
ApplyVendor()
```

Applies the currently loaded vendor drill table to the current design.

This will modify all of your drill holes to match the list of allowed sizes for your vendor.

### H.1.3 Atomic

```
Atomic(Save|Restore|Close|Block)
```

Save or restore the undo serial number.

This action allows making multiple-action bindings into an atomic operation that will be undone by a single Undo command. For example, to optimize rat lines, you'd delete the rats and re-add them. To group these into a single undo, you'd want the deletions and the additions to have the same undo serial number. So, you **Save**, delete the rats, **Restore**, add the rats - using the same serial number as the deletes, then **Block**, which checks to see if the deletions or additions actually did anything. If not, the serial number is set to the saved number, as there's nothing to undo. If something did happen, the serial number is incremented so that these actions are counted as a single undo step.

**Save**        Saves the undo serial number.

**Restore**    Returns it to the last saved number.

**Close**     Sets it to 1 greater than the last save.

**Block**     Does a Restore if there was nothing to undo, else does a Close.

### H.1.4 Attributes

```
Attributes(Layout|Layer|Element)
Attributes(Layer,layername)
```

Let the user edit the attributes of the layout, current or given layer, or selected element.

This just pops up a dialog letting the user edit the attributes of the pcb, an element, or a layer.

### H.1.5 AutoPlaceSelected

```
AutoPlaceSelected()
```

Auto-place selected components.

Attempts to re-arrange the selected components such that the nets connecting them are minimized. Note that you cannot undo this.

### H.1.6 AutoRoute

```
AutoRoute(AllRats|SelectedRats)
```

Auto-route some or all rat lines.

**AllRats**    Attempt to autoroute all rats.

**SelectedRats**  
           Attempt to autoroute the selected rats.

Before autorouting, it's important to set up a few things. First, make sure any layers you aren't using are disabled, else the autorouter may use them. Next, make sure the current line and via styles are set accordingly. Last, make sure "new lines clear polygons" is set, in case you eventually want to add a copper pour.

Autorouting takes a while. During this time, the program may not be responsive.

### H.1.7 ChangeClearSize

```
ChangeClearSize(Object, delta)
ChangeClearSize(SelectedPins|SelectedPads|SelectedVias, delta)
ChangeClearSize(SelectedLines|SelectedArcs, delta)
ChangeClearSize(Selected|SelectedObjects, delta)
```

Changes the clearance size of objects.

If the solder mask is currently showing, this action changes the solder mask clearance. If the mask is not showing, this action changes the polygon clearance.

### H.1.8 ChangeDrillSize

```
ChangeDrillSize(Object, delta)
ChangeDrillSize(SelectedPins|SelectedVias|Selected|SelectedObjects, delta)
```

Changes the drilling hole size of objects.

### H.1.9 ChangeFlag

```
ChangeFlag(Object|Selected|SelectedObjects, flag, value)
ChangeFlag(SelectedLines|SelectedPins|SelectedVias, flag, value)
ChangeFlag(SelectedPads|SelectedTexts|SelectedNames, flag, value)
ChangeFlag(SelectedElements, flag, value)
flag = square | octagon | thermal | join
value = 0 | 1
```

Sets or clears flags on objects.

Toggles the given flag on the indicated object(s). The flag may be one of the flags listed above (square, octagon, thermal, join). The value may be the number 0 or 1. If the value is 0, the flag is cleared. If the value is 1, the flag is set.

### H.1.10 ChangeHole

```
ChangeHole(ToggleObject | Object | SelectedVias | Selected)
```

Changes the hole flag of objects.

The "hole flag" of a via determines whether the via is a plated-through hole (not set), or an unplated hole (set).

### H.1.11 ChangeJoin

```
ChangeJoin(ToggleObject | SelectedLines | SelectedArcs | Selected)
```

Changes the join (clearance through polygons) of objects.

The join flag determines whether a line or arc, drawn to intersect a polygon, electrically connects to the polygon or not. When joined, the line/arc is simply drawn over the polygon, making an electrical connection. When not joined, a gap is drawn between the line and the polygon, insulating them from each other.

### H.1.12 ChangeName

```
ChangeName(Object)
ChangeName(Layout | Layer)
```

Sets the name of objects.

**Object** Changes the name of the element under the cursor.

**Layout** Changes the name of the layout. This is printed on the fab drawings.

**Layer** Changes the name of the currently active layer.

### H.1.13 ChangeOctagon

```
ChangeOctagon(Object | ToggleObject | SelectedObjects | Selected)
ChangeOctagon(SelectedElements | SelectedPins | SelectedVias)
```

Changes the octagon-flag of pins and vias.

Pins, pads, and vias can have various shapes. All may be round. Pins and pads may be square (obviously "square" pads are usually rectangular). Pins and vias may be octagonal. When you change a shape flag of an element, you actually change all of its pins and pads.

Note that the square flag takes precedence over the octagon flag, thus, if both the square and octagon flags are set, the object is square. When the square flag is cleared, the pins and pads will be either round or, if the octagon flag is set, octagonal.

### H.1.14 ChangePaste

```
ChangePaste(ToggleObject|Object|SelectedPads|Selected)
```

Changes the no paste flag of objects.

The "no paste flag" of a pad determines whether the solderpaste stencil will have an opening for the pad (no set) or if there will be no solderpaste on the pad (set). This is used for things such as fiducial pads.

### H.1.15 ChangePinName

```
ChangePinName(ElementName,PinNumber,PinName)
```

Sets the name of a specific pin on a specific element.

This can be especially useful for annotating pin names from a schematic to the layout without requiring knowledge of the pcb file format.

```
ChangePinName(U3, 7, VCC)
```

### H.1.16 ChangeSize

```
ChangeSize(Object, delta)
ChangeSize(SelectedObjects|Selected, delta)
ChangeSize(SelectedLines|SelectedPins|SelectedVias, delta)
ChangeSize(SelectedPads|SelectedTexts|SelectedNames, delta)
ChangeSize(SelectedElements, delta)
```

Changes the size of objects.

For lines and arcs, this changes the width. For pins and vias, this changes the overall diameter of the copper annulus. For pads, this changes the width and, indirectly, the length. For texts and names, this changes the scaling factor. For elements, this changes the width of the silk layer lines and arcs for this element.

### H.1.17 ChangeSquare

```
ChangeSquare(ToggleObject)
ChangeSquare(SelectedElements|SelectedPins)
ChangeSquare(Selected|SelectedObjects)
```

Changes the square flag of pins and pads.

Note that Pins means both pins and pads.

Pins, pads, and vias can have various shapes. All may be round. Pins and pads may be square (obviously "square" pads are usually rectangular). Pins and vias may be octagonal. When you change a shape flag of an element, you actually change all of its pins and pads.

Note that the square flag takes precedence over the octagon flag, thus, if both the square and octagon flags are set, the object is square. When the square flag is cleared, the pins and pads will be either round or, if the octagon flag is set, octagonal.

### H.1.18 ClearOctagon

```
ClearOctagon(ToggleObject | Object | SelectedObjects | Selected)
ClearOctagon(SelectedElements | SelectedPins | SelectedVias)
```

Clears the octagon-flag of pins and vias.

Pins, pads, and vias can have various shapes. All may be round. Pins and pads may be square (obviously "square" pads are usually rectangular). Pins and vias may be octagonal. When you change a shape flag of an element, you actually change all of its pins and pads.

Note that the square flag takes precedence over the octagon flag, thus, if both the square and octagon flags are set, the object is square. When the square flag is cleared, the pins and pads will be either round or, if the octagon flag is set, octagonal.

### H.1.19 ClearSquare

```
ClearSquare(ToggleObject | SelectedElements | SelectedPins)
```

Clears the square-flag of pins and pads.

Note that **Pins** means pins and pads.

Pins, pads, and vias can have various shapes. All may be round. Pins and pads may be square (obviously "square" pads are usually rectangular). Pins and vias may be octagonal. When you change a shape flag of an element, you actually change all of its pins and pads.

Note that the square flag takes precedence over the octagon flag, thus, if both the square and octagon flags are set, the object is square. When the square flag is cleared, the pins and pads will be either round or, if the octagon flag is set, octagonal.

### H.1.20 ClrFlag

```
ClrFlag(Object | Selected | SelectedObjects, flag)
ClrFlag(SelectedLines | SelectedPins | SelectedVias, flag)
ClrFlag(SelectedPads | SelectedTexts | SelectedNames, flag)
ClrFlag(SelectedElements, flag)
flag = square | octagon | thermal | join
```

Clears flags on objects.

Turns the given flag off, regardless of its previous setting. See **ChangeFlag**.

```
ClrFlag(SelectedLines, join)
```

### H.1.21 Connection

Connection(Find | ResetLinesAndPolygons | ResetPinsAndVias | Reset)

Searches connections of the object at the cursor position.

Connections found with this action will be highlighted in the “connected-color” color and will have the “found” flag set.

**Find** The net under the cursor is “found”.

**ResetLinesAndPolygons**

Any “found” lines and polygons are marked “not found”.

**ResetPinsAndVias**

Any “found” pins and vias are marked “not found”.

**Reset** All “found” objects are marked “not found”.

### H.1.22 Delete

Delete(Object | Selected)  
Delete(AllRats | SelectedRats)

Delete stuff.

### H.1.23 DeleteRats

DeleteRats(AllRats | Selected | SelectedRats)

Delete rat lines.

### H.1.24 DisableVendor

DisableVendor()

Disables automatic drill size mapping.

When drill mapping is enabled, new instances of pins and vias will have their drill holes mapped to one of the allowed drill sizes specified in the currently loaded vendor drill table.

### H.1.25 DisperseElements

DisperseElements(All | Selected)

Disperses elements.

Normally this is used when starting a board, by selecting all elements and then dispersing them. This scatters the elements around the board so that you can pick individual ones, rather than have all the elements at the same 0,0 coordinate and thus impossible to choose from.

## H.1.26 Display

Display(NameOnPCB|Description|Value)  
 Display(Grid|Redraw)  
 Display(CycleClip|CycleCrosshair|Toggle45Degree|ToggleStartDirection)  
 Display(ToggleGrid|ToggleRubberBandMode|ToggleUniqueNames)  
 Display(ToggleMask|ToggleName|ToggleClearLine|ToggleFullPoly|ToggleSnapPin)  
 Display(ToggleThindraw|ToggleThindrawPoly|ToggleOrthoMove|ToggleLocalRef)  
 Display(ToggleCheckPlanes|ToggleShowDRC|ToggleAutoDRC)  
 Display(ToggleLiveRoute|LockNames|OnlyNames)  
 Display(Pinout|PinOrPadName)

Several display-related actions.

**NameOnPCB**

**Description**

**Value** Specify whether all elements show their name, description, or value.

**Redraw** Redraw the whole board.

**Toggle45Degree**

When clear, lines can be drawn at any angle. When set, lines are restricted to multiples of 45 degrees and requested lines may be broken up according to the clip setting.

**CycleClip**

Changes the way lines are restricted to 45 degree increments. The various settings are: straight only, orthogonal then angled, and angled then orthogonal. If AllDirections is set, this action disables it.

**CycleCrosshair**

Changes crosshair drawing. Crosshair may accept form of 4-ray, 8-ray and 12-ray cross.

**ToggleRubberBandMode**

If set, moving an object moves all the lines attached to it too.

**ToggleStartDirection**

If set, each time you set a point in a line, the Clip toggles between orth-angle and angle-ortho.

**ToggleUniqueNames**

If set, you will not be permitted to change the name of an element to match that of another element.

**ToggleSnapPin**

If set, pin centers and pad end points are treated as additional grid points that the cursor can snap to.

**ToggleLocalRef**

If set, the mark is automatically set to the beginning of any move, so you can see the relative distance you've moved.



**ToggleThindraw**

If set, objects on the screen are drawn as outlines (lines are drawn as center-lines). This lets you see line endpoints hidden under pins, for example.

**ToggleThindrawPoly**

If set, polygons on the screen are drawn as outlines.

**ToggleShowDRC**

If set, pending objects (i.e. lines you're in the process of drawing) will be drawn with an outline showing how far away from other copper you need to be.

**ToggleLiveRoute**

If set, the progress of the autorouter will be visible on the screen.

**ToggleAutoDRC**

If set, you will not be permitted to make connections which violate the current DRC and netlist settings.

**ToggleCheckPlanes**

If set, lines and arcs aren't drawn, which usually leaves just the polygons. If you also disable all but the layer you're interested in, this allows you to check for isolated regions.

**ToggleOrthoMove**

If set, the crosshair is only allowed to move orthogonally from its previous position. I.e. you can move an element or line up, down, left, or right, but not up+left or down+right.

**ToggleName**

Selects whether the pinouts show the pin names or the pin numbers.

**ToggleLockNames**

If set, text will ignore left mouse clicks and actions that work on objects under the mouse. You can still select text with a lasso (left mouse drag) and perform actions on the selection.

**ToggleOnlyNames**

If set, only text will be sensitive for mouse clicks and actions that work on objects under the mouse. You can still select other objects with a lasso (left mouse drag) and perform actions on the selection.

**ToggleMask**

Turns the solder mask on or off.

**ToggleClearLine**

When set, the clear-line flag causes new lines and arcs to have their "clear polygons" flag set, so they won't be electrically connected to any polygons they overlap.

**ToggleFullPoly**

When set, the full-poly flag causes new polygons to have their "full polygon" flag set, so all parts of them will be displayed instead of only the biggest one.




**simple** Removing unneeded vias, replacing two or more trace segments in a row with a single segment. This is usually performed automatically after other optimizations.

**vianudge** Looks for vias where all traces leave in the same direction. Tries to move via in that direction to eliminate one of the traces (and thus a corner).

Example:

Before vianudge:




After vianudge:




**viatrim** Looks for traces that go from via to via, where moving that trace to a different layer eliminates one or both vias.

Example:

Before viatrim:



After viatrim:




**orthopull**


Looks for chains of traces all going in one direction, with more traces orthogonal on one side than on the other. Moves the chain in that direction, causing a net reduction in trace length, possibly eliminating traces and/or corners.

Example:

Before orthopull:



After orthopull:



**splitlines**

Looks for lines that pass through vias, pins, or pads, and splits them into separate lines so they can be managed separately.

**auto** Performs the above options, repeating until no further optimizations can be made.

**miter** Replaces 90 degree corners with a pair of 45 degree corners, to reduce RF losses and trace length.

Example:

Before miter:



After miter:



### H.1.28 DRC

DRC()

Invoke the DRC check.

Note that the design rule check uses the current board rule settings, not the current style settings.

### H.1.29 DumpLibrary

DumpLibrary()

Display the entire contents of the libraries.

### H.1.30 elementlist

ElementList(Start | Done | Need, <refdes>, <footprint>, <value>)

Adds the given element if it doesn't already exist.

- |              |                                                                                                                                                                                                           |
|--------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Start</b> | Indicates the start of an element list; call this before any Need actions.                                                                                                                                |
| <b>Need</b>  | Searches the board for an element with a matching refdes.<br>If found, the value and footprint are updated.<br>If not found, a new element is created with the given footprint and value.                 |
| <b>Done</b>  | Compares the list of elements needed since the most recent <b>start</b> with the list of elements actually on the board. Any elements that weren't listed are selected, so that the user may delete them. |

### H.1.31 elementsetattr

ElementSetAttr(refdes, name[, value])

Sets or clears an element-specific attribute.

If a value is specified, the named attribute is added (if not already present) or changed (if it is) to the given value. If the value is not specified, the given attribute is removed if present.

### H.1.32 EnableVendor

```
EnableVendor()
```

Enables automatic drill size mapping.

When drill mapping is enabled, new instances of pins and vias will have their drill holes mapped to one of the allowed drill sizes specified in the currently loaded vendor drill table. To enable drill mapping, a vendor resource file containing a drill table must be loaded first.

### H.1.33 execcommand

```
ExecCommand(command)
```

Runs a command.

Runs the given command, which is a system executable.

### H.1.34 ExecuteFile

```
ExecuteFile(filename)
```

Run actions from the given file.

Lines starting with # are ignored.

### H.1.35 Flip

```
Flip(Object | Selected | SelectedElements)
```

Flip an element to the opposite side of the board.

Note that the location of the element will be symmetric about the cursor location; i.e. if the part you are pointing at will still be at the same spot once the element is on the other side. When flipping multiple elements, this retains their positions relative to each other, not their absolute positions on the board.

### H.1.36 FontEdit

```
FontEdit()
```

Convert the current font to a PCB for editing.

This command only allows a font to be edited if the layout being edited contains font symbols. The existing font symbols are displayed on a layer with an overlaid grid, with the new version of the font on another layer which can be modified. Font symbols consist only of lines. The blue lines next to the font symbols indicate the space required after the symbol when it is used.

### H.1.37 FontSave

```
FontSave()
```

Convert the current PCB back to a font.

Once a font has been modified with the `FontEdit` command, the layout can be saved as a new PCB layout. The new PCB layout can then be opened with a text editor so that the font section can be removed and saved as a new "default\_font" file for use in other PCB layouts.

### H.1.38 FreeRotateBuffer

```
FreeRotateBuffer([Angle])
```

Rotates the current paste buffer contents by the specified angle. The angle is given in degrees. If no angle is given, the user is prompted for one.

Rotates the contents of the pastebuffer by an arbitrary angle. If no angle is given, the user is prompted for one.

### H.1.39 GlobalPuller

```
GlobalPuller()
```

Pull all traces tight.

### H.1.40 Import

```
Import()
Import([gnetlist | make[,source,source,...]])
Import(setnewpoint[, (mark | center | X,Y)])
Import(setdisperse,D,units)
```

Import schematics.

Imports element and netlist data from the schematics (or some other source). The first parameter, which is optional, is the mode. If not specified, the `import::mode` attribute in the PCB is used. `gnetlist` means gnetlist is used to obtain the information from the schematics. `make` invokes `make`, assuming the user has a `Makefile` in the current directory. The `Makefile` will be invoked with the following variables set:

|                      |                                                                                                                                                                                         |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <code>PCB</code>     | The name of the .pcb file                                                                                                                                                               |
| <code>SRCLIST</code> | A space-separated list of source files                                                                                                                                                  |
| <code>OUT</code>     | The name of the file in which to put the command script, which may contain any <code>Pcb</code> actions. By default, this is a temporary file selected by <code>Pcb</code> , but if you |

specify an `import::outfile` attribute, that file name is used instead (and not automatically deleted afterwards).

The target specified to be built is the first of these that apply:

- The target specified by an `import::target` attribute.
- The output file specified by an `import::outfile` attribute.
- If nothing else is specified, the target is `pcb_import`.

If you specify an `import::makefile` attribute, then `"-f <that file>"` will be added to the command line.

If you specify the mode, you may also specify the source files (schematics). If you do not specify any, the list of schematics is obtained by reading the `import::srcN` attributes (like `import::src0`, `import::src1`, etc).

For compatibility with future extensions to the import file format, the generated file *must not* start with the two characters `##`.

If a temporary file is needed the `TMPDIR` environment variable is used to select its location.

Note that the programs `gnetlist` and `make` may be overridden by the user via the `make-program` and `gnetlist pcb` settings (i.e. in `~/.pcb/settings` or on the command line).

If `Pcb` cannot determine which schematic(s) to import from, the GUI is called to let user choose (see `ImportGUI()`).

Note that `Import()` doesn't delete anything - after an `Import`, elements which shouldn't be on the board are selected and may be removed once it's determined that the deletion is appropriate.

If `Import()` is called with `setnewpoint`, then the location of new components can be specified. This is where parts show up when they're added to the board. The default is the center of the board.

`Import(setnewpoint)`

Prompts the user to click on the board somewhere, uses that point. If called by a hotkey, uses the current location of the crosshair.

`Import(setnewpoint,mark)`

Uses the location of the mark. If no mark is present, the point is not changed.

`Import(setnewpoint,center)`

Resets the point to the center of the board.

`Import(setnewpoint,X,Y,units)`

Sets the point to the specific coordinates given. Example:  
`Import(setnewpoint,50,25,mm)`

Note that the X and Y locations are stored in attributes named `import::newX` and `import::newY` so you could change them manually if you wished.

Calling `Import(setdisperse,D,units)` sets how much the newly placed elements are dispersed relative to the set point. For example, `Import(setdisperse,10,mm)` will offset each part randomly up to 10mm away from the point. The default dispersion is 1/10th of the smallest board dimension. Dispersion is saved in the `import::disperse` attribute.

### H.1.41 ListLayertypes

```
ListLayertypes()
```

List all available layertypes.

Lists all available layer types. These are the valid types for the second argument of see [Section H.1.75 \[SetLayertype Action\]](#), page 144 or when editing the layout file with a text editor.

### H.1.42 LoadFootprint

```
LoadFootprint(filename[,refdes,value])
```

Loads a single footprint by name.

Loads a single footprint by name, rather than by reference or through the library. If a `refdes` and `value` are specified, those are inserted into the footprint as well. The footprint remains in the paste buffer.

### H.1.43 LoadFrom

```
LoadFrom(Layout | LayoutToBuffer | ElementToBuffer | Netlist | Revert,filename)
```

Load layout data from a file.

This action assumes you know what the filename is. The various GUIs should have a similar **Load** action where the filename is optional, and will provide their own file selection mechanism to let you choose the file name.

**Layout** Loads an entire PCB layout, replacing the current one.

**LayoutToBuffer**

Loads an entire PCB layout to the paste buffer.

**ElementToBuffer**

Loads the given element file into the paste buffer. Element files contain only a single **Element** definition, such as the “newlib” library uses.

**Netlist** Loads a new netlist, replacing any current netlist.

**Revert** Re-loads the current layout from its disk file, reverting any changes you may have made.

### H.1.44 LoadVendorFrom

```
LoadVendorFrom(filename)
```

Loads the specified vendor resource file.

*filename* Name of the vendor resource file. If not specified, the user will be prompted to enter one.



### H.1.45 MarkCrosshair

```
MarkCrosshair()
MarkCrosshair(Center)
```

Set/Reset the Crosshair mark.

The “mark” is a small X-shaped target on the display which is treated like a second origin (the normal origin is the upper left corner of the board). The GUI will display a second set of coordinates for this mark, which tells you how far you are from it.

If no argument is given, the mark is toggled - disabled if it was enabled, or enabled at the current cursor position of disabled. If the **Center** argument is given, the mark is moved to the current cursor location.

### H.1.46 Message

```
Message(message)
```

Writes a message to the log window.

This action displays a message to the log window. This action is primarily provided for use by other programs which may interface with PCB. If multiple arguments are given, each one is sent to the log window followed by a newline.

### H.1.47 MinClearGap

```
MinClearGap(delta)
MinClearGap(Selected, delta)
```

Ensures that polygons are a minimum distance from objects.

Checks all specified objects, and increases the polygon clearance if needed to ensure a minimum distance between their edges and the polygon edges.

### H.1.48 MinMaskGap

```
MinMaskGap(delta)
MinMaskGap(Selected, delta)
```

Ensures the mask is a minimum distance from pins and pads.

Checks all specified pins and/or pads, and increases the mask if needed to ensure a minimum distance between the pin or pad edge and the mask edge.

### H.1.49 Mode

```
Mode(Arc | Arrow | Copy | InsertPoint | Line | Lock | Move | None | PasteBuffer)
Mode(Polygon | Rectangle | Remove | Rotate | Text | Thermal | Via)
Mode(Notify | Release | Cancel | Stroke)
Mode(Save | Restore)
```

Change or use the tool mode.

|             |                                                                                                                                                                        |
|-------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Arc         |                                                                                                                                                                        |
| Arrow       |                                                                                                                                                                        |
| Copy        |                                                                                                                                                                        |
| InsertPoint |                                                                                                                                                                        |
| Line        |                                                                                                                                                                        |
| Lock        |                                                                                                                                                                        |
| Move        |                                                                                                                                                                        |
| None        |                                                                                                                                                                        |
| PasteBuffer |                                                                                                                                                                        |
| Polygon     |                                                                                                                                                                        |
| Rectangle   |                                                                                                                                                                        |
| Remove      |                                                                                                                                                                        |
| Rotate      |                                                                                                                                                                        |
| Text        |                                                                                                                                                                        |
| Thermal     |                                                                                                                                                                        |
| Via         | Select the indicated tool.                                                                                                                                             |
| Notify      | Called when you press the mouse button, or move the mouse.                                                                                                             |
| Release     | Called when you release the mouse button.                                                                                                                              |
| Cancel      | Cancels any pending tool activity, allowing you to restart elsewhere. For example, this allows you to start a new line rather than attach a line to the previous line. |
| Escape      | Similar to Cancel but calling this action a second time will return to the Arrow tool.                                                                                 |
| Stroke      | If your pcb was built with libstroke, this invokes the stroke input method. If not, this will restart a drawing mode if you were drawing, else it will select objects. |
| Save        | Remembers the current tool.                                                                                                                                            |
| Restore     | Restores the tool to the last saved tool.                                                                                                                              |

### H.1.50 MorphPolygon

```
MorphPolygon(Object | Selected)
```

Converts dead polygon islands into separate polygons.

If a polygon is divided into unconnected "islands", you can use this command to convert the otherwise disappeared islands into separate polygons. Be sure the cursor is over a portion of the polygon that remains visible. Very small islands that may flake off are automatically deleted.

### H.1.51 MoveLayer

```
MoveLayer(old,new)
```

Moves/Creates/Deletes Layers.

Moves a layer, creates a new layer, or deletes a layer.

|               |                                                           |
|---------------|-----------------------------------------------------------|
| <b>old</b>    | The is the layer number to act upon. Allowed values are:  |
| <b>c</b>      | Currently selected layer.                                 |
| <b>-1</b>     | Create a new layer.                                       |
| <b>number</b> | An existing layer number.                                 |
| <b>new</b>    | Specifies where to move the layer to. Allowed values are: |
| <b>-1</b>     | Deletes the layer.                                        |
| <b>up</b>     | Moves the layer up.                                       |
| <b>down</b>   | Moves the layer down.                                     |
| <b>c</b>      | Creates a new layer.                                      |

### H.1.52 MoveObject

```
MoveObject(X,Y,dim)
```

Moves the object under the crosshair.

The **X** and **Y** are treated like **delta** is for many other objects. For each, if it's prefixed by + or -, then that amount is relative. Otherwise, it's absolute. Units can be **mil** or **mm**; if unspecified, units are PCB's internal units, currently 1/100 mil.

### H.1.53 MoveToCurrentLayer

```
MoveToCurrentLayer(Object|SelectedObjects)
```

Moves objects to the current layer.

Note that moving an element from a component layer to a solder layer, or from solder to component, won't automatically flip it. Use the **Flip()** action to do that.

### H.1.54 Netlist

```
Net(find|select|rats|norats|clear[,net[,pin]])
Net(freeze|thaw|forcethaw)
Net(add,net,pin)
```

Perform various actions on netlists.

Each of these actions apply to a specified set of nets. *net* and *pin* are patterns which match one or more nets or pins; these patterns may be full names or regular expressions. If an exact match is found, it is the only match; if no exact match is found, *then* the pattern is tried as a regular expression.

If neither *net* nor *pin* are specified, all nets apply. If *net* is specified but not *pin*, all nets matching *net* apply. If both are specified, nets which match *net* and contain a pin matching *pin* apply.

**find** Nets which apply are marked *found* and are drawn in the `connected-color` color.

**select** Nets which apply are selected.

**rats** Nets which apply are marked as available for the rats nest.

**norats** Nets which apply are marked as not available for the rats nest.

**clear** Clears the netlist.

**add** Add the given pin to the given netlist, creating either if needed.

**sort** Called after a list of add's, this sorts the netlist.

**freeze**

**thaw**

**forcethaw**

Temporarily prevents changes to the netlist from being reflected in the GUI. For example, if you need to make multiple changes, you freeze the netlist, make the changes, then thaw it. Note that freeze/thaw requests may nest, with the netlist being fully thawed only when all pending freezes are thawed. You can bypass the nesting by using `forcethaw`, which resets the freeze count and immediately updates the GUI.

### H.1.55 New

```
New([name])
```

Starts a new layout.

If a name is not given, one is prompted for.

### H.1.56 OptAutoOnly

```
OptAutoOnly()
```

Toggles the optimize-only-autorouted flag.

The original purpose of the trace optimizer was to clean up the traces created by the various autorouters that have been used with PCB. When a board has a mix of autorouted and carefully hand-routed traces, you don't normally want the optimizer to move your hand-routed traces. But, sometimes you do. By default, the optimizer only optimizes autorouted traces. This action toggles that setting, so that you can optimize hand-routed traces also.

### H.1.57 PasteBuffer

```
PasteBuffer(AddSelected|Clear|1..MAX_BUFFER)
PasteBuffer(Rotate, 1..3)
PasteBuffer(Convert|Save|Restore|Mirror)
PasteBuffer(ToLayout, X, Y, units)
```

Various operations on the paste buffer.

There are a number of paste buffers; the actual limit is a compile-time constant `MAX_BUFFER` in `'globalconst.h'`. It is currently 5. One of these is the “current” paste buffer, often referred to as “the” paste buffer.

#### AddSelected

Copies the selected objects to the current paste buffer.

#### Clear

Remove all objects from the current paste buffer.

#### Convert

Convert the current paste buffer to an element. Vias are converted to pins, lines are converted to pads.

#### Restore

Convert any elements in the paste buffer back to vias and lines.

#### Mirror

Flip all objects in the paste buffer vertically (up/down flip). To mirror horizontally, combine this with rotations.

#### Rotate

Rotates the current buffer. The number to pass is 1..3, where 1 means 90 degrees counter clockwise, 2 means 180 degrees, and 3 means 90 degrees clockwise (270 CCW).

#### Save

Saves any elements in the current buffer to the indicated file.

#### ToLayout

Pastes any elements in the current buffer to the indicated X, Y coordinates in the layout. The X and Y are treated like `delta` is for many other objects. For each, if it's prefixed by + or -, then that amount is relative to the last location. Otherwise, it's absolute. Units can be `mil` or `mm`; if unspecified, units are PCB's internal units, currently 1/100 mil.

#### 1..MAX\_BUFFER

Selects the given buffer to be the current paste buffer.

### H.1.58 Polygon

```
Polygon(Close|PreviousPoint)
```

Some polygon related stuff.

Polygons need a special action routine to make life easier.

**Close** Creates the final segment of the polygon. This may fail if clipping to 45 degree lines is switched on, in which case a warning is issued.

**PreviousPoint**


Resets the newly entered corner to the previous one. The Undo action will call `Polygon(PreviousPoint)` when appropriate to do so.

### H.1.59 Puller

Puller()

Pull an arc-line junction tight.

The `Puller()` action is a special-purpose optimization. When invoked while the crosshair is over the junction of an arc and a line, it will adjust the arc's angle and the connecting line's endpoint such that the line intersects the arc at a tangent. In the example below, the left side is "before" with the black target marking where to put the crosshair:



The right side is "after" with the black target marking where the arc-line intersection was moved to.

### H.1.60 Quit

Quit()

Quits the application after confirming.

If you have unsaved changes, you will be prompted to confirm (or save) before quitting.

### H.1.61 Redo

Redo()

Redo recent "undo" operations.

This routine allows you to recover from the last undo command. You might want to do this if you thought that undo was going to revert something other than what it actually did (in case you are confused about which operations are un-doable), or if you have been backing up through a long undo list and over-shoot your stopping point. Any change that is made since the undo in question will trim the redo list. For example if you add ten lines, then undo three of them you could use redo to put them back, but if you move a line on the board before performing the redo, you will lose the ability to "redo" the three "undone" lines.

### H.1.62 Relocate

The `Relocate()` action in `pcb` that will take all selected elements and stack them up at the current crosshairs. This works well when starting a new layout and you have hundreds of parts on your workspace and you're just starting to do your component placement. Use `Select Element by Name (refdes)` to select the elements you want to move, and then use `:Relocate()` to set the position of those elements to where ever your crosshair is.

TODO: Right now, if multiple elements are selected, they are all are stacked up on top of each other. Instead make them spread out the way `Disperse Elements` does.

### H.1.63 RemoveSelected

```
RemoveSelected()
```

Removes any selected objects.

### H.1.64 Renumber

```
Renumber()
Renumber(filename)
```

Renumber all elements. The changes will be recorded to `filename` for use in backannotating these changes to the schematic.

### H.1.65 RenumberBlock

The `RenumberBlocks()` action rennumbers all selected refdes on the `pcb`.

Usage: `RenumberBlock(oldnum,newnum)`

All selected elements are renumbered by adding `(newnum-oldnum)` to the existing number.

To invoke it, use the command window, usually by typing `:"`.

Example:

`RenumberBlock(100,200)` will change R213 to R313.

### H.1.66 RenumberBuffer

The `RenumberBuffer()` action rennumbers all selected refdes in the paste buffer.

Usage: `RenumberBuffer(oldnum,newnum)`

All selected elements are renumbered by adding `(newnum-oldnum)` to the existing number.

To invoke it, use the command window, usually by typing `:"`.

Example:

`RenumberBuffer(0,10)` will change R2 to R12.

### H.1.67 Report

```
Report(Object|DrillReport|FoundPins|NetLength|AllNetLengths|[,name])
```

Produce various report.

**Object** The object under the crosshair will be reported, describing various aspects of the object.

**DrillReport**

A report summarizing the number of drill sizes used, and how many of each, will be produced.

**FoundPins**

A report listing all pins and pads which are marked as “found” will be produced.

**NetLength**

The name and length of the net under the crosshair will be reported to the message log.

**AllNetLengths**

The name and length of the net under the crosshair will be reported to the message log. An optional parameter specifies mm, mil, pcb, or in units

### H.1.68 ReportDialog

```
ReportDialog()
```

Report on the object under the crosshair

This is a shortcut for `Report(Object)`.

### H.1.69 RipUp

```
RipUp(All|Selected|Element)
```

Ripup auto-routed tracks, or convert an element to parts.

**All** Removes all lines and vias which were created by the autorouter.

**Selected** Removes all selected lines and vias which were created by the autorouter.

**Element** Converts the element under the cursor to parts (vias and lines). Note that this uses the highest numbered paste buffer.

### H.1.70 RouteStyle

```
RouteStyle(1|2|3|4)
```

Copies the indicated routing style into the current sizes.



### H.1.71 SaveSettings

```
SaveSettings()
SaveSettings(local)
```

Saves settings.

If you pass no arguments, the settings are stored in `$HOME/.pcb/settings`. If you pass the word `local` they're saved in `./pcb.settings`.

### H.1.72 SaveTo

```
SaveTo(Layout | LayoutAs,filename)
SaveTo(AllConnections | AllUnusedPins | ElementConnections,filename)
SaveTo(PasteBuffer,filename)
```

Saves data to a file.

**Layout** Saves the current layout.

**LayoutAs** Saves the current layout, and remembers the filename used.

**AllConnections**  
Save all connections to a file.

**AllUnusedPins**  
List all unused pins to a file.

**ElementConnections**  
Save connections to the element at the cursor to a file.

**PasteBuffer**  
Save the content of the active Buffer to a file. This is the graphical way to create a footprint.

### H.1.73 Select

```
Select(Object | ToggleObject)
Select(All | Block | Connection | BuriedVias)
Select(ElementByName | ObjectByName | PadByName | PinByName)
Select(ElementByName | ObjectByName | PadByName | PinByName, Name)
Select(TextByName | ViaByName | NetByName)
Select(TextByName | ViaByName | NetByName, Name)
Select(Convert)
```

Toggles or sets the selection.

ElementByName  
 ObjectByName  
 PadByName  
 PinByName  
 TextByName  
 ViaByName  
 NetByName

These all rely on having a regular expression parser built into `pcb`. If the name is not specified then the user is prompted for a pattern, and all objects that match the pattern and are of the type specified are selected.

Object

ToggleObject

Selects the object under the cursor.

Block      Selects all objects in a rectangle indicated by the cursor.

All         Selects all objects on the board.

Found      Selects all connections with the “found” flag set.

Connection

Selects all connections with the “connected” flag set.

Connection

Selects all blind and buried vias.

Convert    Converts the selected objects to an element. This uses the highest numbered paste buffer.

### H.1.74 SetFlag

```

SetFlag(Object | Selected | SelectedObjects, flag)
SetFlag(SelectedLines | SelectedPins | SelectedVias, flag)
SetFlag(SelectedPads | SelectedTexts | SelectedNames, flag)
SetFlag(SelectedElements, flag)
flag = square | octagon | thermal | join

```

Sets flags on objects.

Turns the given flag on, regardless of its previous setting. See `ChangeFlag`.

```
SetFlag(SelectedPins, thermal)
```

### H.1.75 SetLayertype

```
SetLayertype(layer, type)
```

Sets the type of a layer. Type can be given by name or by number. For a list of available types, run `ListLayertypes()`.

Layers can have various types, like *copper*, *silk* or *outline*. Behaviour of GUI and exporters largely depend on these types. For example, searching for electrical connections searches only layers of type *copper*, all other layers are ignored.

For a list of available types see see [Section H.1.41 \[ListLayertypes Action\]](#), page 134.

### H.1.76 SetOctagon

```
SetOctagon(Object | ToggleObject | SelectedElements | Selected)
```

Sets the octagon-flag of objects.

Pins, pads, and vias can have various shapes. All may be round. Pins and pads may be square (obviously "square" pads are usually rectangular). Pins and vias may be octagonal. When you change a shape flag of an element, you actually change all of its pins and pads.

Note that the square flag takes precedence over the octagon flag, thus, if both the square and octagon flags are set, the object is square. When the square flag is cleared, the pins and pads will be either round or, if the octagon flag is set, octagonal.

### H.1.77 SetSame

```
SetSame()
```

Sets current layer and sizes to match indicated item.

When invoked over any line, arc, polygon, or via, this changes the current layer to be the layer that item is on, and changes the current sizes (thickness, keepaway, drill, etc) according to that item.

### H.1.78 SetSquare

```
SetSquare(ToggleObject | SelectedElements | SelectedPins)
```

sets the square-flag of objects.

Note that Pins means pins and pads.

Pins, pads, and vias can have various shapes. All may be round. Pins and pads may be square (obviously "square" pads are usually rectangular). Pins and vias may be octagonal. When you change a shape flag of an element, you actually change all of its pins and pads.

Note that the square flag takes precedence over the octagon flag, thus, if both the square and octagon flags are set, the object is square. When the square flag is cleared, the pins and pads will be either round or, if the octagon flag is set, octagonal.

### H.1.79 SetThermal

```
SetThermal(Object | SelectedPins | SelectedVias | Selected, Style)
```

Set the thermal (on the current layer) of pins or vias to the given style. Style = 0 means no thermal. Style = 1 has diagonal fingers with sharp edges. Style = 2 has horizontal and

vertical fingers with sharp edges. Style = 3 is a solid connection to the plane. Style = 4 has diagonal fingers with rounded edges. Style = 5 has horizontal and vertical fingers with rounded edges.

This changes how/whether pins or vias connect to any rectangle or polygon on the current layer. The first argument can specify one object, or all selected pins, or all selected vias, or all selected pins and vias. The second argument specifies the style of connection. There are 5 possibilities: 0 - no connection, 1 - 45 degree fingers with sharp edges, 2 - horizontal & vertical fingers with sharp edges, 3 - solid connection, 4 - 45 degree fingers with rounded corners, 5 - horizontal & vertical fingers with rounded corners.

Pins and Vias may have thermals whether or not there is a polygon available to connect with. However, they will have no effect without the polygon.

### H.1.80 SetupRouteStyle

Sets the parameters of a route style.

TODO: Doesn't currently update the GUI widgets.

### H.1.81 SetValue

```
SetValue(Grid|Line|LineSize|Text|TextScale|ViaDrillingHole|Via|ViaSize, delta)
```

Change various board-wide values and sizes.

**ViaDrillingHole**

Changes the diameter of the drill for new vias.

**Grid**

Sets the grid spacing.

**Line**

**LineSize** Changes the thickness of new lines.

**Via**

**ViaSize** Changes the diameter of new vias.

**Text**

**TextScale**

Changes the size of new text.

### H.1.82 setvialayers

```
SetViaLayers(Object|SelectedVias|Selected[,ThroughHole|TH])
SetViaLayers(Object|SelectedVias|Selected,from,to)
SetViaLayers(Object|SelectedVias|Selected,[c|-|from],[c|-|to]));
```

Sets starting and ending layer for burried/blind/standard vias.

Specifies layers, which are connected by via.

**TH|ThroughHole**

The vias will be set as through-hole, connecting all layers

**from** layer name or layer number of the first layer to be connected by via; "-" stands for unchanged, "c" stands for currently selected layer

**to** layer name or layer number of the last layer to be connected by via; "-" stands for unchanged, "c" stands for currently selected layer

If no parameter is used, dialog is displayed (if implemented in the respective GUI HID).

### H.1.83 SmartDisperse

```
SmartDisperse([All|Selected])
```

Setup the routing style using the given parameters. Parameters can be either a style string, or the values themselves.

The `SmartDisperse([All|Selected])` action is a special-purpose optimization for dispersing elements.

Run with `:SmartDisperse()` or `:SmartDisperse(Selected)` (you can also say `:SmartDisperse(All)`, but that's the default).

### H.1.84 Teardrops

The `Teardrops()` action adds teardrops to the intersections between traces and pins/vias.

This is a simplistic test, so there are cases where you'd think it would add them but doesn't.

If the trace doesn't end at *exactly* the same point as the pin/via, it will be skipped.

This often happens with metric parts on an Imperial grid or visa-versa.

If a trace passes through a pin/via but doesn't end there, there won't be any teardrops.

Use `:djopt(none)` to split those lines into two segments, each of which ends at the pin/via.


Usage:

This action takes no parameters.

To invoke it, use the command window, usually by typing ":".

Example:

```
:Teardrops()
```

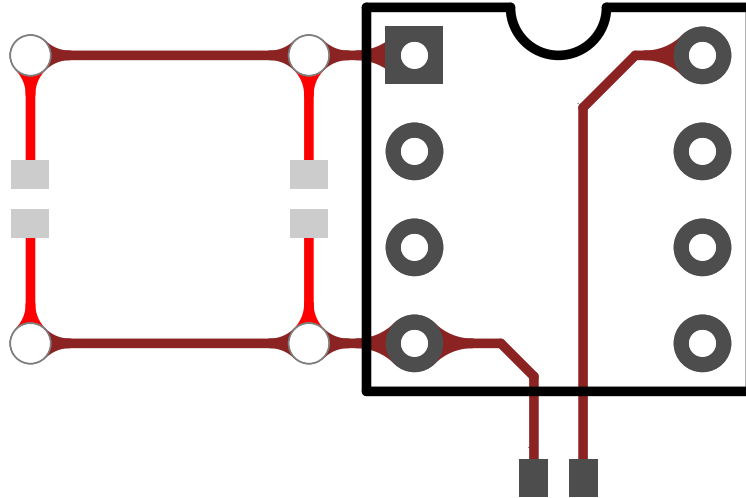

With the lesstif HID you can add this action to your menu or a hotkey by editing `$HOME/.pcb/pcb-menu.res` (grab a copy from the pcb source if you haven't one there yet).

Known Bugs:

Square pins are teardropped too.

Refdes silk is no longer visible.

### H.1.85 ToggleHideName

```
ToggleHideName(Object|SelectedElements)
```

Toggles the visibility of element names.

If names are hidden you won't see them on the screen and they will not appear on the silk layer when you print the layout.

### H.1.86 ToggleVendor

```
ToggleVendor()
```

Toggles the state of automatic drill size mapping.

When drill mapping is enabled, new instances of pins and vias will have their drill holes mapped to one of the allowed drill sizes specified in the currently loaded vendor drill table. To enable drill mapping, a vendor resource file containing a drill table must be loaded first.

### H.1.87 Undo

```
Undo()
Undo(ClearList)
```

Undo recent changes.

The unlimited undo feature of Pcb allows you to recover from most operations that materially affect you work. Calling `Undo()` without any parameter recovers from the last

(non-undo) operation. `ClearList` is used to release the allocated memory. `ClearList` is called whenever a new layout is started or loaded. See also `Redo` and `Atomic`.

Note that undo groups operations by serial number; changes with the same serial number will be undone (or redone) as a group. See `Atomic`.

### H.1.88 UnloadVendor

```
UnloadVendor()
```

Unloads the current vendor drill mapping table.

### H.1.89 Unselect

```
Unselect(All|Block|Connection)
Unselect(ElementByName|ObjectByName|PadByName|PinByName)
Unselect(ElementByName|ObjectByName|PadByName|PinByName, Name)
Unselect(TextByName|ViaByName)
Unselect(TextByName|ViaByName, Name)
```

Unselects the object at the pointer location or the specified objects.

**All** Unselect all objects.

**Block** Unselect all objects in a rectangle given by the cursor.

**Connection**  
Unselect all connections with the “found” flag set.

**ElementByName**

**ObjectByName**

**PadByName**

**PinByName**

**TextByName**

**ViaByName**

These all rely on having a regular expression parser built into `pcb`. If the name is not specified then the user is prompted for a pattern, and all objects that match the pattern and are of the type specified are unselected.

## H.2 common actions

### H.2.1 LayersChanged

```
LayersChanged()
```

Tells the GUI that the layers have changed.

This includes layer names, colors, stacking order, visibility, etc.

This is one of a number of actions which are part of the HID interface. The core functions use these actions to tell the current GUI when to change the presented information in response to changes that the GUI may not know about. The user normally does not invoke these directly.

### H.2.2 LibraryChanged

```
LibraryChanged()
```

Tells the GUI that the libraries have changed.

This is one of a number of actions which are part of the HID interface. The core functions use these actions to tell the current GUI when to change the presented information in response to changes that the GUI may not know about. The user normally does not invoke these directly.

### H.2.3 NetlistChanged

```
NetlistChanged()
```

Tells the GUI that the netlist has changed.

This is one of a number of actions which are part of the HID interface. The core functions use these actions to tell the current GUI when to change the presented information in response to changes that the GUI may not know about. The user normally does not invoke these directly.

### H.2.4 PCBChanged

```
PCBChanged([revert])
```

Tells the GUI that the whole PCB has changed. The optional "revert" parameter can be used as a hint to the GUI that the same design is being reloaded, and that it might keep some viewport settings

This is one of a number of actions which are part of the HID interface. The core functions use these actions to tell the current GUI when to change the presented information in response to changes that the GUI may not know about. The user normally does not invoke these directly.

### H.2.5 RouteStylesChanged

```
RouteStylesChanged()
```

Tells the GUI that the routing styles have changed.

This is one of a number of actions which are part of the HID interface. The core functions use these actions to tell the current GUI when to change the presented information in



response to changes that the GUI may not know about. The user normally does not invoke these directly.

## H.3 gtk actions

### H.3.1 gtk About

About()

Tell the user about this version of PCB.

This just pops up an about dialog telling the user which version of `pcb` they're running.

### H.3.2 gtk AdjustStyle

AdjustStyle()

Open the window which allows editing of the route styles.

Opens the window which allows editing of the route styles.

### H.3.3 gtk Benchmark

Benchmark()

Report the amount of redraws per second.

This action is invoked by typing `Benchmark()` in the command entry dialog.

This action reports the number of redraws per second on the command line interface.

### H.3.4 gtk Busy

Busy()

Show a busy cursor.

This action is invoked by the program when there is a waiting state for the user.

This action shows a "watch" like cursor graphic to indicate the `pcb` program is chewing on a task taking significant time.

The cursor graphic is reset when the task is finished.

When invoked by the user from the command entry window (no program task running) the cursor graphic is reset when the user enters a coordinate (left mouse button click).

### H.3.5 gtk Center

Center()

Moves the pointer to the center of the window.

Move the pointer to the center of the window, but only if it's currently within the window already.

### H.3.6 gtk Command

Command()

Displays the command line input window.

The command window allows the user to manually enter actions to be executed. Action syntax can be done one of two ways:

- Follow the action name by an open parenthesis, arguments separated by commas, end with a close parenthesis. Example:

`Abc(1,2,3)`

- Separate the action name and arguments by spaces. Example:

`Abc 1 2 3`

The first option allows you to have arguments with spaces in them, but the second is more “natural” to type for most people.

Note that action names are not case sensitive, but arguments normally are. However, most actions will check for “keywords” in a case insensitive way.

`Esc` closes the command window if pressed while the command window has focus. If you press the `Esc` key, the window goes away without invoking anything, and the next time you bring up the command window it resumes entering the command you were entering before.

### H.3.7 gtk Cursor

Cursor(Type,DeltaUp,DeltaRight,Units)

Move the cursor.

This action moves the mouse cursor. Unlike other actions which take coordinates, this action's coordinates are always relative to the user's view of the board. Thus, a positive *DeltaUp* may move the cursor towards the board origin if the board is inverted.

Type is one of `'Pan'` or `'Warp'`. `'Pan'` causes the viewport to move such that the crosshair is under the mouse cursor. `'Warp'` causes the mouse cursor to move to be above the crosshair.

*Units* can be one of the following:

`'mil'`

`'mm'`

The cursor is moved by that amount, in board units.

- 'grid'      The cursor is moved by that many grid points.
- 'view'      The values are percentages of the viewport's view. Thus, a pan of '100' would scroll the viewport by exactly the width of the current view.
- 'board'     The values are percentages of the board size. Thus, a move of '50,50' moves you halfway across the board.

### H.3.8 gtk DoWindows

```
DoWindows(1|2|3|4|5|6)
DoWindows(Layout|Library|Log|Netlist|Preferences|DRC)
```

Open various GUI windows.

- 1  
Layout      Open the layout window. Since the layout window is always shown anyway, this has no effect.
- 2  
Library     Open the library window.
- 3  
Log         Open the log window.
- 4  
Netlist     Open the netlist window.
- 5  
Preferences      Open the preferences window.
- 6  
DRC         Open the DRC violations window.

### H.3.9 gtk EditLayerGroups

```
EditLayerGroups()
```

Open the preferences window which allows editing of the layer groups.

Opens the preferences window which is where the layer groups are edited. This action is primarily provides to provide menu resource compatibility with the lesstif HID.

### H.3.10 gtk Export

```
Export()
```

Open the Export dialog window.

This action is invoked by typing `Export()` in the command entry dialog. This action opens the Export dialog window.

### H.3.11 gtk GetXY

```
GetXY()
```

Get a coordinate.

Prompts the user for a coordinate, if one is not already selected.

### H.3.12 gtk ImportGUI

```
ImportGUI()
```

Asks user which schematics to import into PCB.

Asks user which schematics to import into PCB.

### H.3.13 gtk Load

```
Load(Layout | LayoutToBuffer | ElementToBuffer | Netlist | Revert,filename)
```

Load layout data from a user-selected file.

This action is invoked by typing `Load()` in the command entry dialog. This action is a GUI front-end to the core's `LoadFrom` action (see [Section H.1.43 \[LoadFrom Action\]](#), page 134). If you happen to pass a filename, like `LoadFrom`, then `LoadFrom` is called directly. Else this action opens a file chooser dialog window. The user is to select a filename to load, and then that layout file is loaded into pcb.

### H.3.14 gtk Pan

```
Pan([thumb], Mode)
```

Start or stop panning (Mode = 1 to start, 0 to stop) Optional thumb argument is ignored for now in gtk hid.

Start or stop panning. To start call with Mode = 1, to stop call with Mode = 0.

### H.3.15 gtk Popup

```
Popup(MenuName, [Button])
```

Bring up the popup menu specified by `MenuName`. If called by a mouse event then the mouse button number must be specified as the optional second argument.

This just pops up the specified menu. The menu must have been defined as a named subresource of the Popups resource in the menu resource file. The second, optional (and ignored) argument represents the mouse button number which is triggering the popup.

### H.3.16 gtk Print

```
Print()
```

Print the layout.

This will find the default printing HID, prompt the user for its options, and print the layout.

### H.3.17 gtk PrintCalibrate

```
PrintCalibrate()
```

Calibrate the printer.

This will print a calibration page, which you would measure and type the measurements in, so that future printouts will be more precise.

### H.3.18 gtk Save

```
Save()
Save(Layout|LayoutAs)
Save(AllConnections|AllUnusedPins|ElementConnections)
Save(PasteBuffer)
```

Save layout and/or element data to a user-selected file.

This action is a GUI front-end to the core's `SaveTo` action (see [Section H.1.72 \[SaveTo Action\]](#), page 143). If you happen to pass a filename, like `SaveTo`, then `SaveTo` is called directly. Else, the user is prompted for a filename to save, and then `SaveTo` is called with that filename.

### H.3.19 gtk SelectLayer

```
SelectLayer(1..MAXLAYER|Silk|Rats)
```

Select which layer is the current layer.

The specified layer becomes the currently active layer. It is made visible if it is not already visible

### H.3.20 gtk SetUnits

```
SetUnits(mm|mil)
```

Set the default measurement units.

`mil` Sets the display units to mils (1/1000 inch).

`mm` Sets the display units to millimeters.

### H.3.21 `gtk SwapSides`

```
SwapSides(|v|h|r)
```

Swaps the side of the board you're looking at.

This action changes the way you view the board.

`v` Flips the board over vertically (up/down).

`h` Flips the board over horizontally (left/right), like flipping pages in a book.

`r` Rotates the board 180 degrees without changing sides.

If no argument is given, the board isn't moved but the opposite side is shown.

Normally, this action changes which pads and silk layer are drawn as true silk, and which are drawn as the "invisible" layer. It also determines which solder mask you see.

As a special case, if the layer group for the side you're looking at is visible and currently active, and the layer group for the opposite is not visible (i.e. disabled), then this action will also swap which layer group is visible and active, effectively swapping the "working side" of the board.

### H.3.22 `gtk ToggleView`

```
ToggleView(1..MAXLAYER)
ToggleView(layername)
ToggleView(Silk|Rats|Pins|Vias|Mask|BackSide)
```

Toggle the visibility of the specified layer or layer group.

If you pass an integer, that layer is specified by index (the first layer is 1, etc). If you pass a layer name, that layer is specified by name. When a layer is specified, the visibility of the layer group containing that layer is toggled.

If you pass a special layer name, the visibility of those components (silk, rats, etc) is toggled. Note that if you have a layer named the same as a special layer, the layer is chosen over the special layer.

### H.3.23 `gtk Zoom`

```
Zoom()
Zoom(factor)
```

Various zoom factor changes. Changes the zoom (magnification) of the view of the board. If no arguments are passed, the view is scaled such that the board just fits inside

the visible window (i.e. “view all”). Otherwise, *factor* specifies a change in zoom factor. It may be prefixed by +, -, or = to change how the zoom factor is modified. The *factor* is a floating point number, such as 1.5 or 0.75.

**+factor** Values greater than 1.0 cause the board to be drawn smaller; more of the board will be visible. Values between 0.0 and 1.0 cause the board to be drawn bigger; less of the board will be visible.

**-factor** Values greater than 1.0 cause the board to be drawn bigger; less of the board will be visible. Values between 0.0 and 1.0 cause the board to be drawn smaller; more of the board will be visible.

**=factor**

The *factor* is an absolute zoom factor; the unit for this value is "PCB units per screen pixel". Since PCB units are 0.01 mil, a *factor* of 1000 means 10 mils (0.01 in) per pixel, or 100 DPI, about the actual resolution of most screens - resulting in an "actual size" board. Similarly, a *factor* of 100 gives you a 10x actual size.

Note that zoom factors of zero are silently ignored.

## H.4 lesstif actions

### H.4.1 lesstif About

About()

Tell the user about this version of PCB.

This just pops up a dialog telling the user which version of `pcb` they're running.

### H.4.2 lesstif AdjustSizes

AdjustSizes()

Let the user change the board size, DRC parameters, etc

Displays a dialog box that lets the user change the board size, DRC parameters, and text scale.

The units are determined by the default display units.

### H.4.3 lesstif AdjustStyle

AdjustStyle()

Displays the route style adjustment window.

#### H.4.4 lesstif Benchmark

Benchmark()

Benchmark the GUI speed.

This action is used to speed-test the Lesstif graphics subsystem. It redraws the current screen as many times as possible in ten seconds. It reports the amount of time needed to draw the screen once.

#### H.4.5 lesstif Command

Command()

Displays the command line input window.

The command window allows the user to manually enter actions to be executed. Action syntax can be done one of two ways:

- Follow the action name by an open parenthesis, arguments separated by commas, end with a close parenthesis. Example:

`Abc(1,2,3)`

- Separate the action name and arguments by spaces. Example:

`Abc 1 2 3`

The first option allows you to have arguments with spaces in them, but the second is more “natural” to type for most people.

Note that action names are not case sensitive, but arguments normally are. However, most actions will check for “keywords” in a case insensitive way.

There are three ways to finish with the command window. If you press the **Enter** key, the command is invoked, the window goes away, and the next time you bring up the command window it’s empty. If you press the **Esc** key, the window goes away without invoking anything, and the next time you bring up the command window it’s empty. If you change focus away from the command window (i.e. click on some other window), the command window goes away but the next time you bring it up it resumes entering the command you were entering before.

#### H.4.6 lesstif Cursor

Cursor(Type,DeltaUp,DeltaRight,Units)

Move the cursor.

This action moves the mouse cursor. Unlike other actions which take coordinates, this action’s coordinates are always relative to the user’s view of the board. Thus, a positive *DeltaUp* may move the cursor towards the board origin if the board is inverted.

Type is one of ‘Pan’ or ‘Warp’. ‘Pan’ causes the viewport to move such that the crosshair is under the mouse cursor. ‘Warp’ causes the mouse cursor to move to be above the crosshair.

*Units* can be one of the following:



|                      |                                                                                                                                                          |
|----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------|
| <code>'mil'</code>   |                                                                                                                                                          |
| <code>'mm'</code>    | The cursor is moved by that amount, in board units.                                                                                                      |
| <code>'grid'</code>  | The cursor is moved by that many grid points.                                                                                                            |
| <code>'view'</code>  | The values are percentages of the viewport's view. Thus, a pan of <code>'100'</code> would scroll the viewport by exactly the width of the current view. |
| <code>'board'</code> | The values are percentages of the board size. Thus, a move of <code>'50,50'</code> moves you halfway across the board.                                   |

#### H.4.7 lesstif Debug

Debug(...)

Debug action.

This action exists to help debug scripts; it simply prints all its arguments to stdout.

#### H.4.8 lesstif DebugXY

DebugXY(...)

Debug action, with coordinates

Like `Debug`, but requires a coordinate. If the user hasn't yet indicated a location on the board, the user will be prompted to click on one.

#### H.4.9 lesstif DoWindows

DoWindows(1|2|3|4)  
DoWindows(Layout|Library|Log|Netlist)

Open various GUI windows.

|         |                                                                                             |
|---------|---------------------------------------------------------------------------------------------|
| 1       |                                                                                             |
| Layout  | Open the layout window. Since the layout window is always shown anyway, this has no effect. |
| 2       |                                                                                             |
| Library | Open the library window.                                                                    |
| 3       |                                                                                             |
| Log     | Open the log window.                                                                        |
| 4       |                                                                                             |
| Netlist | Open the netlist window.                                                                    |

#### H.4.10 lesstif DumpKeys

DumpKeys()

Dump Lesstif key bindings.

Causes the list of key bindings (from `pcb-menu.res`) to be dumped to stdout. This is most useful when invoked from the command line like this:

```
pcb --action-string DumpKeys
```

#### H.4.11 lesstif EditLayerGroups

EditLayerGroups()

Let the user change the layer groupings

Displays a dialog that lets the user view and change the layer groupings. Each layer (row) can be a member of any one layer group (column). Note the special layers `solder` and `component` allow you to specify which groups represent the top and bottom of the board.

See [Section H.1.12 \[ChangeName Action\]](#), page 122.

#### H.4.12 lesstif Export

Export()

Export the layout.

Prompts the user for an exporter to use. Then, prompts the user for that exporter's options, and exports the layout.

#### H.4.13 lesstif GetXY

GetXY()

Get a coordinate.

Prompts the user for a coordinate, if one is not already selected.

#### H.4.14 lesstif ImportGUI

ImportGUI()

Lets the user choose the schematics to import from

Displays a dialog that lets the user select the schematic(s) to import from, then saves that information in the layout's attributes for future imports.

#### H.4.15 lesstif LibraryShow

LibraryShow()

Displays the library window.

### H.4.16 lesstif Load

```
Load()
Load(Layout | LayoutToBuffer | ElementToBuffer | Netlist | Revert)
```

Load layout data from a user-selected file.

This action is a GUI front-end to the core's `LoadFrom` action (see [Section H.1.43 \[LoadFrom Action\]](#), page 134). If you happen to pass a filename, like `LoadFrom`, then `LoadFrom` is called directly. Else, the user is prompted for a filename to load, and then `LoadFrom` is called with that filename.

### H.4.17 lesstif LoadVendor

```
LoadVendor()
```

Loads a user-selected vendor resource file.

The user is prompted for a file to load, and then `LoadVendorFrom` is called (see [Section H.1.44 \[LoadVendorFrom Action\]](#), page 134) to load that vendor file.

### H.4.18 lesstif NetlistShow

```
NetlistShow(pinname | netname)
```

Selects the given pinname or netname in the netlist window.

### H.4.19 lesstif Print

```
Print()
```

Print the layout.

This will find the default printing HID, prompt the user for its options, and print the layout.

### H.4.20 lesstif PrintCalibrate

```
PrintCalibrate()
```

Calibrate the printer.

This will print a calibration page, which you would measure and type the measurements in, so that future printouts will be more precise.

### H.4.21 lesstif PromptFor

```
PromptFor([message[,default]])
```

Prompt for a response.

This is mostly for testing the lesstif HID interface. The parameters are passed to the `prompt_for()` HID function, causing the user to be prompted for a response. The response is simply printed to the user's stdout.

#### H.4.22 lesstif Return

```
Return(0|1)
```

Simulate a passing or failing action.

This is for testing. If passed a 0, does nothing and succeeds. If passed a 1, does nothing but pretends to fail.

#### H.4.23 lesstif Save

```
Save()
Save(Layout|LayoutAs)
Save(AllConnections|AllUnusedPins|ElementConnections)
Save(PasteBuffer)
```

Save layout data to a user-selected file.

This action is a GUI front-end to the core's `SaveTo` action (see [Section H.1.72 \[SaveTo Action\]](#), page 143). If you happen to pass a filename, like `SaveTo`, then `SaveTo` is called directly. Else, the user is prompted for a filename to save, and then `SaveTo` is called with that filename.

#### H.4.24 lesstif SelectLayer

```
SelectLayer(1..MAXLAYER|Silk|Rats)
```

Select which layer is the current layer.

The specified layer becomes the currently active layer. It is made visible if it is not already visible

#### H.4.25 lesstif SetUnits

```
SetUnits(mm|mil)
```

Set the default measurement units.

`mil`        Sets the display units to mils (1/1000 inch).

`mm`         Sets the display units to millimeters.

### H.4.26 lesstif SwapSides

```
SwapSides(|v|h|r)
```

Swaps the side of the board you're looking at.

This action changes the way you view the board.

- v Flips the board over vertically (up/down).
- h Flips the board over horizontally (left/right), like flipping pages in a book.
- r Rotates the board 180 degrees without changing sides.

If no argument is given, the board isn't moved but the opposite side is shown.

Normally, this action changes which pads and silk layer are drawn as true silk, and which are drawn as the "invisible" layer. It also determines which solder mask you see.

As a special case, if the layer group for the side you're looking at is visible and currently active, and the layer group for the opposite is not visible (i.e. disabled), then this action will also swap which layer group is visible and active, effectively swapping the "working side" of the board.

### H.4.27 lesstif ToggleView

```
ToggleView(1..MAXLAYER)
ToggleView(layername)
ToggleView(Silk|Rats|Pins|Vias|Mask|BackSide)
```

Toggle the visibility of the specified layer or layer group.

If you pass an integer, that layer is specified by index (the first layer is 1, etc). If you pass a layer name, that layer is specified by name. When a layer is specified, the visibility of the layer group containing that layer is toggled.

If you pass a special layer name, the visibility of those components (silk, rats, etc) is toggled. Note that if you have a layer named the same as a special layer, the layer is chosen over the special layer.

### H.4.28 lesstif Zoom

```
Zoom()
Zoom(factor)
```

Various zoom factor changes.

Changes the zoom (magnification) of the view of the board. If no arguments are passed, the view is scaled such that the board just fits inside the visible window (i.e. "view all"). Otherwise, *factor* specifies a change in zoom factor. It may be prefixed by +, -, or = to change how the zoom factor is modified. The *factor* is a floating point number, such as 1.5 or 0.75.

**+factor** Values greater than 1.0 cause the board to be drawn smaller; more of the board will be visible. Values between 0.0 and 1.0 cause the board to be drawn bigger; less of the board will be visible.

**-factor** Values greater than 1.0 cause the board to be drawn bigger; less of the board will be visible. Values between 0.0 and 1.0 cause the board to be drawn smaller; more of the board will be visible.

**=factor**

The *factor* is an absolute zoom factor; the unit for this value is "PCB units per screen pixel". Since PCB units are 0.01 mil, a *factor* of 1000 means 10 mils (0.01 in) per pixel, or 100 DPI, about the actual resolution of most screens - resulting in an "actual size" board. Similarly, a *factor* of 100 gives you a 10x actual size.

Note that zoom factors of zero are silently ignored.

## Appendix I Glossary


**Footprint** The pattern of metal, silkscreen, soldermask relief, and drills which defines where you place a component on a circuit board. Footprints are placed by the user onto the PCB during the placement phase of PCB layout.

**Gerber File**

The file format used in the industry to convey a board database to the manufacturer is RS-274X (which replaces the now obsolete RS-274D format). This file format was originally developed by Gerber for their photo plotters and thus RS-274D and RS-274X format files are often times referred to as “Gerber” files.

**Thermal, Thermal Relief**

A thermal relief is a way of connecting a pin to a ground or power plane. Instead of directly connecting to the plane, small "spokes" are used to increase the thermal resistance between the pin and the plane. Often times these connections are referred to as simply a thermal. By increasing the thermal resistance to the plane, it becomes easier to solder to the pin. In the drawing below, the pin on the left is connected to the polygon using a solid connection with no thermal relief, the middle pin is connected using a thermal, while the pin on the right has no connection to the polygon. In Pcb, the “Thermal” Tool is used to make both a solid connection and one with thermal relief (see [Section 2.8 \[Polygon Objects\]](#), page 9).

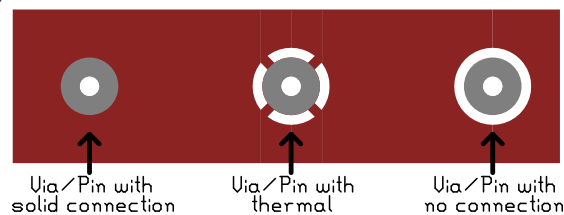

## Index of Resources

### A

|                         |    |
|-------------------------|----|
| absoluteGrid .....      | 53 |
| alignmentDistance ..... | 53 |
| allDirectionLines ..... | 53 |

### B

|                       |     |
|-----------------------|-----|
| backgroundImage ..... | 53  |
| backupInterval .....  | 53  |
| bloat .....           | 53  |
| BTNMOD .....          | 103 |

### C

|                       |    |
|-----------------------|----|
| connectedColor .....  | 53 |
| cross hairColor ..... | 54 |

### D

|                      |     |
|----------------------|-----|
| DEFAULTFONT .....    | 103 |
| DEFAULTLIBRARY ..... | 103 |

### E

|                              |        |
|------------------------------|--------|
| Element Search .....         | 109    |
| elementColor .....           | 54     |
| elementCommand .....         | 54, 71 |
| elementContentsCommand ..... | 56     |
| elementPath .....            | 54     |
| elementSelectedColor .....   | 54     |
| Exporting a layout .....     | 27     |

### F

|                   |        |
|-------------------|--------|
| fileCommand ..... | 54, 71 |
| filePath .....    | 54     |
| fontCommand ..... | 54, 71 |
| fontFile .....    | 55     |
| fontPath .....    | 55     |

### G

|                 |     |
|-----------------|-----|
| GNUM4 .....     | 103 |
| grid .....      | 55  |
| gridColor ..... | 55  |

### I

|                             |     |
|-----------------------------|-----|
| INFOLIBDIR .....            | 103 |
| invisibleObjectsColor ..... | 55  |

### L

|                  |    |
|------------------|----|
| layerColor ..... | 55 |
|------------------|----|

|                              |        |
|------------------------------|--------|
| layerGroups .....            | 55     |
| layerName .....              | 55     |
| layerSelectedColor .....     | 55     |
| libraryCommand .....         | 55, 71 |
| libraryContentsCommand ..... | 71     |
| libraryFilename .....        | 56     |
| libraryPath .....            | 56     |
| lineThickness .....          | 56     |

### M

|                           |    |
|---------------------------|----|
| Measuring distances ..... | 34 |
| media .....               | 56 |

### O

|                     |    |
|---------------------|----|
| offLimitColor ..... | 56 |
|---------------------|----|

### P

|                         |     |
|-------------------------|-----|
| PCBLIBDIR .....         | 103 |
| pinColor .....          | 56  |
| pinoutFont0..6 .....    | 56  |
| pinoutNameLength .....  | 56  |
| pinoutOffsetX .....     | 56  |
| pinoutOffsetY .....     | 56  |
| pinoutTextOffsetX ..... | 57  |
| pinoutTextOffsetY ..... | 57  |
| pinoutZoom .....        | 57  |
| pinSelectedColor .....  | 56  |
| printCommand .....      | 57  |

### R

|                            |     |
|----------------------------|-----|
| raiseLogWindow .....       | 57  |
| ratCommand .....           | 57  |
| ratPath .....              | 57  |
| Regular Expressions .....  | 109 |
| resetAfterElement .....    | 57  |
| ringBellWhenFinished ..... | 57  |
| routeStyle .....           | 57  |
| rubberBandMode .....       | 57  |

### S

|                              |        |
|------------------------------|--------|
| saveCommand .....            | 57, 71 |
| saveInTMP .....              | 58     |
| saveLastCommand .....        | 58     |
| Searching for elements ..... | 34     |
| shrink .....                 | 58     |
| size .....                   | 58     |
| stipplePolygons .....        | 58     |



**T**

textScale ..... 58

**U**

useLogWindow ..... 58

**V**

viaColor ..... 58

viaDrillingHole ..... 58

viaSelectedColor ..... 58

viaThickness ..... 58

volume ..... 59

**W**

warnColor ..... 59

**Z**

zoom ..... 59

## Index of Actions, Commands and Options

|                                         |        |                                           |    |
|-----------------------------------------|--------|-------------------------------------------|----|
| -                                       |        |                                           |    |
| --basename <string> .....               | 51     | --format <string> .....                   | 50 |
| --action-script <string> .....          | 40     | --found-color <string> .....              | 43 |
| --action-string <string> .....          | 40     | --full-poly .....                         | 41 |
| --advanced-gcode .....                  | 48     | --gerberfile <string> .....               | 48 |
| --align-marks .....                     | 49     | --grid <num> .....                        | 45 |
| --alignment-distance <num> .....        | 45     | --grid-color <string> .....               | 43 |
| --all-direction-lines .....             | 42     | --grid-increment-mil <string> .....       | 40 |
| --all-layers .....                      | 48     | --grid-increment-mm <string> .....        | 40 |
| --attrs <string> .....                  | 47     | --grid-units-mm <string> .....            | 39 |
| --auto-buried-vias .....                | 41     | --groups <string> .....                   | 40 |
| --auto-mirror .....                     | 49     | --help .....                              | 39 |
| --background-color <string> .....       | 42     | --invisible-mark-color <string> .....     | 43 |
| --backup-interval .....                 | 40     | --invisible-objects-color <string> .....  | 43 |
| --basename <string> .....               | 47, 51 | --iso-mill-depth <real> .....             | 47 |
| --bg-image <string> .....               | 42     | --iso-tool-diameter <real> .....          | 47 |
| --black-color <string> .....            | 42     | --iso-tool-feedrate <real> .....          | 48 |
| --bloat <num> .....                     | 46     | --iso-tool-plunge <real> .....            | 47 |
| --bomfile <string> .....                | 47     | --keepaway <num> .....                    | 45 |
| --clear-increment-mil <string> .....    | 40     | --layer-color-<n> <string> .....          | 43 |
| --clear-increment-mm <string> .....     | 40     | --layer-name-1 <string> .....             | 43 |
| --clear-line .....                      | 41     | --layer-name-2 <string> .....             | 44 |
| --connected-color <string> .....        | 43     | --layer-name-3 <string> .....             | 44 |
| --copper-height <num> .....             | 51     | --layer-name-4 <string> .....             | 44 |
| --copy-outline <string> .....           | 48     | --layer-name-5 <string> .....             | 44 |
| --copyright .....                       | 39     | --layer-name-6 <string> .....             | 44 |
| --cross-color <string> .....            | 42     | --layer-name-7 <string> .....             | 44 |
| --crosshair-color <string> .....        | 42     | --layer-name-8 <string> .....             | 44 |
| --default-font <string> .....           | 44     | --layer-selected-color-<n> <string> ..... | 43 |
| --default-PCB-height <num> .....        | 45     | --layer-stack <string> .....              | 41 |
| --default-PCB-width <num> .....         | 45     | --lib-command <string> .....              | 46 |
| --dpi .....                             | 50     | --lib-command-dir <string> .....          | 46 |
| --dpi <int> .....                       | 47     | --lib-contents-command <string> .....     | 46 |
| --dpi <num> .....                       | 51, 52 | --lib-name <string> .....                 | 44 |
| --draw-grid .....                       | 41     | --lib-newlib <string> .....               | 44 |
| --drill-copper .....                    | 50     | --lib-path <string> .....                 | 44 |
| --drill-depth <real> .....              | 48     | --line-increment-mil <string> .....       | 40 |
| --drill-feedrate <real> .....           | 48     | --line-increment-mm <string> .....        | 40 |
| --drill-helper .....                    | 49     | --line-thickness <num> .....              | 45 |
| --drill-mill .....                      | 48     | --listen .....                            | 42 |
| --dump-actions .....                    | 39     | --lprcommand <string> .....               | 52 |
| --element-color <string> .....          | 43     | --mask-color <string> .....               | 43 |
| --element-command <string> .....        | 46     | --measurement-unit <unit> .....           | 47 |
| --element-path <string> .....           | 40     | --media <media-name> .....                | 49 |
| --element-selected-color <string> ..... | 43     | --metric .....                            | 48 |
| --eps-file <string> .....               | 50     | --min-drill <num> .....                   | 47 |
| --eps-scale <num> .....                 | 50     | --min-ring <num> .....                    | 47 |
| --fab-author <string> .....             | 41     | --min-silk <num> .....                    | 46 |
| --file-command <string> .....           | 46     | --min-width <num> .....                   | 46 |
| --file-path <string> .....              | 44     | --minimum polygon area <num> .....        | 45 |
| --fill-holes .....                      | 50     | --mirror .....                            | 49 |
| --fill-page .....                       | 49     | --monochrome .....                        | 50 |
| --font-command <string> .....           | 46     | --multi-file .....                        | 49 |
| --font-path <string> .....              | 44     | --name-style <string> .....               | 49 |
|                                         |        | --netlist-file <string> .....             | 51 |

|                                      |    |                                        |         |
|--------------------------------------|----|----------------------------------------|---------|
| --off-limit-color <string> .....     | 43 | --verbose .....                        | 39, 48  |
| --only-visible .....                 | 50 | --version .....                        | 39      |
| --outfile <string> .....             | 50 | --via-color <string> .....             | 42      |
| --outline .....                      | 49 | --via-drilling-hole <num> .....        | 45      |
| --outline-mill-depth <real> .....    | 48 | --via-selected-color <string> .....    | 42      |
| --outline-mill-feedrate <real> ..... | 48 | --via-solder-mask-clerance <num> ..... | 45      |
| --outline-mill-plunge <real> .....   | 48 | --via-thickness <num> .....            | 45      |
| --outline-tool-diameter <real> ..... | 48 | --warn-color <string> .....            | 43      |
| --paste-adjust <num> .....           | 45 | --x-max .....                          | 50      |
| --pcb-menu <string> .....            | 42 | --xcalib <num> .....                   | 49      |
| --photo-flip-x .....                 | 51 | --xy-max .....                         | 50      |
| --photo-flip-y .....                 | 51 | --xy-unit <unit> .....                 | 47      |
| --photo-mask-colour <colour> .....   | 51 | --xyfile <string> .....                | 47      |
| --photo-mode .....                   | 51 | --y-max .....                          | 50      |
| --photo-plating <colour> .....       | 51 | --ycalib <num> .....                   | 49      |
| --photo-silk-colour <colour> .....   | 51 |                                        |         |
| --pin-color <string> .....           | 43 | <b>A</b>                               |         |
| --pin-name-color <string> .....      | 43 | AddRats() .....                        | 59      |
| --pin-selected-color <string> .....  | 43 | ApplyVendor() .....                    | 60, 120 |
| --pinout-offset-x <num> .....        | 41 | Atomic() .....                         | 60      |
| --pinout-offset-y <num> .....        | 41 |                                        |         |
| --pinout-text-offset-x <num> .....   | 41 | <b>B</b>                               |         |
| --pinout-text-offset-y <num> .....   | 41 | Bell() .....                           | 60      |
| --png-bloat <num><dim> .....         | 51 |                                        |         |
| --predrill .....                     | 48 | <b>C</b>                               |         |
| --print-file <string> .....          | 46 | ChangeClearSize() .....                | 60      |
| --ps-bloat <num> .....               | 49 | ChangeDrillSize() .....                | 60      |
| --ps-color .....                     | 49 | ChangeFlag() .....                     | 60      |
| --ps-invert .....                    | 49 | ChangeHole() .....                     | 61      |
| --psfade <num> .....                 | 49 | ChangeName() .....                     | 61      |
| --psfile <string> .....              | 49 | ChangeOctagon() .....                  | 61      |
| --rat-color <string> .....           | 43 | ChangePinName() .....                  | 61      |
| --rat-command <string> .....         | 46 | ChangeSize() .....                     | 61      |
| --rat-selected-color <string> .....  | 43 | ChangeSquare() .....                   | 61      |
| --rat-thickness <num><unit> .....    | 45 | ClrFlag() .....                        | 62      |
| --reset-after-element .....          | 41 | Command() .....                        | 62      |
| --ring-bell-finished .....           | 41 | Connection() .....                     | 62      |
| --route-styles <string> .....        | 40 |                                        |         |
| --safe-Z <real> .....                | 47 | <b>D</b>                               |         |
| --save-command <string> .....        | 46 | DeleteRats() .....                     | 62      |
| --save-in-tmp .....                  | 41 | DisableVendor() .....                  | 62, 125 |
| --save-last-command .....            | 41 | DisperseElements() .....               | 62      |
| --save-metric-only .....             | 41 | Display() .....                        | 62      |
| --scale <num> .....                  | 49 | DRC() .....                            | 63      |
| --screen-layer-order .....           | 50 |                                        |         |
| --show-actions .....                 | 39 | <b>E</b>                               |         |
| --show-defaults .....                | 39 | EditLayerGroups() .....                | 63      |
| --show-legend .....                  | 50 | EnableVendor() .....                   | 63, 131 |
| --show-number .....                  | 42 | ExecuteFile() .....                    | 63      |
| --shrink <num> .....                 | 46 |                                        |         |
| --size-increment-mil <string> .....  | 40 | <b>L</b>                               |         |
| --size-increment-mm <string> .....   | 40 | Load() .....                           | 64      |
| --snap-pin .....                     | 41 |                                        |         |
| --substrate-epsilon <num> .....      | 51 |                                        |         |
| --substrate-height <num> .....       | 51 |                                        |         |
| --text-scale <num> .....             | 45 |                                        |         |
| --unique-names .....                 | 41 |                                        |         |
| --use-alpha .....                    | 50 |                                        |         |

LoadVendor() ..... 64  
LoadVendorFrom() ..... 134

## M

MarkCrosshair() ..... 64  
Mode() ..... 64  
MovePointer() ..... 65  
MoveToCurrentLayer() ..... 65

## N

New() ..... 65

## P

PasteBuffer() ..... 65  
Polygon() ..... 66  
Print() ..... 66

## Q

Quit() ..... 66

## R

Redo() ..... 66  
RemoveSelected() ..... 67  
Report() ..... 67  
RouteStyle() ..... 67

## S

Save() ..... 67  
Select() ..... 67  
SetFlag() ..... 67  
SetValue() ..... 68  
SwapSides() ..... 68  
SwitchDrawingLayer() ..... 68

## T

ToggleHideName() ..... 68  
ToggleVendor() ..... 68, 148  
ToggleVisibility() ..... 68

## U

Undo() ..... 69  
UnloadVendor() ..... 69, 149  
Unselect() ..... 69

# Index of Concepts

- /
- /tmp ..... 25, 58
  
- A**
- action reference ..... 119
- actions ..... 59
- actions file, executing ..... 63
- align-marks ..... 49
- alignment ..... 53
- alignment targets ..... 26
- Alpha ..... 104
- annotation file format ..... 117
- arc ..... 9
- arc, an example ..... 21
- architecture ..... 104, 105
- arrow tool ..... 31
- ASCII files, format of ..... 71
- Atari version ..... 1
- atomic ..... 60
- auto-router ..... 14
- autorouter ..... 36
  
- B**
- backannotation file format ..... 117
- background ..... 53
- backup ..... 25, 53, 58
- bell ..... 60
- bill of materials ..... 27
- bloat ..... 53
- bom ..... 27
- buffer, an example ..... 24
- buffer, convert contents to element ..... 23
- Buffer, popup menu ..... 14
- buffer, selecting a ..... 65
- button translations ..... 59
  
- C**
- cat ..... 54, 57
- centering ..... 62
- centroid file format ..... 115
- centroid file, algorithms ..... 115
- change active layer ..... 15
- change drawing layer ..... 68
- change object name ..... 61
- change settings ..... 68
- change sizes ..... 60, 61
- change square flag ..... 61
- change viewing side ..... 68
- changing layers ..... 25
- changing pin/pad names ..... 61
- clearance ..... 9
- clearance, changing of objects ..... 60
- clearance, for new lines ..... 13
- clipping lines to 45 degree ..... 53, 62
- closing a polygon ..... 66
- cnc ..... 27
- color printout ..... 26
- color, warning ..... 59
- colors ..... 53, 54, 55, 56, 58, 59
- command-line options ..... 39
- compile, how to ..... 103
- configure ..... 103
- connection, removing an ..... 69
- connections, colors ..... 53
- connections, creating list of ..... 30
- connections, resetting ..... 62
- connections, resetting after element ..... 57
- connections, searching for ..... 62
- Connects, popup menu ..... 14
- copy an object ..... 70
- copying objects ..... 65
- copying, an example ..... 24
- creating objects ..... 20
- cursor color ..... 54
- cursor movements ..... 65
- cursor position ..... 64
- cursor steps ..... 55
- cutting objects ..... 65
  
- D**
- DEC ..... 104
- default font ..... 55
- default layout size ..... 58
- default library ..... 56
- default text scaling ..... 58
- default translations ..... 69
- design rule checker, invoking ..... 14
- design rule checking ..... 32, 63
- device, selecting an output ..... 25
- directory /tmp ..... 25, 58
- dispersing elements ..... 62
- display ..... 58
- displaying element names ..... 13, 62
- displaying pinout ..... 62
- displaying status information ..... 15
- distributing elements ..... 62
- DOS filenames ..... 26
- drawing objects ..... 19
- drc ..... 32, 53, 58, 63
- drill ..... 67
- drill report ..... 14
- drill sizes, list of standard ..... 111
- Drill table ..... 34
- drill-helper ..... 49

drilling hole, changing of objects . . . . . 60  
 drilling hole, setting of initial size . . . . . 68

## E

Edit, popup menu . . . . . 13  
 element name, hiding . . . . . 68  
 element name, removing from silk-screen . . . . . 68  
 Element Search . . . . . 109  
 element, an example . . . . . 22  
 element, an overview . . . . . 6  
 element, color . . . . . 54, 55  
 element, command . . . . . 54  
 element, creating a new package . . . . . 23  
 element, display names of . . . . . 13, 62  
 element, editing . . . . . 14  
 element, file format . . . . . 72  
 element, files . . . . . 54  
 element, move name of . . . . . 70  
 elements, dispersing . . . . . 62  
 elements, distributing . . . . . 62  
 encapsulated postscript . . . . . 29  
 entering user commands . . . . . 38  
 eps . . . . . 29  
 erasing objects . . . . . 19  
 example files . . . . . 23  
 example of buffer handling . . . . . 24  
 example of connection lists . . . . . 30  
 example of copying . . . . . 24  
 example of creating an element . . . . . 23  
 example of element handling . . . . . 22  
 example of line handling . . . . . 21  
 example of loading . . . . . 25  
 example of loading an element file . . . . . 23  
 example of moving . . . . . 24  
 example of pastebuffer handling . . . . . 24  
 example of pin handling . . . . . 23  
 example of polygon handling . . . . . 21  
 example of printing . . . . . 25  
 example of rectangle handling . . . . . 21  
 example of saving . . . . . 25  
 example of text handling . . . . . 22  
 example of via handling . . . . . 22  
 exit . . . . . 66  
 Exporting a layout . . . . . 27

## F

file format, element data . . . . . 72  
 file format, font data . . . . . 72  
 file format, layout data . . . . . 71  
 file format, libraries . . . . . 74  
 file format, library contents . . . . . 74  
 file formats . . . . . 71  
 file formats, pads and lines . . . . . 71  
 file load command . . . . . 54  
 file save command . . . . . 57  
 File syntax . . . . . 75

File, popup menu . . . . . 12  
 flags, changing . . . . . 60  
 flags, clearing . . . . . 62  
 flags, setting . . . . . 67  
 font command . . . . . 54  
 font file, format of . . . . . 72  
 font files . . . . . 54, 55  
 font, an overview . . . . . 5  
 font, used for pin names . . . . . 56  
 format of element files . . . . . 72  
 format of font files . . . . . 72  
 format of layout files . . . . . 71  
 format of libraries . . . . . 74  
 format of library contents . . . . . 74  
 FreeBSD . . . . . 105

## G

g-code . . . . . 27  
 gcode . . . . . 27  
 gEDA, how to interface with . . . . . 99  
 gerber . . . . . 29  
 glossary . . . . . 165  
 GNU build system . . . . . 103  
 GNU configure script . . . . . 103  
 grid . . . . . 18, 53, 55  
 grid color . . . . . 55  
 grid, absolute and relative . . . . . 62  
 grid, alignment . . . . . 13  
 grid, display . . . . . 13, 62  
 grid, setting of . . . . . 68  
 groups . . . . . 55  
 groups, editing of . . . . . 63  
 gschem, how to interface with . . . . . 99  
 gsvit . . . . . 30

## H

header, an overview . . . . . 5  
 Hewlett Packard . . . . . 104  
 hide element name . . . . . 68  
 how to start . . . . . 12  
 HP . . . . . 104

## I

image export . . . . . 29  
 index of terms . . . . . 165  
 Info, popup menu . . . . . 14  
 information about objects . . . . . 67  
 input-field, position of . . . . . 15  
 inputfield, saving entered command-line . . . . . 58  
 inputfield, start user input . . . . . 62  
 install, how to . . . . . 103  
 ipc-d-356 . . . . . 30

**K**

key translations . . . . . 59  
 keyboard bell . . . . . 57

**L**

layer controls . . . . . 15  
 layer groups . . . . . 8  
 layer visibility, toggling . . . . . 68  
 layer, change active . . . . . 68  
 layer, name of . . . . . 55  
 layers, an overview . . . . . 7  
 layers, changing which is active . . . . . 15  
 layers, colors . . . . . 55  
 layers, editing of groups . . . . . 63  
 layers, groups . . . . . 55  
 layers, switching on/off . . . . . 15  
 layout files . . . . . 54, 57  
 layout files, format of . . . . . 71  
 layout objects, an overview . . . . . 5  
 layout, default size of . . . . . 58  
 layout, printing a . . . . . 66  
 layout, start a new . . . . . 65  
 layout-name . . . . . 6  
 length of a pin name . . . . . 56  
 library accuracy . . . . . 7  
 library command . . . . . 55  
 library contents command . . . . . 56  
 library contents file, format of . . . . . 74  
 library creation . . . . . 91  
 library file, format of . . . . . 74  
 library name . . . . . 56  
 library searchpath . . . . . 56  
 library window . . . . . 19  
 lines, an example . . . . . 21  
 lines, an overview . . . . . 8  
 lines, clipping to 45 degree . . . . . 53, 62  
 lines, setting of initial size . . . . . 68  
 lines, size . . . . . 56  
 Linux . . . . . 105  
 listing library contents . . . . . 56  
 loading elements . . . . . 54, 55  
 loading files . . . . . 64  
 loading fonts . . . . . 54, 55  
 loading layouts . . . . . 54  
 loading symbols . . . . . 54, 55  
 loading, an example . . . . . 25  
 log window . . . . . 18, 57, 58

**M**

m4 . . . . . 54  
 m4, preprocessing example files . . . . . 23  
 mark . . . . . 64  
 Measuring distances . . . . . 34  
 media . . . . . 56  
 media margin . . . . . 56  
 media, size of . . . . . 26

menus . . . . . 12  
 messages . . . . . 18, 57, 58  
 mirroring printout . . . . . 25  
 mode selection . . . . . 16  
 mode, selecting of . . . . . 64  
 mounting holes . . . . . 61  
 move . . . . . 57  
 move an object . . . . . 70  
 moving objects . . . . . 31  
 moving objects to current layer . . . . . 65  
 moving, an example . . . . . 24  
 moving, traces to a different layer . . . . . 25  
 multi-file . . . . . 49

**N**

name of an element . . . . . 62  
 name, change an objects . . . . . 61  
 namelength of pins . . . . . 56  
 nelma . . . . . 29  
 NetBSD . . . . . 105  
 netlist . . . . . 10, 31, 57, 59, 62  
 Netlist Window . . . . . 19  
 netlist, file format . . . . . 73  
 netlist, reading . . . . . 73

**O**

object report . . . . . 14  
 object, change name of . . . . . 61  
 object, changing the size of an . . . . . 20  
 object, copy an . . . . . 70  
 object, creating an . . . . . 20  
 object, drawing and removing . . . . . 19  
 object, move an . . . . . 70  
 object, removing an . . . . . 20, 69  
 objects, moving to current layer . . . . . 65  
 octagonal flag, changing . . . . . 60  
 octagonal flag, clearing . . . . . 62  
 octagonal flag, setting . . . . . 67  
 octagonal pins and vias . . . . . 61  
 off limit color . . . . . 56  
 offset of pinnames . . . . . 57  
 offset of pinout . . . . . 56  
 offset of printout . . . . . 26  
 old library . . . . . 7  
 only-visible . . . . . 50  
 OpenWindows . . . . . 104  
 operation modes, selecting of . . . . . 64  
 optimizer . . . . . 33  
 outline printout . . . . . 26  
 output device . . . . . 25  
 overlap, minimum . . . . . 32

**P**

pad specification . . . . . 71  
 pastebuffer, an example . . . . . 24

pastebuffer, convert contents to element . . . . . 23  
 pastebuffer, popup menu . . . . . 14  
 pastebuffer, selecting a . . . . . 65  
 path for element files . . . . . 54  
 path for font files . . . . . 55  
 path for layout files . . . . . 54  
 path for libraries . . . . . 56  
 PC UNIX . . . . . 104, 105  
 PCB, an overview . . . . . 4  
 photo-mask-colour . . . . . 51  
 photo-mode . . . . . 51  
 photo-plating . . . . . 51  
 photo-silk-colour . . . . . 51  
 pin color . . . . . 56  
 pin, name of . . . . . 56  
 pin/pad names, changing . . . . . 61  
 pinout, display of . . . . . 62  
 pinout, font to display pin names . . . . . 56  
 pinout, zoomfactor of display . . . . . 57  
 pins, an example . . . . . 23  
 pins, changing shape of . . . . . 61  
 png . . . . . 29  
 pointer, moving of . . . . . 65  
 polygon . . . . . 58  
 polygon point, go back to previous . . . . . 66  
 polygon, an example . . . . . 21  
 polygon, an overview . . . . . 9  
 polygon, closing a . . . . . 66  
 popping up menus . . . . . 12  
 postprocessing layout data . . . . . 57  
 postscript . . . . . 29  
 preprocessing element data . . . . . 54  
 preprocessing font data . . . . . 54  
 preprocessing layout data . . . . . 54  
 preventing loss of data . . . . . 25, 58  
 print command . . . . . 26  
 print media . . . . . 26, 56  
 print offset . . . . . 26  
 printing . . . . . 57  
 printing a layout . . . . . 66  
 printing, an example . . . . . 25  
 problems . . . . . 104  
 ps . . . . . 29  
 ps-bloat . . . . . 49  
 ps-invert . . . . . 49  
 psfade . . . . . 49

## Q

quit . . . . . 66

## R

rat-line . . . . . 31, 59, 62  
 rats nest . . . . . 31, 57, 59, 62  
 rats-nest . . . . . 10  
 recover . . . . . 66, 69  
 rectangle, an example . . . . . 21

redo . . . . . 13, 66  
 redrawing layout . . . . . 62  
 refreshing layout . . . . . 62  
 Regular Expressions . . . . . 109  
 removing connections . . . . . 69  
 removing objects . . . . . 19, 20, 69  
 removing selected objects . . . . . 67  
 report . . . . . 14, 67  
 resetting found connections . . . . . 57, 62  
 resources . . . . . 53  
 rotate . . . . . 57  
 rotating a buffer . . . . . 65  
 rotating printout . . . . . 25  
 Route Styles, popup menu . . . . . 13  
 routing style . . . . . 57, 67  
 rubber band . . . . . 13  
 rubberband . . . . . 57, 62

## S

saving connections . . . . . 67  
 saving files . . . . . 67  
 saving found connections . . . . . 62  
 saving last entered user command . . . . . 58  
 saving layouts . . . . . 25, 57, 58  
 saving, an example . . . . . 25  
 scaling a printout . . . . . 26  
 scanning connections . . . . . 62  
 schematic capture . . . . . 99  
 schematic frontend . . . . . 99  
 SCO . . . . . 104  
 screen-layer-order (EPS) . . . . . 50  
 script file, executing . . . . . 63  
 scrolling . . . . . 69  
 searching connections . . . . . 62  
 Searching for elements . . . . . 34  
 searchpath for element files . . . . . 54  
 searchpath for font files . . . . . 55  
 searchpath for layout files . . . . . 54  
 searchpath for libraries . . . . . 56  
 Select, popup menu . . . . . 14  
 selected object, removing an . . . . . 67  
 selected objects, changing sizes . . . . . 14  
 selected objects, removing . . . . . 14  
 selecting a buffer . . . . . 65  
 selecting a new tool . . . . . 16  
 selecting objects . . . . . 67  
 selecting, using the arrow tool . . . . . 31  
 selection . . . . . 67, 69  
 Settings, popup menu . . . . . 13  
 SGI . . . . . 104  
 show-legend . . . . . 50  
 shrink . . . . . 58  
 signal . . . . . 60  
 Silicon Graphics . . . . . 104  
 size of lines . . . . . 56  
 size of lines and vias . . . . . 67  
 size of vias . . . . . 58



sizes, changing of objects . . . . . 60, 61  
 snap to pins . . . . . 13  
 Solaris . . . . . 104  
 solder mask, viewing and editing . . . . . 13  
 spacing, minimum . . . . . 32  
 speaker volume . . . . . 59  
 square flag, changing . . . . . 60  
 square flag, changing of objects . . . . . 61  
 square flag, clearing . . . . . 62  
 square flag, setting . . . . . 67  
 standard drill sizes . . . . . 111  
 start user input . . . . . 62  
 starting Pcb . . . . . 39  
 starting a new layout . . . . . 65  
 status information . . . . . 15  
 strings, an example . . . . . 22  
 strings, an overview . . . . . 10  
 Sun . . . . . 104  
 symbols . . . . . 55  
 symbols, an overview . . . . . 5  
 Syntax, file . . . . . 75

## T

temporary files . . . . . 25, 58  
 terminology . . . . . 165  
 TeX, problems . . . . . 105  
 text, an example . . . . . 22  
 text, an overview . . . . . 10  
 text, default scaling . . . . . 58  
 thermal flag, changing . . . . . 60  
 thermal flag, clearing . . . . . 62  
 thermal flag, setting . . . . . 67  
 thickness of lines . . . . . 56  
 thickness of objects . . . . . 20  
 thickness of vias . . . . . 58  
 thickness, changing of objects . . . . . 61  
 toggle layer visibility . . . . . 68  
 tool selection . . . . . 16  
 tool, arrow . . . . . 31  
 Topological router . . . . . 37  
 Toporouter . . . . . 37  
 trace optimizer . . . . . 33  
 translations . . . . . 59, 69  
 troubleshooting . . . . . 104  
 two line mode . . . . . 8

## U

undo . . . . . 13, 69  
 undo, multi-action resources . . . . . 60  
 unique names . . . . . 13  
 unix command . . . . . 54, 55, 56, 57

unselect objects . . . . . 69  
 user commands . . . . . 38  
 user input . . . . . 69, 70

## V

vendor drill table . . 60, 120, 125, 131, 134, 148, 149  
 Vendor drill table . . . . . 34  
 vendor drill table, disabling . . . . . 62  
 vendor drill table, enabling . . . . . 63  
 vendor drill table, loading . . . . . 64  
 vendor drill table, toggling . . . . . 68  
 vendor drill table, unloading . . . . . 69  
 vendor map . . . . . 60, 120, 125, 131, 134, 148, 149  
 vendor map, disabling . . . . . 62  
 vendor map, enabling . . . . . 63  
 vendor map, loading . . . . . 64  
 vendor map, toggling . . . . . 68  
 vendor map, unloading . . . . . 69  
 Vendor mapping . . . . . 34  
 Vendor rules . . . . . 34  
 vias, an example . . . . . 22  
 vias, an overview . . . . . 5  
 vias, changing shape of . . . . . 61  
 vias, color . . . . . 58  
 vias, converting to mounting hole . . . . . 61  
 vias, setting of initial size . . . . . 68  
 vias, size . . . . . 58  
 View, popup menu . . . . . 13  
 viewing side, changing of . . . . . 68  
 volume of speaker . . . . . 59

## W

Window, popup menu . . . . . 14

## X

x-y file format . . . . . 115  
 x-y file, algorithms . . . . . 115  
 X11 . . . . . 53  
 X11 default translations . . . . . 69  
 X11 resources . . . . . 53  
 X11 translations . . . . . 59  
 X11, problems . . . . . 105  
 xcircuit, how to interface with . . . . . 102

## Z

zoom of Layout area . . . . . 59  
 zoom of pinout window . . . . . 57  
 zoom, setting . . . . . 13  
 zoom, setting of . . . . . 68